



CONSTRUCTION EQUIPMENT

702238 ALTA RENTS VOLVO A30G 753625 - TRANSMISSION (AUTO)



Sample No: VCP443777
Oil Type: VOLVO AUTOMATIC TRANSMISSION FLUID AT102
Job No: 702238 ALTA RENTS



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC
 8418 PALM RIVER ROAD
 TAMPA, FL
 US 33619
 Contact: KENNY HANEY
 khaney@flaglerce.com
 T: (813)630-0077
 F: (813)630-2233



SAMPLE INFORMATION

Sample Number	VCP443777	---	---	---
Sample Date	17 Apr 2024	---	---	---
Machine Hours	746	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Not Chngd	---	---	---
Sample Status	NORMAL	---	---	---



OIL CONDITION

Visc @ 40°C	cSt	█ 28.8	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 13	---	---	---
Sodium	ppm	█ 5	---	---	---
Potassium	ppm	█ 4	---	---	---



WEAR METALS

Iron	ppm	█ 23	---	---	---
Copper	ppm	█ 31	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 5	---	---	---
Aluminum	ppm	█ 15	---	---	---
Chromium	ppm	█ <1	---	---	---
Molybdenum	ppm	█ 0	---	---	---
Nickel	ppm	█ 4	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ 3	---	---	---
Vanadium	ppm	<1	---	---	---



ADDITIVES

Calcium	ppm	█ 73	---	---	---
Magnesium	ppm	█ <1	---	---	---
Zinc	ppm	█ 5	---	---	---
Phosphorus	ppm	█ 183	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 79	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the fluid. The condition of the fluid is acceptable for the time in service.

Depot: VOLVO0093
Unique No: 10991907
Signed: Jonathan Hester
Report Date: 24 Apr 2024



CONSTRUCTION EQUIPMENT




GRAPHS

Iron (ppm)



Lead (ppm)

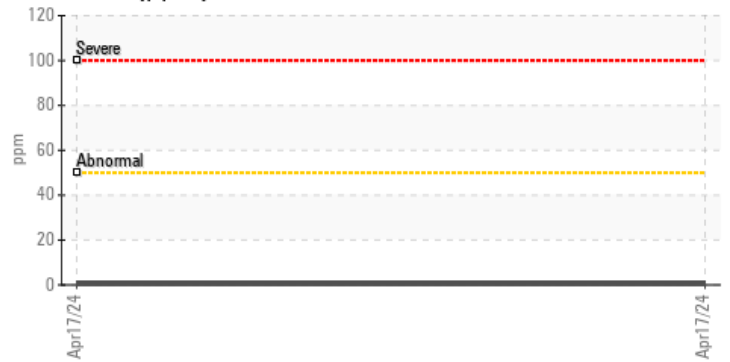

Aluminum (ppm)




Chromium (ppm)




Copper (ppm)



Silicon (ppm)

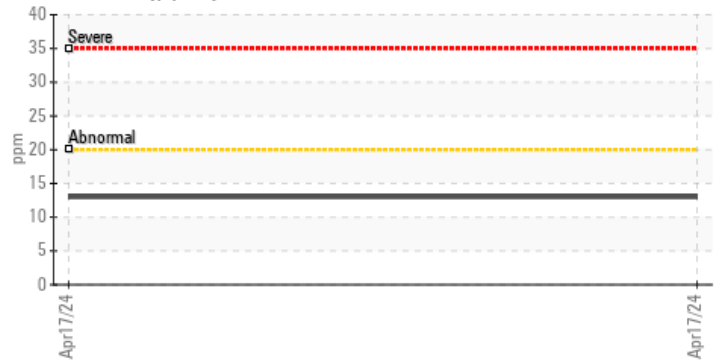

Viscosity @ 40°C

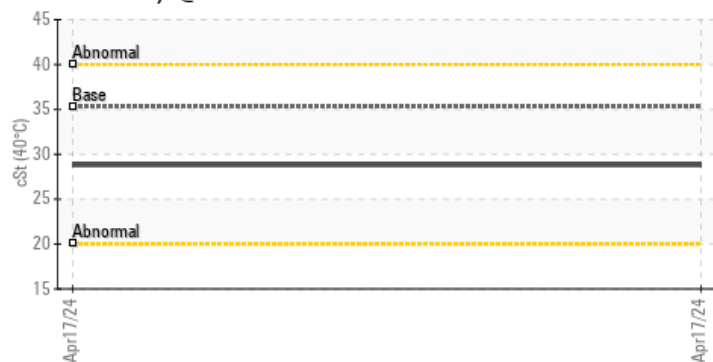

Additives

