CONSTRUCTION EQUIPMENT 337558 VOLVO A25G 752581 - FRONT AXLE



Sample No:	VCP437854
Oil Type:	GEAR OIL SAE 80W140
Job No:	337558

SAMPLE INFORMATION

OLA

Calcium

Zinc

Barium

Boron

Magnesium

Phosphorus

ADDITIVES

ppm

ppm

ppm

ppm

ppm

ppm

VOLVO

	INF UNITA LIUI			
Sample Number		VCP437854	 	
Sample Date		22 Apr 2024	 	
Machine Hours		1662	 	
Oil Hours		0	 	
Oil Changed		N/A	 	
Sample Status		NORMAL	 	
OIL COND	DITION			
Visc @ 40°C	cSt	250	 	
CONTAM	INATION			
Water	%	NEG	 	
Silicon	ppm	3	 	
Sodium	ppm	0	 	
Potassium	ppm	0	 	
WEAR M	ETALS			
Iron	ppm	155	 	
Copper	ppm	1 3	 	
Lead	ppm	0	 	
Tin	ppm		 	
Aluminum	ppm	0	 	
Chromium	ppm	2	 	
Molybdenum	ppm	 <1	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	4	 	
Vanadium	ppm	0	 	

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC

8418 PALM RIVER ROAD TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077 F: (813)630-2233

Diagnosis

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 80W140. Please confirm. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot:	VOLVO0093
Unique No:	10994876
Signed:	Wes Davis
Report Date:	25 Apr 2024
Contact/Location: KENNY	HANEY - VOLVO0093

149

0

62

0 207


1175

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

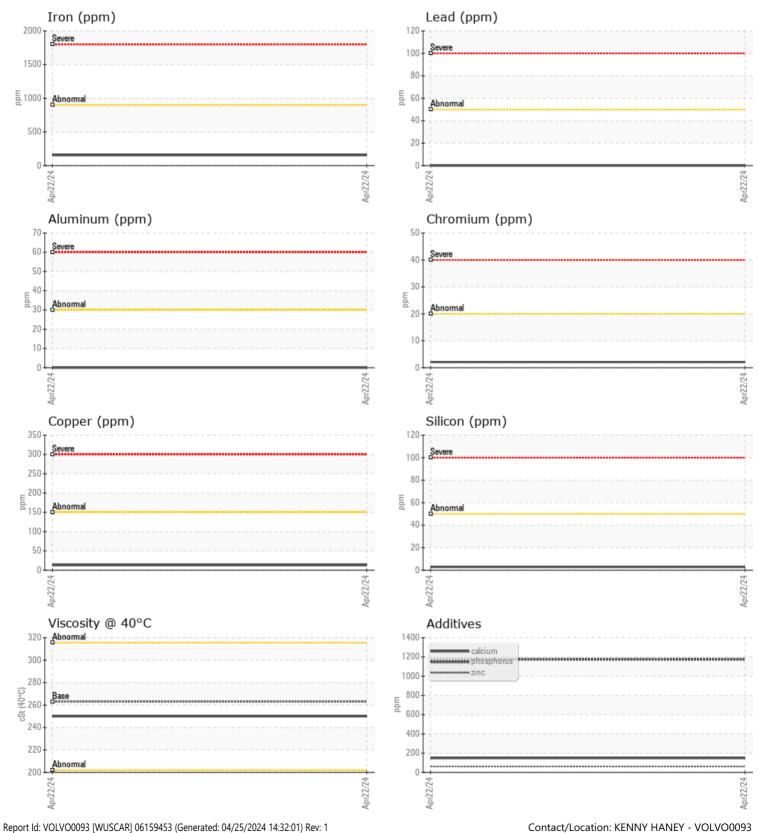

Page 2 of 2