CONSTRUCTION EQUIPMENT SPM701872 VOLVO L350H 1011 - FRONT AXLE




Sample No:VCP427268Oil Type:VOLVO WET BRAKE TRANSAXLE OILJob No:SPM701872

SAMPLE INFORMATION

VOLVO

Sample Number		VCP427268	VCP405991	
Sample Date		15 Apr 2024	18 May 2023	
Machine Hours		9455	6873	
Oil Hours		0	0	
Oil Changed		Changed	Changed	
Sample Status		NORMAL	NORMAL	
OIL CONDI	TION			
Visc @ 40°C	cSt	∎41.0	42.7	
CONTAMI	NATION			
Water	%	NEG	NEG	
Silicon	ppm	11	15	
Sodium	ppm	 <1	4	
Potassium	ppm	0	0	
WEAR ME	TALS			

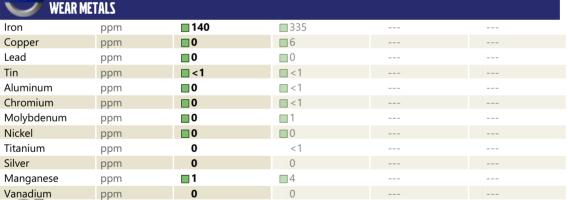



101 **ADDITIVES** Calcium 2760 2317 ppm Magnesium **10** 16 ppm 1147 Zinc ppm 1324 Phosphorus 1113 949 ppm Barium 1 0 ppm 86 Boron 31 ppm



ALTA EQUIPMENT CO - ORLAND PARK

5000 INDUSTRIAL HWY GARY, IN US 46406 Contact: DAVE ENG DAVE.ENG@ALTG.COM T: (312)350-2560 E:

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

 Depot:
 VOLVO8885

 Unique No:
 10996149

 Signed:
 Don Baldridge

 Report Date:
 29 Apr 2024


 Contact/Location: DAVE ENG - VOLVO8885

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

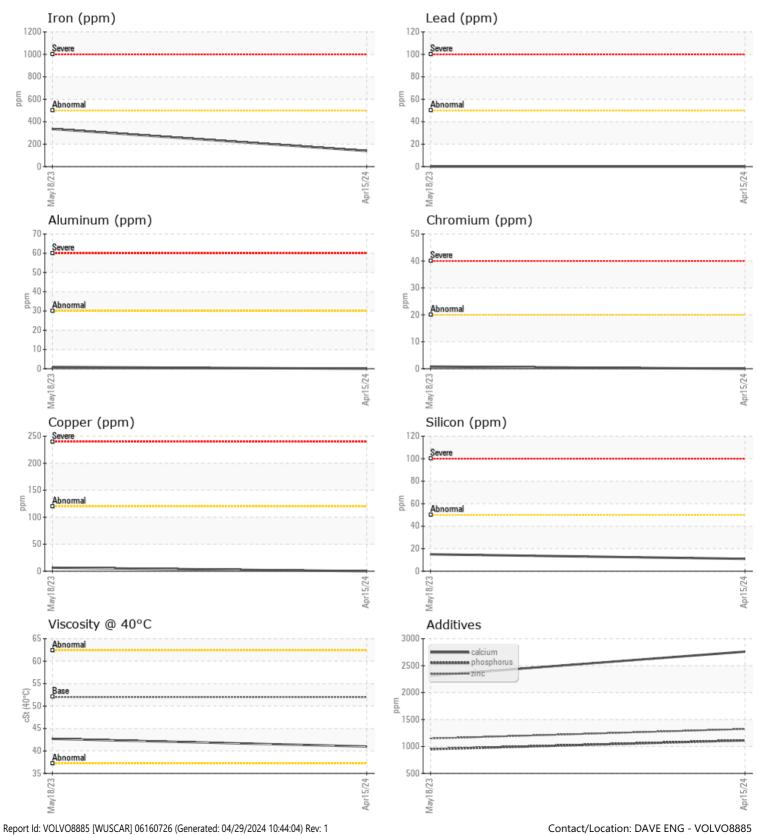

Page 2 of 2