


CONSTRUCTION EQUIPMENT
700977 DETROIT IRON VOLVO EC350 310600 - HYDRAULIC SYSTEM

Sample No: VCP443768

Oil Type: **VOLVO SUPER HYDRAULIC OIL 46**

Job No: 700977 DETROIT IRON

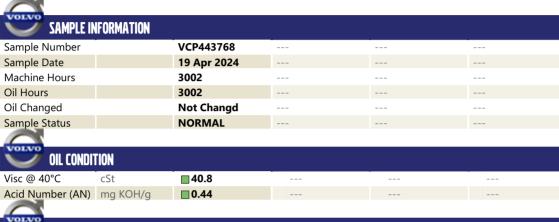

CONTAMINATION							
Water	%	NEG					
Particles >4µm	1	25954					
Particles >6µm	1	7619					
Particles > 14µr	m	635					
ISO 4406:1999 (c)		22/20/16					
Silicon	ppm	■ 2					
Sodium	ppm	2					
Potassium	ppm	■ 0					

WEAR METALS						
Iron	ppm	11				
Copper	ppm	18				
Lead	ppm	0				
Tin	ppm	■ 0				
Aluminum	ppm	0				
Chromium	ppm	2				
Molybdenum	ppm	0				
Nickel	ppm	■ 0				
Titanium	ppm	0				
Silver	ppm	0				
Manganese	ppm					
Vanadium	ppm	0				

ADDIT	IVES			
Calcium	ppm	55	 	
Magnesium	ppm	■0	 	
Zinc	ppm	423	 	
Phosphorus	ppm	■322	 	
Barium	ppm	■ 0	 	
Boron	ppm	■0	 	



ALTA EQUIPMENT COMPANY - METRO WEST 56195 PONTIAC TRAIL NEW HUDSON, MI US 48165 Contact: PAUL CONZ paul.conz@altg.com T: (313)348-8861 F: (248)356-2029

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

Depot: VOLVO2990 **Unique No:** 10996802 Signed: Wes Davis Report Date: 29 Apr 2024



CONSTRUCTION EQUIPMENT





GRAPHS

