



# CONSTRUCTION EQUIPMENT

## VOLVO A40G 353267 - TRANSMISSION (AUTO)



**Sample No:** VCP445625  
**Oil Type:** VOLVO AUTOMATIC TRANSMISSION FLUID AT102  
**Job No:**



### SAMPLE INFORMATION

Sample Number	VCP445625	---	---	---
Sample Date	25 Apr 2024	---	---	---
Machine Hours	2215	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	ABNORMAL	---	---	---

**ALTA EQUIPMENT COMPANY**  
 5151 DR MARTIN LUTHER KING BLVD  
 FORT MYERS, FL  
 US 33905  
 Contact: TODD LARK  
 tlark@altaequipfl.com  
 T:  
 F: (239)481-3302



### OIL CONDITION

Visc @ 40°C	cSt	█ 28.3	---	---	---
-------------	-----	--------	-----	-----	-----



### CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 5	---	---	---
Sodium	ppm	█ 3	---	---	---
Potassium	ppm	█ <1	---	---	---

**Diagnosis**  
 Oil and filter change at the time of sampling has been noted. Resample at the next service interval to monitor. All component wear rates are normal. Moderate concentration of visible dirt/debris present in the fluid. The condition of the fluid is acceptable for the time in service.



### WEAR METALS

Iron	ppm	█ 20	---	---	---
Copper	ppm	█ 8	---	---	---
Lead	ppm	█ 0	---	---	---
Tin	ppm	█ <1	---	---	---
Aluminum	ppm	█ 8	---	---	---
Chromium	ppm	█ 0	---	---	---
Molybdenum	ppm	█ 0	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ 1	---	---	---
Vanadium	ppm	0	---	---	---



### ADDITIVES

Calcium	ppm	█ 89	---	---	---
Magnesium	ppm	█ 0	---	---	---
Zinc	ppm	█ 0	---	---	---
Phosphorus	ppm	█ 197	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 92	---	---	---

**Depot:** VOLVO0090  
**Unique No:** 11005697  
**Signed:** Jonathan Hester  
**Report Date:** 03 May 2024



# CONSTRUCTION EQUIPMENT



## GRAPHS


### Iron (ppm)




### Lead (ppm)



### Aluminum (ppm)

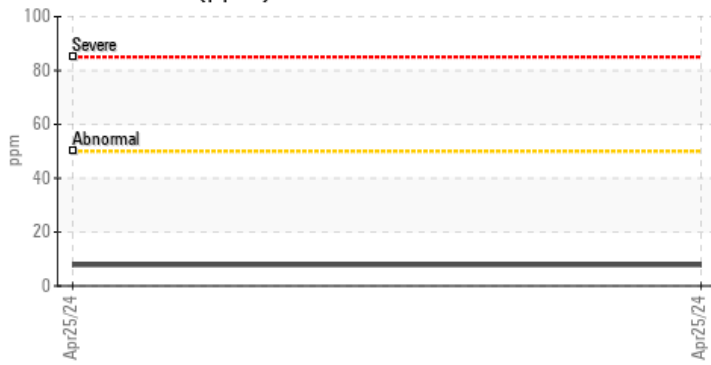


### Chromium (ppm)

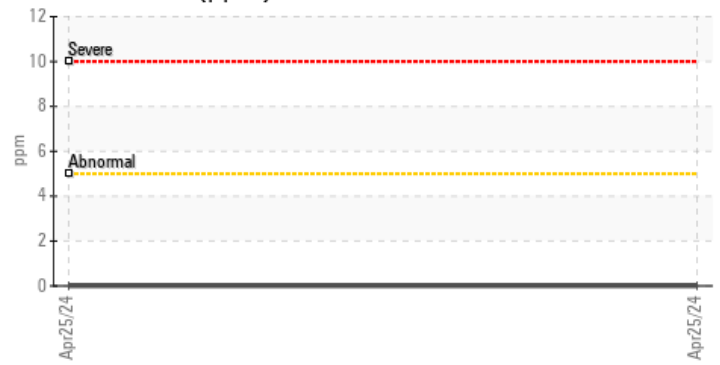

### Copper (ppm)



### Silicon (ppm)

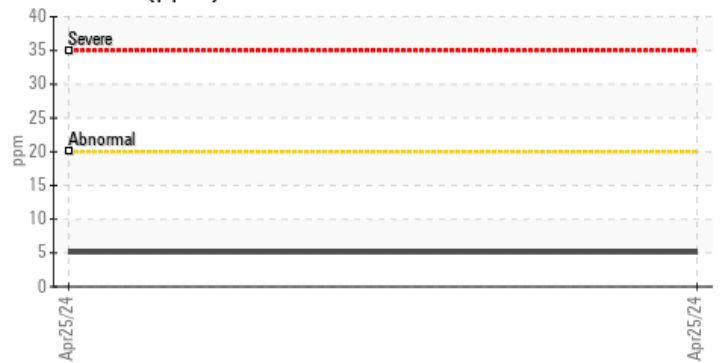

### Viscosity @ 40°C



### Additives

