

## CONSTRUCTION EQUIPMENT VOLVO L70G 614117 - DIESEL ENGINE



## VCP455284 Sample No:

**Oil Type:** VOLVO ULTRA DIESEL ENGINE OIL 15W40 VDS-3

Job	No:

SAMPLE IN	IFORMATION				and a second second
Sample Number		VCP455284		 	
Sample Date		30 Apr 2024		 	ALTA EQUIPMENT COMPAN
Machine Hours		4104		 	5151 DR MARTIN LUTHER KIN
Oil Hours		0		 	FORT MYERS, FL
Oil Changed		Changed		 	US 33905
Sample Status		ABNORMAL		 	Contact: TODD LARK
					tlark@altaequipfl.com
					T:
				-	F: (239)481-3302
Visc @ 100°C	cSt	▲ 12.3		 	
Base Number (BN)		■ 8.0		 	Diagnosis
Oxidation (PA)	%	55		 	•
VOLVO					Oil and filter change at the t
CONTAMIN	ATION				sampling has been noted. Re at the next service interval to
Water	%	NEG		 	monitor.The aluminum level
Soot %	%	0.3		 	abnormal. All other compon
Nitration (PA)	%	61		 	rates are normal. Fuel conte
, ,	%	49			negligible. There is no indica
Sulfation (PA)		49 NEG		 	any contamination in the oil
Glycol Fuel	%				viscosity is lower than norm
Silicon		1.7		 	BN result indicates that ther
	ppm	<b>4</b>		 	suitable alkalinity remaining
Sodium	ppm	□<1		 	
Potassium	ppm	0		 	
VOLVO					
WEAR MET	ALS		<u> </u>	-	
Iron	ppm	21		 	
Copper	ppm	<b>1</b>		 	
Lead	ppm	0		 	
Tin	ppm	0		 	
Aluminum	ppm	<u> </u>		 	
Chromium	ppm	<b>■</b> <1		 	
Molybdenum	ppm	55		 	
Nickel	ppm	0		 	
Titanium	ppm	0		 	
Silver	ppm	0		 	
Manganese	ppm	■ <1		 	
Vanadium	ppm	0		 	
Calcium	ppm	<b>1394</b>		 	
Magnesium	ppm	697		 	
Zinc	ppm	1220		 	
Phosphorus	ppm	1022		 	
Barium	ppm	0		 	Depot: VOLVO0090
Boron	ppm	2		 	Unique No: 11006047



## COMPANY

THER KING BLVD m


e at the time of noted. Resample nterval to um level is component wear lel content no indication of in the oil. The oil an normal. The that there is emaining in the oil.

## **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

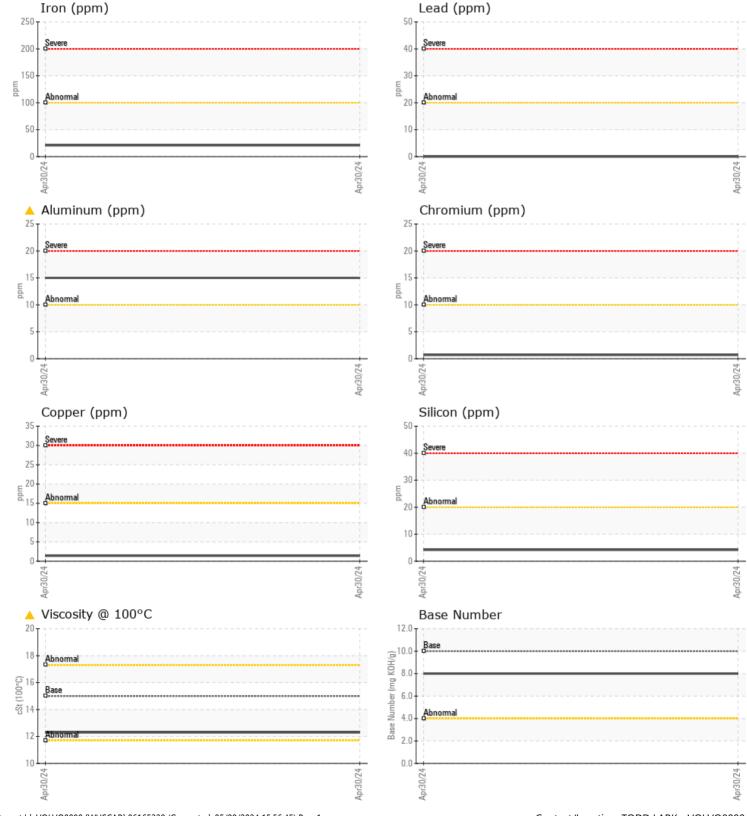

Report Id: VOLVO0090 [WUSCAR] 06165328 (Generated: 05/08/2024 15:56:45) Rev: 1

Contact/Location: TODD LARK - VOLVO0090