



CONSTRUCTION EQUIPMENT

SWA534849-10 VOLVO A40G 342112 - COOLANT



Sample No: VCP445610
Oil Type: VOLVO COOLANT VCS (YELLOW)
Job No: SWA534849-10



SAMPLE INFORMATION

Sample Number	VCP445610	VCP0007906	VCP0006350	---
Sample Date	27 Apr 2024	29 Mar 2024	07 Feb 2023	---
Machine Hours	7700	7550	7550	---
Sample Status	NORMAL	NORMAL	NORMAL	---

ALTA EQUIPMENT COMPANY
8750 PHILIPS HWY
JACKSONVILLE, FL
US 32256
Contact: SHAWN NORTHCRAFT
shawn.northcraft@altg.com
T: (904)737-6000
F: (904)737-1260



COOLANT CONDITION

pH	Scale 0-14	7.41	7.67	7.48	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	NT	NT	NT	---
Percentage Glycol	%	47.1	47.5	47.3	---
Freezing Point	°C	-28	-28	-28	---

Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

Coolant Appearance	normal	normal	normal	---
Coolant Color	Yllow	Yllow	Yllow	---

Depot: VOLVO0092
Unique No: 11006967
Signed: Doug Bogart
Report Date: 02 May 2024




CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver

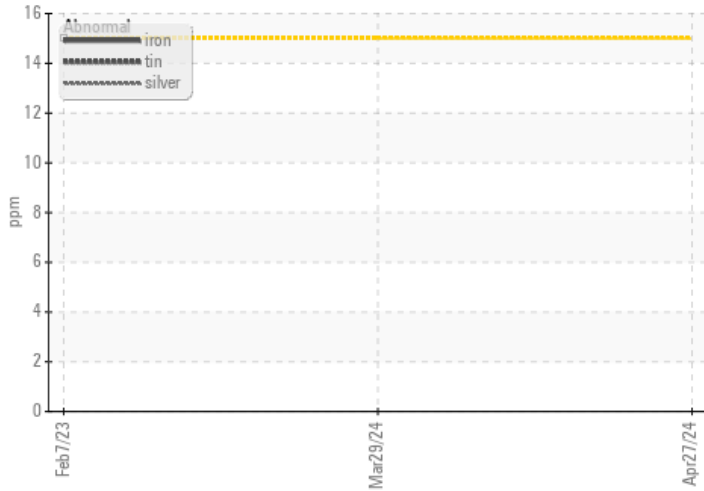


Reserve Alkalinity

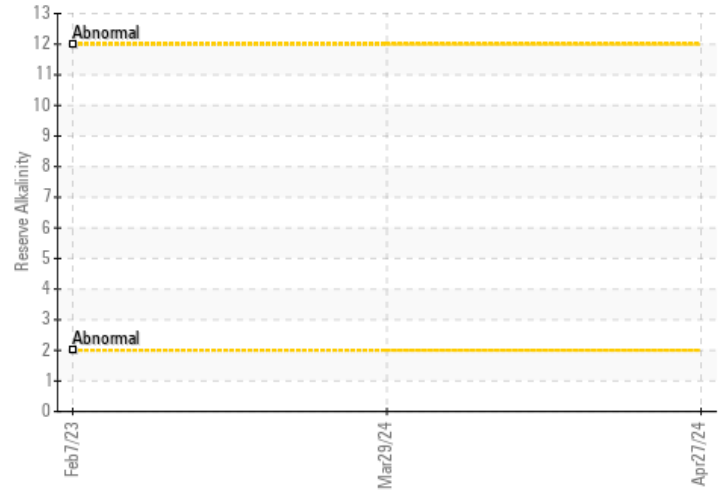


Copper/Aluminum/Lead

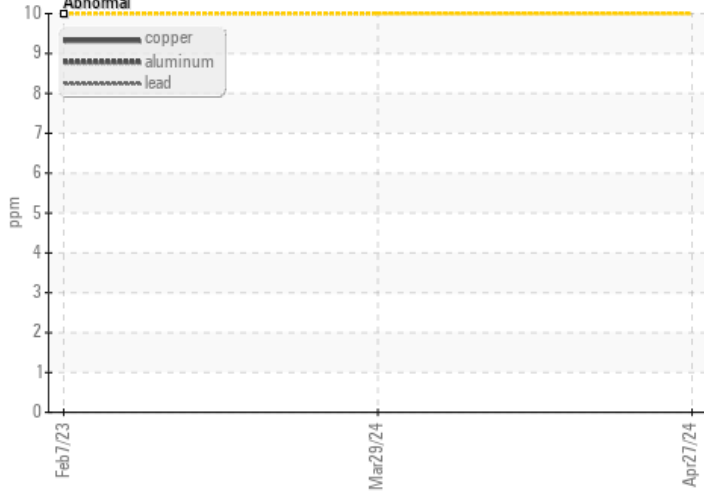

Freeze Point

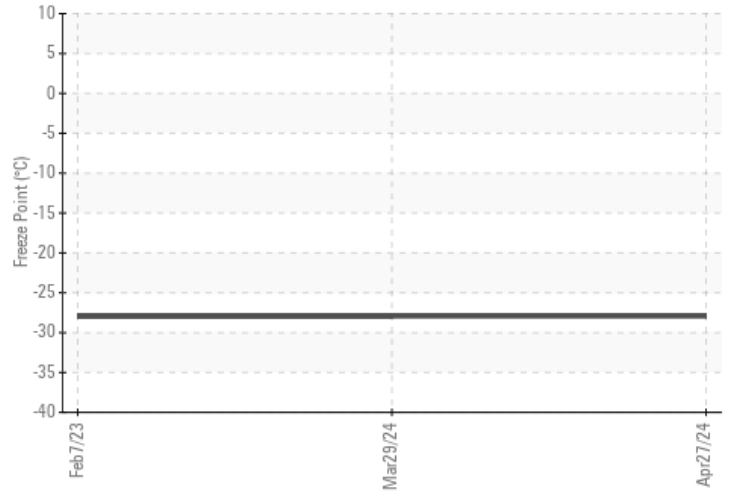

pH

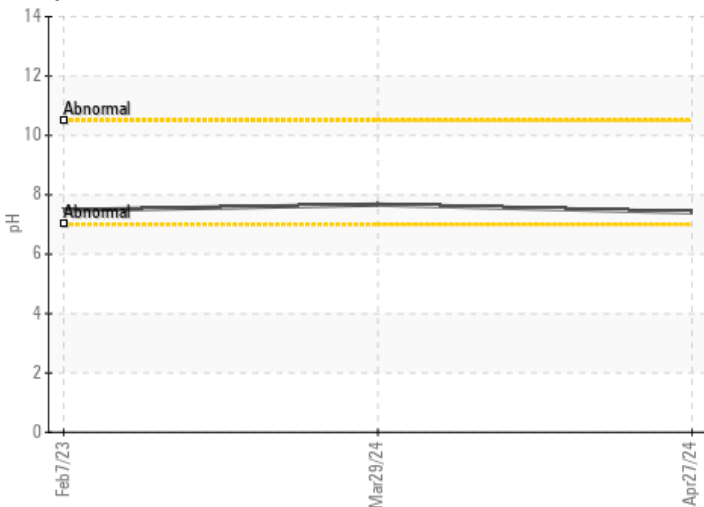

Nitrites

