



CONSTRUCTION EQUIPMENT

VOLVO A40G 342583 - COOLANT



Sample No: VCP0007890
Oil Type: EXTENDED LIFE COOLANT
Job No:



SAMPLE INFORMATION

Sample Number	VCP0007890	---	---	---
Sample Date	02 May 2024	---	---	---
Machine Hours	6881	---	---	---
Sample Status	NORMAL	---	---	---



COOLANT CONDITION

pH	Scale 0-14	■ 7.52	---	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	■ NT	---	---	---
Percentage Glycol	%	■ 45.0	---	---	---
Freezing Point	°C	■ -24	---	---	---



CONTAMINATION

Coolant Appearance	normal	---	---	---
Coolant Color	Orange	---	---	---

ALTA EQUIPMENT COMPANY
 8750 PHILIPS HWY
 JACKSONVILLE, FL
 US 32256
 Contact: TECHNICIAN ACCOUNT
 catherine.anastasio@wearcheck.com
 T:
 F: (904)737-1260

Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.

Depot: VOLVO0092
Unique No: 11016501
Signed: Jonathan Hester
Report Date: 08 May 2024

Submitted By: TECHNICIAN ACCOUNT



CONSTRUCTION EQUIPMENT




VOLVO GRAPHS


Iron/Tin/Silver




Reserve Alkalinity

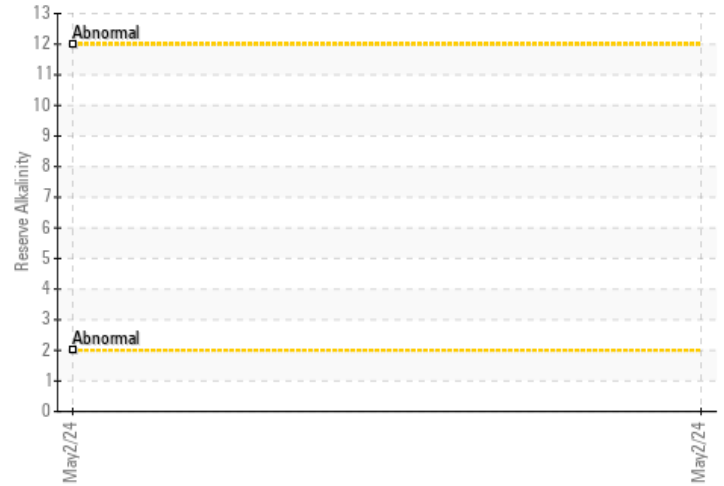

Copper/Aluminum/Lead

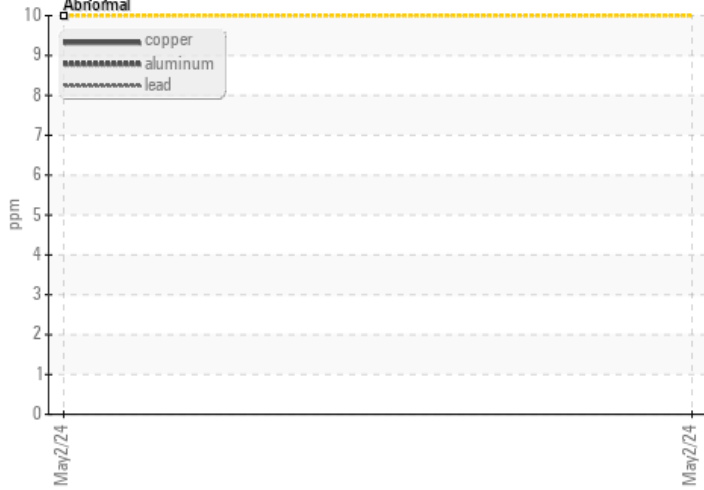

Freeze Point

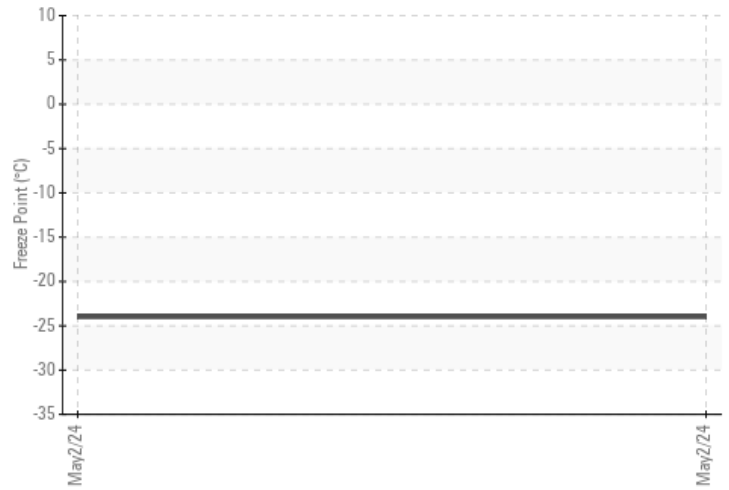

pH



Nitrites

