## CONSTRUCTION EQUIPMENT 715411 ALTA RENTS VOLVO A30G 753624 - HYDRAULIC SYSTEM

Sample No: VCP438422 Oil Type: VOLVO SUPER H

VOLVO

VOLVO SUPER HYDRAULIC OIL 46 715411 ALTA RENTS

CTRONIE CONTRACTOR						
SAMPLE IN	FORMATION					
Sample Number		VCP438422				
Sample Date		07 May 2024				
Machine Hours		489				
Oil Hours		0				
Oil Changed		Not Changd				
Sample Status		NORMAL				
OIL CONDITION						
Visc @ 40°C	cSt	<b>45.0</b>				
Acid Number (AN)	mg KOH/g	0.47				
	_					

CONTAI	MINATION			
Water	%	NEG	 	
Particles >4µm		3074	 	
Particles >6µm		943	 	
Particles >14µm		<b>70</b>	 	
ISO 4406:1999 (d	c)	19/17/13	 	
Silicon	ppm	2	 	
Sodium	ppm	<b>1</b>	 	
Potassium	ppm	0	 	

## WEAR METALS

Iron	ppm	2	 	
Copper	ppm	<b>4</b>	 	
Lead	ppm	<b></b> <1	 	
Tin	ppm		 	
Aluminum	ppm	0	 	
Chromium	ppm	0	 	
Molybdenum	ppm	0	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	<b>1</b>	 	
Vanadium	ppm	0	 	

VOLVO

Calcium	ppm	94				
Magnesium	ppm	0				
Zinc	ppm	451				
Phosphorus	ppm	351				
Barium	ppm	0				
Boron	ppm	0				



#### ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC

9601 BOGGY CREEK RD ORLANDO, FL US 32824 Contact: Robert LaPlante robert.laplante@altg.com T: (407)508-9736 F: (407)659-8720

### Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO0096

 Unique No:
 11023118

 Signed:
 Wes Davis


 Report Date:
 14 May 2024

# **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

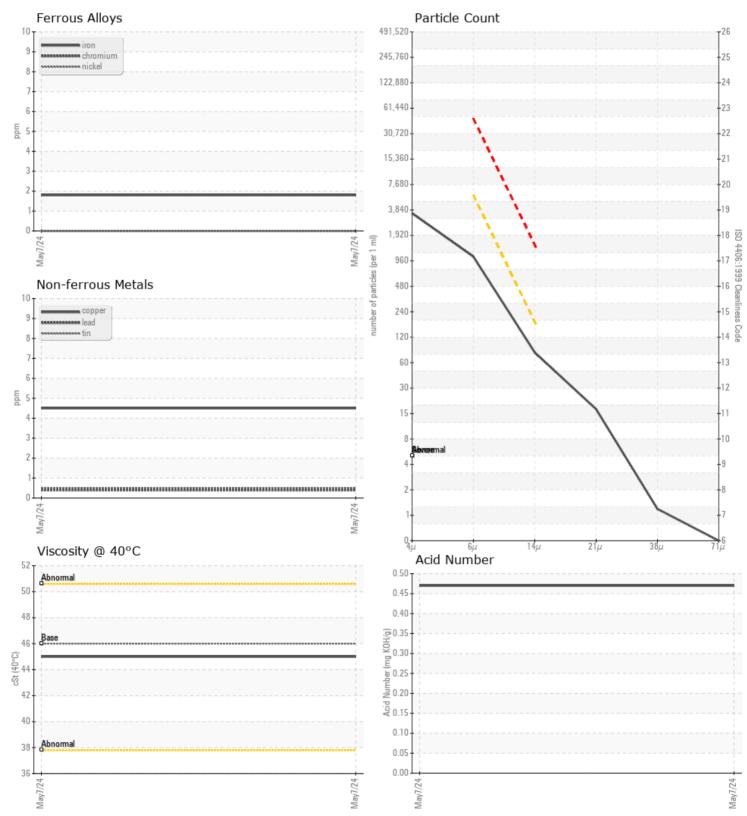

Contact/Location: Robert LaPlante - VOLVO0096