



CONSTRUCTION EQUIPMENT

715411 ALTA RENTS VOLVO A30G 753624 - DROP BOX



Sample No: VCP438409
Oil Type: VOLVO PREMIUM GEAR OIL 85W-140 GL-5
Job No: 715411 ALTA RENTS



ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC
 9601 BOGGY CREEK RD
 ORLANDO, FL
 US 32824
 Contact: Robert LaPlante
 robert.laplante@altg.com
 T: (407)508-9736
 F: (407)659-8720



SAMPLE INFORMATION

Sample Number	VCP438409	---	---	---
Sample Date	07 May 2024	---	---	---
Machine Hours	489	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Not Chngd	---	---	---
Sample Status	ATTENTION	---	---	---



OIL CONDITION

Visc @ 40°C	cSt	● 97.6	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	■ 5	---	---	---
Sodium	ppm	■ 2	---	---	---
Potassium	ppm	■ 2	---	---	---



WEAR METALS

Iron	ppm	■ 252	---	---	---
Copper	ppm	■ 10	---	---	---
Lead	ppm	■ 0	---	---	---
Tin	ppm	■ <1	---	---	---
Aluminum	ppm	■ <1	---	---	---
Chromium	ppm	■ 6	---	---	---
Molybdenum	ppm	■ 7	---	---	---
Nickel	ppm	■ 2	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	■ 12	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	■ 410	---	---	---
Magnesium	ppm	■ 0	---	---	---
Zinc	ppm	■ 174	---	---	---
Phosphorus	ppm	1375	---	---	---
Barium	ppm	■ <1	---	---	---
Boron	ppm	■ 292	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The oil viscosity is lower than normal. Confirm oil type.

Depot: VOLVO0096
Unique No: 11023584
Signed: Don Baldrige
Report Date: 15 May 2024




CONSTRUCTION EQUIPMENT




GRAPHS


Iron (ppm)

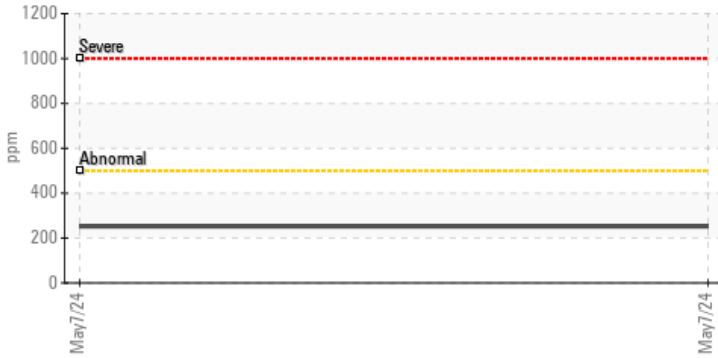


Lead (ppm)

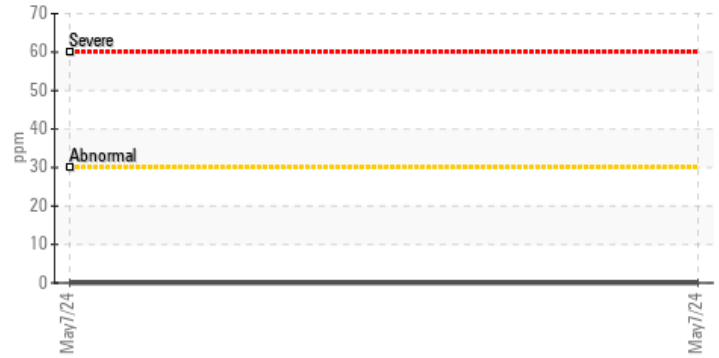


Aluminum (ppm)

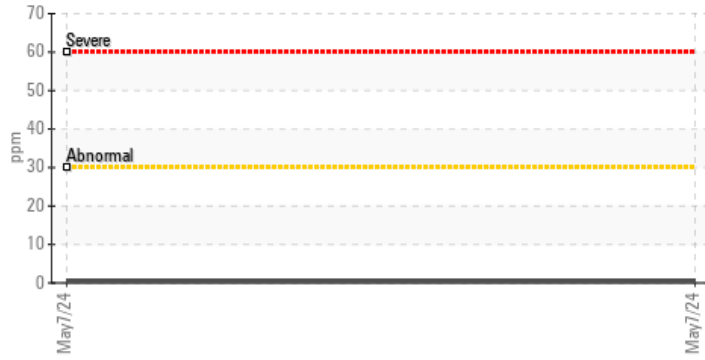

Chromium (ppm)

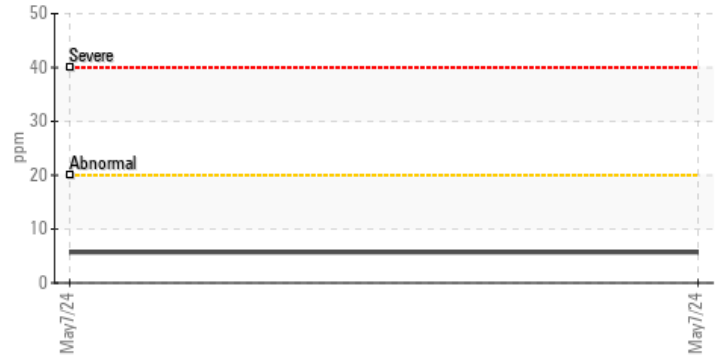


Copper (ppm)

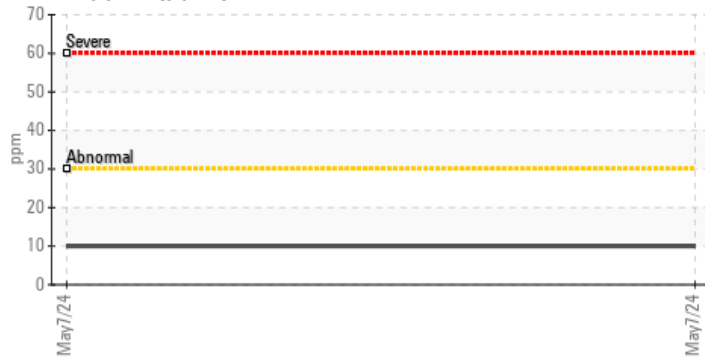

Silicon (ppm)



● Viscosity @ 40°C

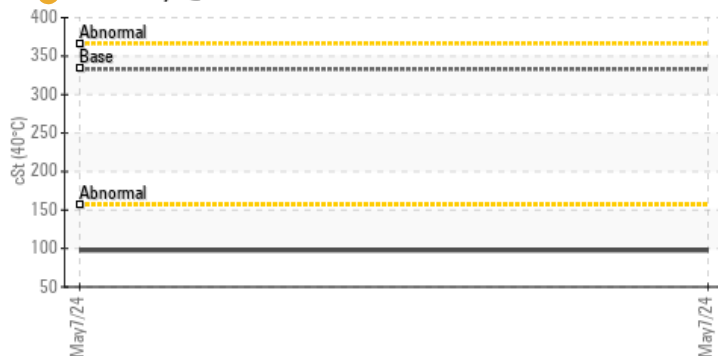

Additives

