



# CONSTRUCTION EQUIPMENT

RANGO HITACHI EX1200-7B 7358 - RIGHT FINAL DRIVE



**Sample No:** VCP267823  
**Oil Type:** GEAR OIL SAE 90  
**Job No:** RANGO



## SAMPLE INFORMATION

Sample Number	VCP267823	---	---	---
Sample Date	05 May 2024	---	---	---
Machine Hours	3823	---	---	---
Oil Hours	0	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	NORMAL	---	---	---

**ARNOLD MACHINERY COMPANY**  
 4323 EAST WINSLOW AVENUE  
 PHOENIX, AZ  
 US 85040  
 Contact: RANDY ALLEN  
 rallen@arnoldmachinery.com  
 T:  
 F: (602)414-1904



## OIL CONDITION

Visc @ 40°C	cSt	█ 108	---	---	---
-------------	-----	-------	-----	-----	-----



## CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 7	---	---	---
Sodium	ppm	█ 1	---	---	---
Potassium	ppm	█ 1	---	---	---



## WEAR METALS

Iron	ppm	█ 44	---	---	---
Copper	ppm	█ 6	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 0	---	---	---
Aluminum	ppm	█ <1	---	---	---
Chromium	ppm	█ 1	---	---	---
Molybdenum	ppm	█ <1	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	<1	---	---	---
Silver	ppm	<1	---	---	---
Manganese	ppm	█ 1	---	---	---
Vanadium	ppm	<1	---	---	---



## ADDITIVES

Calcium	ppm	█ 20	---	---	---
Magnesium	ppm	█ 0	---	---	---
Zinc	ppm	█ 6	---	---	---
Phosphorus	ppm	█ 1441	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 282	---	---	---

## Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

**Depot:** VOLVO6174  
**Unique No:** 11033418  
**Signed:** Wes Davis  
**Report Date:** 17 May 2024




# CONSTRUCTION EQUIPMENT




## GRAPHS


### Iron (ppm)

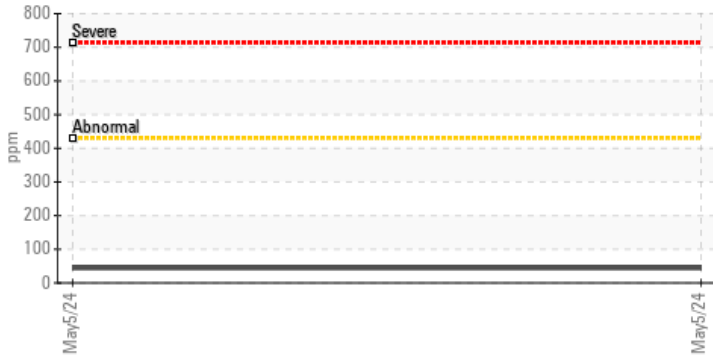

### Lead (ppm)

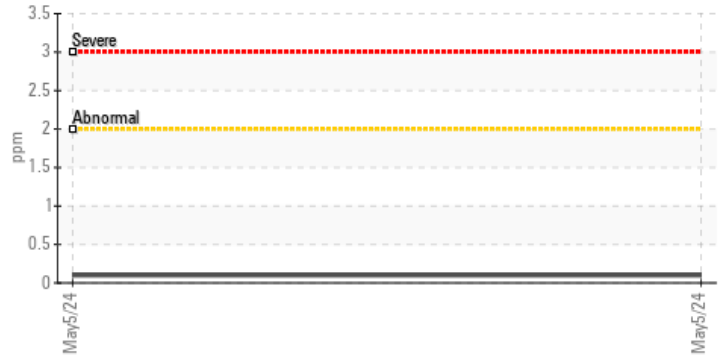


### Aluminum (ppm)

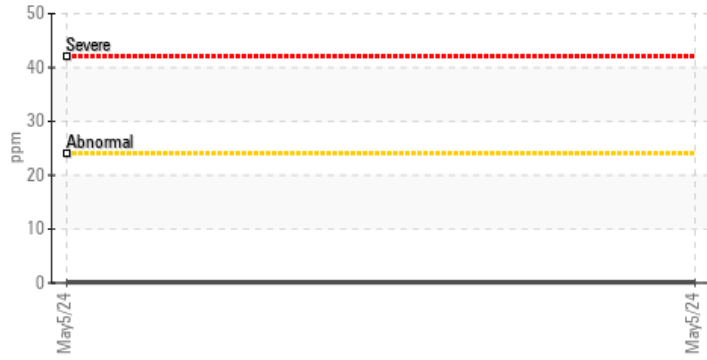


### Chromium (ppm)



### Copper (ppm)

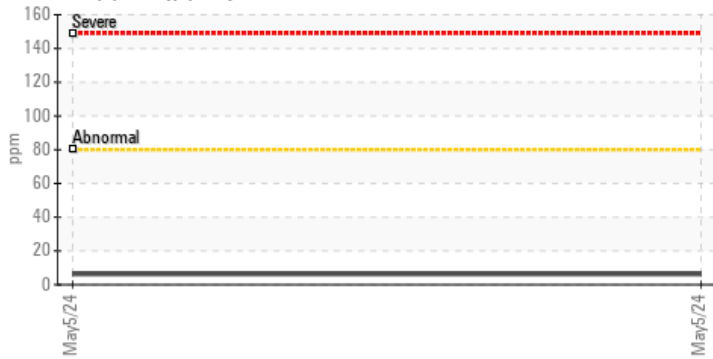

### Silicon (ppm)

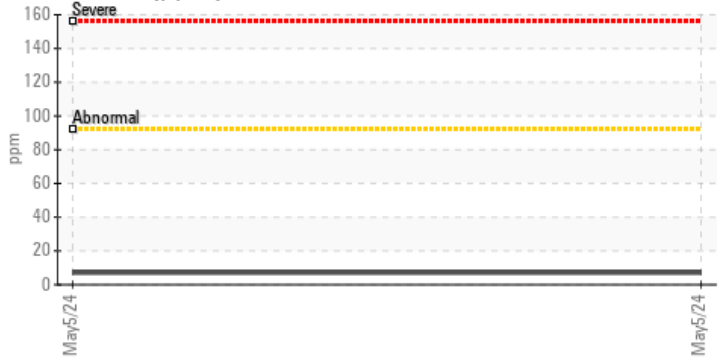

### Viscosity @ 40°C



### Additives

