CONSTRUCTION EQUIPMENT 560376 LKQ VOLVO L90H 626621 - REAR LEFT FINAL DRIVE

Sample No:VCP452795Oil Type:VOLVO WET BRAKE TRANSAXLE OILJob No:560376 LKQ

VCP452795

Sample Number

VOLVO

	15 May 2024							
	2089							
	0							
	Changed							
	NORMAL							
OIL CONDITION								
cSt	40.3							
CONTAMINATION								
%	NEG							
ppm	18							
ppm	5							
ppm	3							
TALS								
ppm	42							
ppm	8							
ppm	 <1							
	cSt IATION % ppm ppm ppm TALS ppm ppm	2089 0 Changed NORMAL TION cSt	2089 0 Changed NORMAL TION cSt 40.3 ATION % NEG ppm 18 ppm 3 TALS ppm 42 ppm 8	2089 0 Changed NORMAL TION cSt 40.3 MATION % NEG ppm 18 ppm 3 TALS ppm 42 ppm 8				



ALTA EQUIPMENT COMPANY

5210 REESE ROAD DAVIE, FL US 33314 Contact: N. FACEY nfacey@altaequipfl.com T: (954)581-4744 F: (954)583-0318

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Lead	ppm	 <1						
Tin	ppm	0						
Aluminum	ppm	1						
Chromium	ppm	∎1						
Molybdenum	ppm	1						
Nickel	ppm	0						
Titanium	ppm	0						
Silver	ppm	<1						
Manganese	ppm	3						
Vanadium	ppm	<1						
Calcium	ppm	3756						
Magnesium	ppm	6						
Zinc	ppm	1543						
Phosphorus	ppm	1407						

 Depot:
 VOLVO0095

 Unique No:
 11036014

 Signed:
 Wes Davis

 Report Date:
 21 May 2024

0 🔲

142

ppm

ppm

Barium


Boron

CONSTRUCTION EQUIPMENT



GRAPHS

VOLV

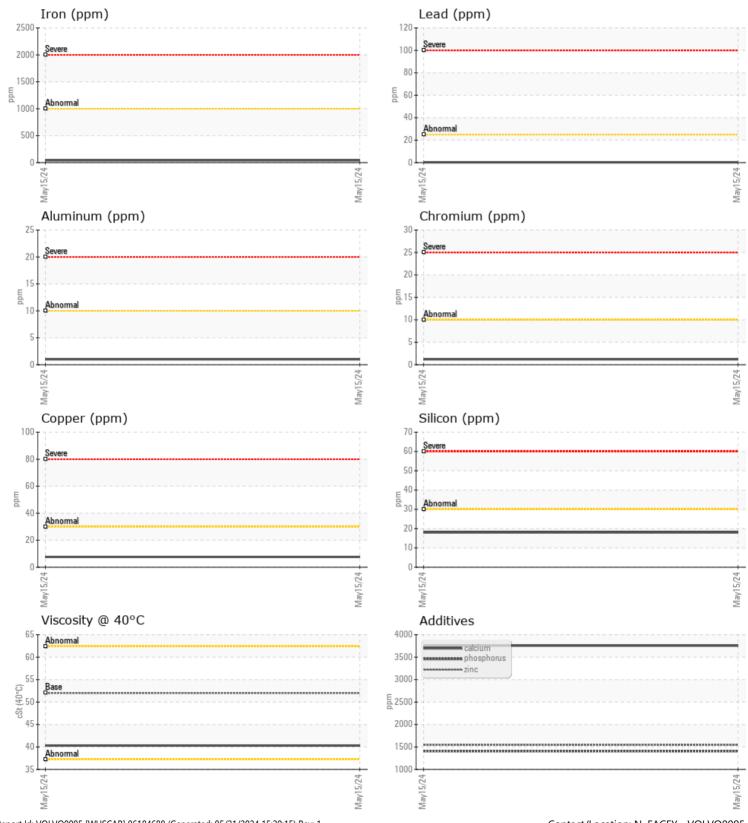

Report Id: VOLVO0095 [WUSCAR] 06184688 (Generated: 05/21/2024 15:20:15) Rev: 1

Contact/Location: N. FACEY - VOLVO0095