



# CONSTRUCTION EQUIPMENT

701702 GREGCO SDLG L959F 640022 - COOLANT



**Sample No:** VCP445477  
**Oil Type:** VOLVO COOLANT VCS (YELLOW)  
**Job No:** 701702 GREGCO



## SAMPLE INFORMATION

Sample Number	VCP445477	---	---	---
Sample Date	16 Apr 2024	---	---	---
Machine Hours	5226	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC  
8418 PALM RIVER ROAD  
TAMPA, FL  
US 33619  
Contact: KENNY HANEY  
khaney@flaglerce.com  
T: (813)630-0077  
F: (813)630-2233



## COOLANT CONDITION

pH	Scale 0-14	■ 7.61	---	---	---
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	■ NT	---	---	---
Percentage Glycol	%	■ 53.7	---	---	---
Freezing Point	°C	■ -43	---	---	---

## Diagnosis

No corrective action is recommended at this time. The fluid is suitable for further service. There is no indication of any contamination in the coolant. Carboxylate test failed. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



## CONTAMINATION

Coolant Appearance	normal	---	---	---
Coolant Color	Orange	---	---	---

**Depot:** VOLVO0093  
**Unique No:** 11037081  
**Signed:** Jonathan Hester  
**Report Date:** 24 May 2024



# CONSTRUCTION EQUIPMENT




## GRAPHS


### Iron/Tin/Silver




### Reserve Alkalinity

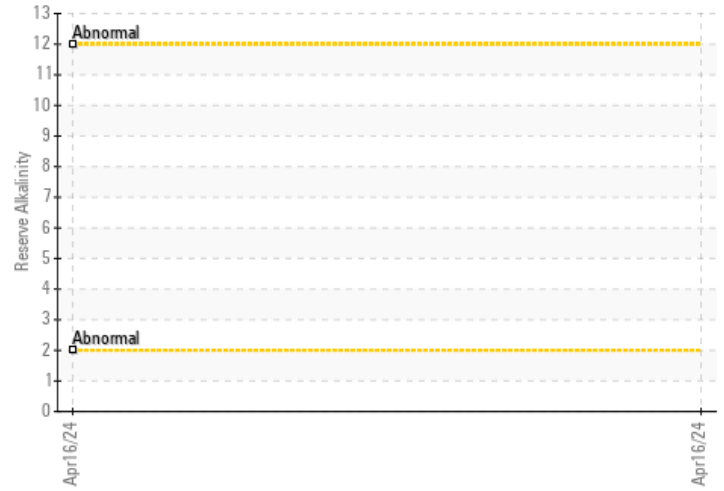


### Copper/Aluminum/Lead

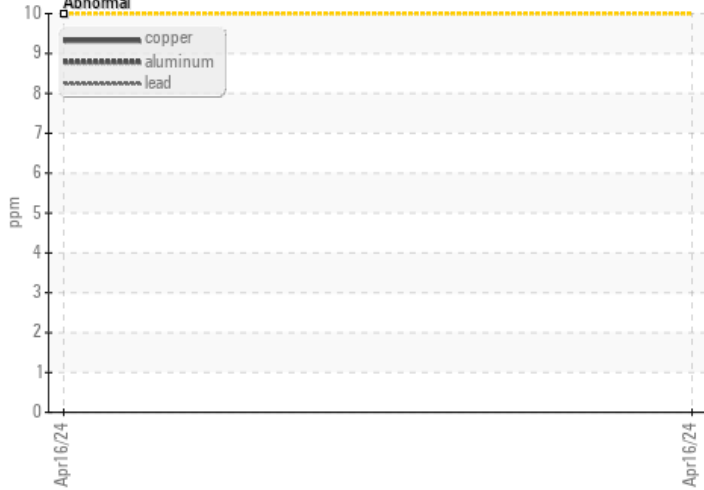

### Freeze Point

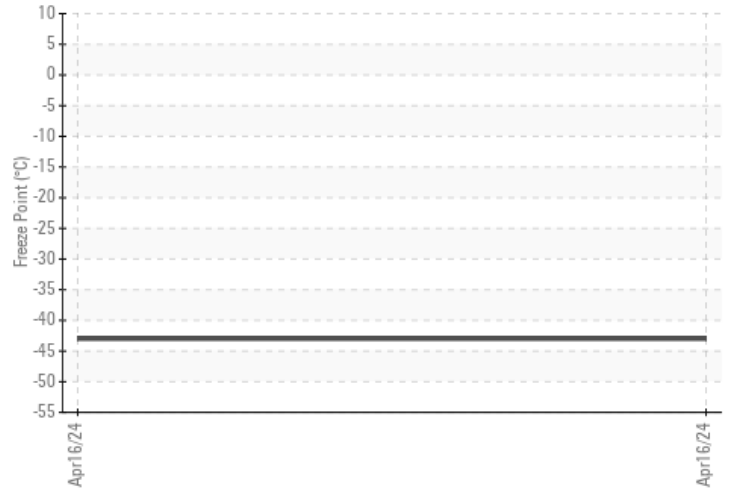

### pH

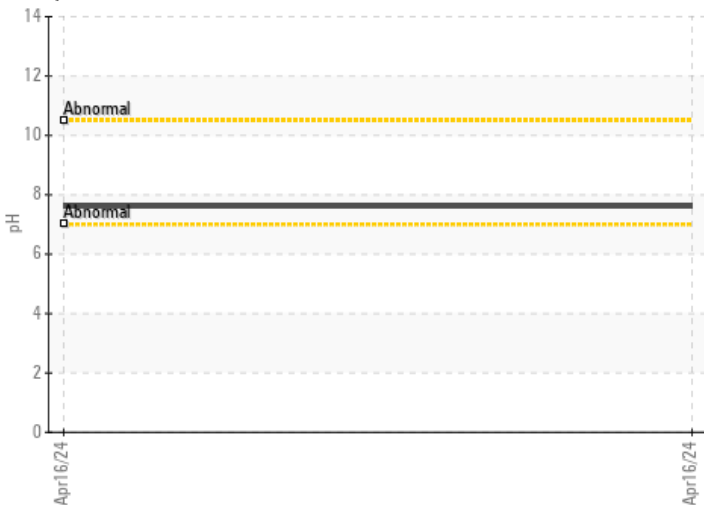

### Nitrites

