



# CONSTRUCTION EQUIPMENT

## VOLVO EC350E 310403 - DIESEL ENGINE



**Sample No:** ML0001591  
**Oil Type:** DIESEL ENGINE OIL SAE 15W40  
**Job No:**



### SAMPLE INFORMATION

Sample Number	ML0001591	---	---	---
Sample Date	23 May 2024	---	---	---
Machine Hours	9621	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Changed	---	---	---
Sample Status	NORMAL	---	---	---

**WILLIAM HAZEL**  
 PO BOX 600  
 CHANTILLY, VA  
 US 20153  
 Contact: SERVICE MANAGER  
 jimmy\_elswick@wahazel.com  
 T: (703)378-8300  
 F:



### OIL CONDITION

Visc @ 100°C	cSt	█ 12.5	---	---	---
Base Number (BN)	mg KOH/g	█ 9.4	---	---	---
Oxidation (PA)	%	77	---	---	---

### Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The BN result indicates that there is suitable alkalinity remaining in the oil. The condition of the oil is acceptable for the time in service.



### CONTAMINATION

Water	%	NEG	---	---	---
Soot %	%	█ 0.1	---	---	---
Nitration (PA)	%	53	---	---	---
Sulfation (PA)	%	59	---	---	---
Glycol	%	NEG	---	---	---
Fuel	%	<1.0	---	---	---
Silicon	ppm	█ 4	---	---	---
Sodium	ppm	█ 3	---	---	---
Potassium	ppm	█ 2	---	---	---



### WEAR METALS

Iron	ppm	█ 3	---	---	---
Copper	ppm	█ 6	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ <1	---	---	---
Aluminum	ppm	█ 2	---	---	---
Chromium	ppm	█ 0	---	---	---
Molybdenum	ppm	█ 40	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	█ 0	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ <1	---	---	---
Vanadium	ppm	0	---	---	---



### ADDITIVES

Calcium	ppm	█ 1614	---	---	---
Magnesium	ppm	█ 473	---	---	---
Zinc	ppm	█ 869	---	---	---
Phosphorus	ppm	█ 742	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 67	---	---	---

**Depot:** WILCHA  
**Unique No:** 11050467  
**Signed:** Sean Felton  
**Report Date:** 30 May 2024




# CONSTRUCTION EQUIPMENT




## GRAPHS

### Ferrous Alloys

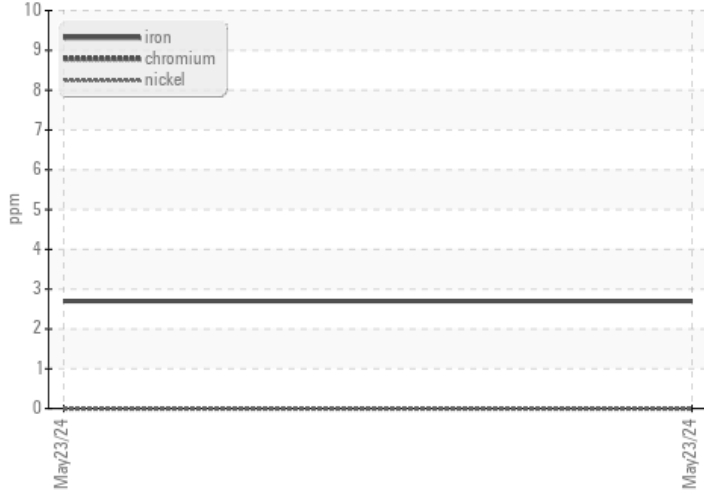

### Non-ferrous Metals

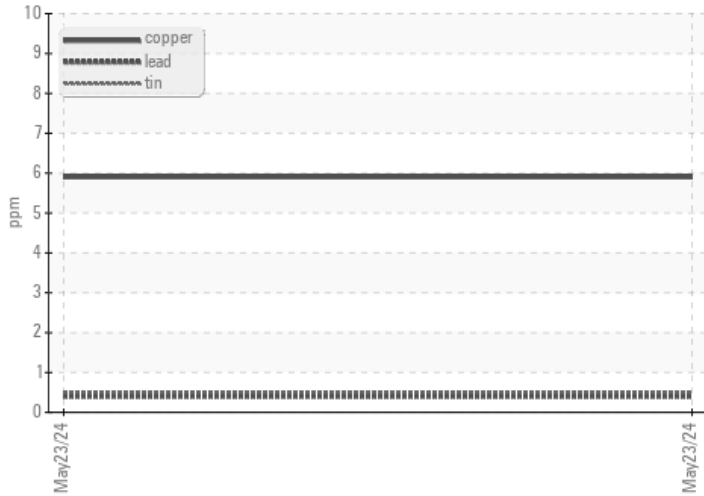

### Viscosity @ 100°C



### Base Number

