CONSTRUCTION EQUIPMENT HERC RENTALS VOLVO A30G 753512 - TRANSMISSION (AUTO)

Sample No:VCP454999Oil Type:DEXRON IIIJob No:HERC RENTALS

VOLVO

## SAMPLE INFORMATION

Calcium

Zinc

Barium

Boron

Magnesium

Phosphorus

	INFORMATION			
Sample Number		VCP454999	VCP436184	 
Sample Date		22 May 2024	14 Oct 2023	 
Machine Hours		1885	702	 
Oil Hours		0	0	 
Oil Changed		Not Changd	Not Changd	 
Sample Status		NORMAL	NORMAL	 
OIL COND				
			• • • • •	
Visc @ 40°C	cSt	28.2	28.6	 
VOLVO				
CONTAM	INATION			
Water	%	NEG	0.083	 
Silicon	ppm	115	12	 
Sodium	ppm	7	3	 
Potassium	ppm	4	3	 
	ppiii			
VOLVO				
VEAR M	ETALS			
Iron	ppm	<b>41</b>	24	 
Copper	ppm	26	18	 
Lead	ppm	<b>  </b> <1	0	 
Tin	ppm	6	3	 
Aluminum	ppm	31	14	 
Chromium	ppm	<b></b> <1	<b></b> <1	 
Molybdenum	ppm	0	<b></b> < 1	 
Nickel	ppm	2	2	 
Titanium	ppm	<1	0	 
Silver	ppm	<b></b> <1	0	 
Manganese	ppm	4	2	 
Vanadium	ppm	<1	0	 
	FC			 
	D			

72

<1

0

**0** 

189



ALTA EQUIPMENT/FLAGLER CONSTRUCTION EQUIPMENT LLC

8418 PALM RIVER ROAD TAMPA, FL US 33619 Contact: KENNY HANEY khaney@flaglerce.com T: (813)630-0077 F: (813)630-2233

## Diagnosis

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DEXRON III. Please confirm. All component wear rates are normal. There is no indication of any contamination in the fluid. The condition of the fluid is acceptable for the time in service.

Depot:	VOLVO0093		
Unique No:	11056618		
Signed:	Wes Davis		
Report Date:	30 May 2024		
Contact/Location: KENNY	HANEY - VOLVO0093		

**71** 

■ <1

6 🔲

185

**||** <1

71

ppm

ppm

ppm

ppm

ppm


ppm

## **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

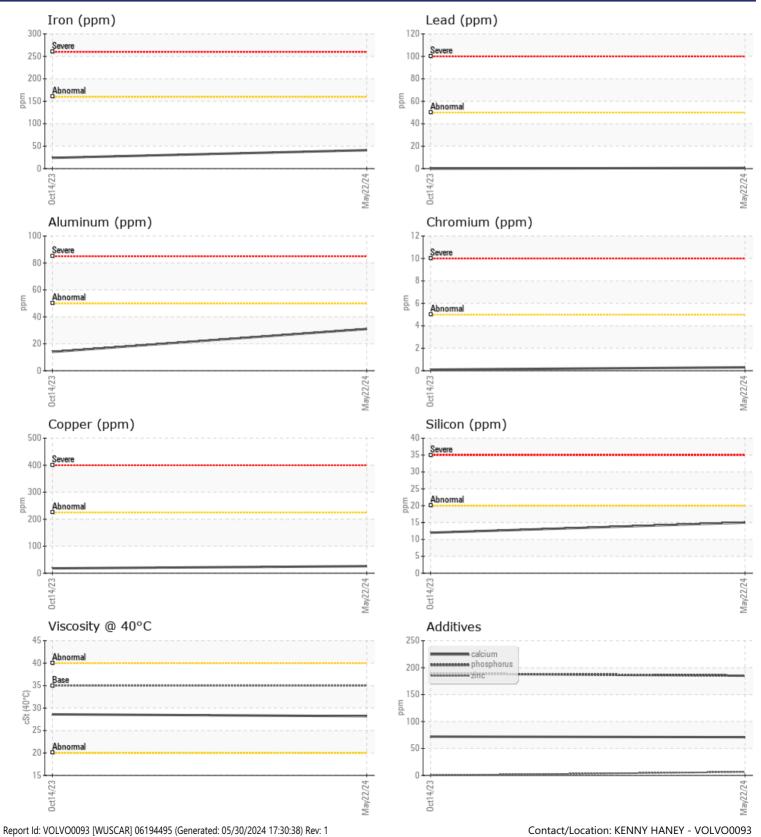

Page 2 of 2