## CONSTRUCTION EQUIPMENT 716013 HERC RENTALS VOLVO ECR145 316464 - HYDRAULIC SYST

Sample No: VCP454766

VOLVO

Oil Type: VOLVO SUPER HYDRAULIC OIL 46 Job No: 716013 HERC RENTALS

	_		_
1			
_	_	-	г.

SAMPLE IN	FORMATION			
Sample Number	-	VCP454766	 	
Sample Date		23 May 2024	 	
Machine Hours		958	 	
Oil Hours		0	 	
Oil Changed		Changed	 	
Sample Status		NORMAL	 	
OIL CONDIT	TION			
Visc @ 40°C	cSt	<b>43.0</b>	 	
Acid Number (AN)	mg KOH/g	0.48	 	

CONTA	MINATION			
Water	%	NEG	 	
Particles >4µm		23668	 	
Particles >6µm		5487	 	
Particles >14µm	า	296	 	
ISO 4406:1999 (	(c)	22/20/15	 	
Silicon	ppm	5	 	
Sodium	ppm	0	 	
Potassium	ppm	<b>  </b> <1	 	

### WEAR METALS

Iron	ppm	3	 	
Copper	ppm	29	 	
Lead	ppm	<b>1</b>	 	
Tin	ppm	<b></b> <1	 	
Aluminum	ppm	<b></b> <1	 	
Chromium	ppm		 	
Molybdenum	ppm	<b></b> <1	 	
Nickel	ppm		 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	0	 	
Vanadium	ppm	0	 	

VOLVO

ADDITI	VES			
Calcium	ppm	85	 	
Magnesium	ppm	2	 	
Zinc	ppm	594	 	
Phosphorus	ppm	<b>446</b>	 	
Barium	ppm	0	 	
Boron	ppm	0	 	



### ALTA EQUIPMENT COMPANY

5210 REESE ROAD DAVIE, FL US 33314 Contact: N. FACEY nfacey@altaequipfl.com T: (954)581-4744 F: (954)583-0318

### Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO0095

 Unique No:
 11057464

 Signed:
 Wes Davis

 Report Date:
 31 May 2024

 Contact/Location: N. FACEY - VOLVO0095


Report Id: VOLVO0095 [WUSCAR] 06195341 (Generated: 05/31/2024 13:16:05) Rev: 1

# **CONSTRUCTION EQUIPMENT**



GRAPHS

VOLVO

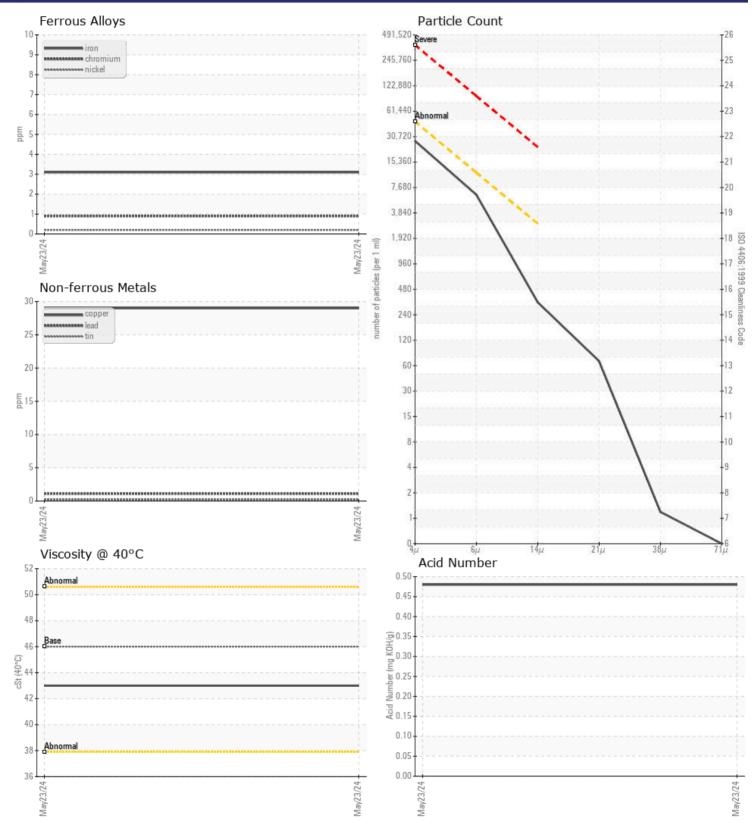

Report Id: VOLVO0095 [WUSCAR] 06195341 (Generated: 05/31/2024 13:16:08) Rev: 1

Contact/Location: N. FACEY - VOLVO0095