CONSTRUCTION EQUIPMENT 717448 RENTAL VOLVO A40G 752208 - HYDRAULIC SYSTEM

Sample No:VCP454668Oil Type:VOLVO SUPE

VOLVO

pe:	VOLVO SUPER HYDRAULIC OIL 4	6

Job No:

717448 RENTAL

	E INFORMATION				
Sample Number	-	VCP454668			
Sample Date		03 Jun 2024			
Machine Hours		1160			
Oil Hours		0			
Oil Changed		Not Changd			
Sample Status		NORMAL			
OIL COI	NDITION				
Visc @ 40°C	cSt	46.0			
Acid Number (A	N) mg KOH/g	0.43			
CONTA	MINATION				
Water	0/	NEC	<u> </u>	-	

Water	%	NEG	 	
Particles >4µm		2825	 	
Particles >6µm		1032	 	
Particles >14µm		89	 	
ISO 4406:1999 (c)		19/17/14	 	
Silicon	ppm	2	 	
Sodium	ppm	0	 	
Potassium	ppm	□ <1	 	

WEAR METALS

Iron	ppm	1	 	
Copper	ppm	2	 	
Lead	ppm	1	 	
Tin	ppm		 	
Aluminum	ppm	2	 	
Chromium	ppm	□ <1	 	
Molybdenum	ppm	0	 	
Nickel	ppm	0	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	0	 	
Vanadium	ppm	0	 	

VOLVO

Calcium	ppm	40				
Magnesium	ppm					
Zinc	ppm	427				
Phosphorus	ppm	323				
Barium	ppm	0				
Boron	ppm	0				



ALTA EQUIPMENT COMPANY

5210 REESE ROAD DAVIE, FL US 33314 Contact: N. FACEY nfacey@altaequipfl.com T: (954)581-4744 F: (954)583-0318

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable. The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

 Depot:
 VOLVO0095

 Unique No:
 11070112

 Signed:
 Wes Davis

 Report Date:
 10 Jun 2024

 Contact/Location: N. FACEY - VOLVO0095


Report Id: VOLVO0095 [WUSCAR] 06202651 (Generated: 06/10/2024 10:12:04) Rev: 1

CONSTRUCTION EQUIPMENT



🥖 GRAPHS

VOLVO

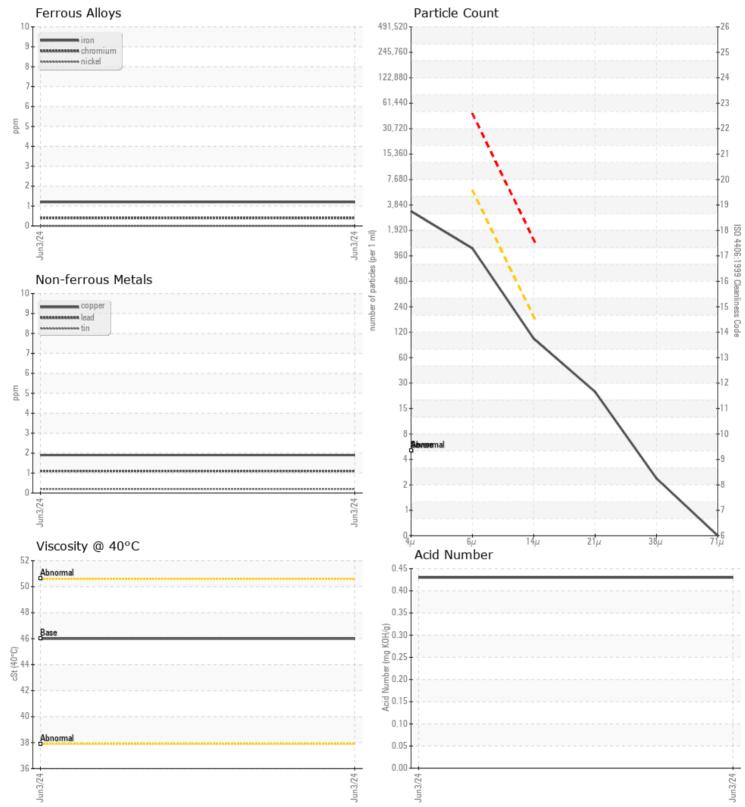

Contact/Location: N. FACEY - VOLVO0095