



CONSTRUCTION EQUIPMENT

728681 RENTALS VOLVO A40G 752282 - WET DISC BRAKE



Sample No: VCP449666
Oil Type: VOLVO SUPER WET BRAKE TRANSAXLE OIL WB102
Job No: 728681 RENTALS



SAMPLE INFORMATION

Sample Number	VCP449666	---	---	---
Sample Date	05 Jun 2024	---	---	---
Machine Hours	1036	---	---	---
Oil Hours	0	---	---	---
Oil Changed	Not Chngd	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT/FLAGLER EQUIPMENT LLC
 9601 BOGGY CREEK RD
 ORLANDO, FL
 US 32824
 Contact: Robert LaPlante
 robert.laplante@altg.com
 T: (407)508-9736
 F: (407)659-8720



OIL CONDITION

Visc @ 40°C	cSt	█ 43.6	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 12	---	---	---
Sodium	ppm	█ 4	---	---	---
Potassium	ppm	█ 2	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.



WEAR METALS

Iron	ppm	█ 16	---	---	---
Copper	ppm	█ 52	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ <1	---	---	---
Aluminum	ppm	█ <1	---	---	---
Chromium	ppm	█ 0	---	---	---
Molybdenum	ppm	█ 0	---	---	---
Nickel	ppm	█ 4	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	█ <1	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	█ 3440	---	---	---
Magnesium	ppm	█ 9	---	---	---
Zinc	ppm	█ 1464	---	---	---
Phosphorus	ppm	█ 1224	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 117	---	---	---

Depot: VOLVO0096
Unique No: 11074409
Signed: Don Baldrige
Report Date: 13 Jun 2024




CONSTRUCTION EQUIPMENT




GRAPHS

Iron (ppm)

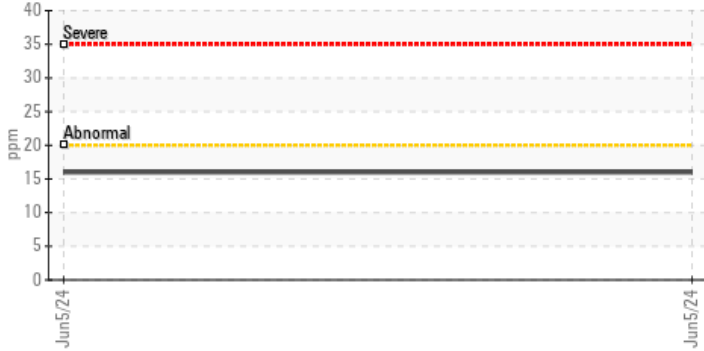

Lead (ppm)

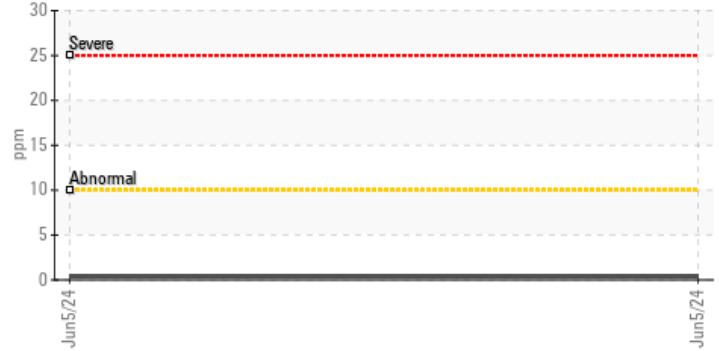


Aluminum (ppm)




Chromium (ppm)



Copper (ppm)

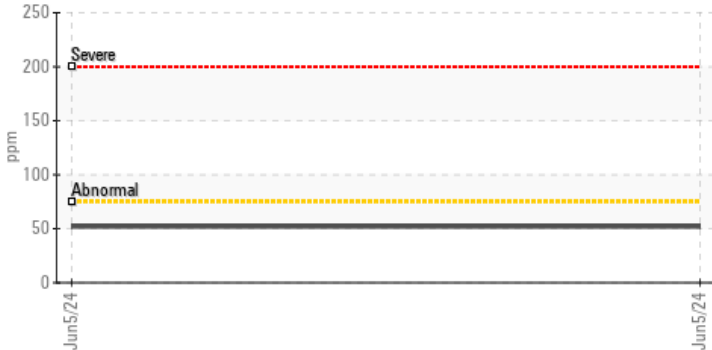

Silicon (ppm)

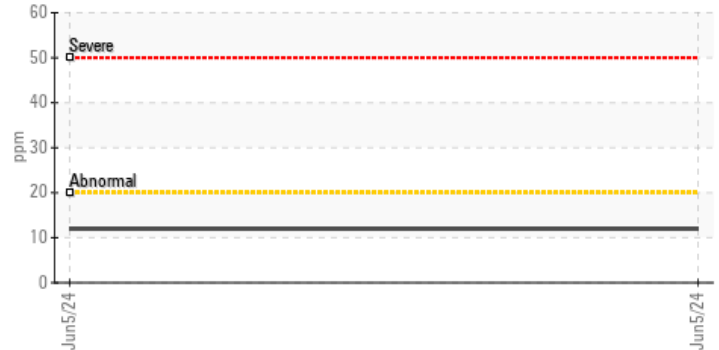

Viscosity @ 40°C



Additives

