



CONSTRUCTION EQUIPMENT

VOLVO A25G 752695 - TRANSMISSION (AUTO)



Sample No: VCP0008753

Oil Type: DEXRON III

Job No:



SAMPLE INFORMATION

Sample Number	VCP0008753	---	---	---
Sample Date	10 Jun 2024	---	---	---
Machine Hours	2005	---	---	---
Oil Hours	0	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT COMPANY

8750 PHILIPS HWY
JACKSONVILLE, FL
US 32256

Contact: TECHNICIAN ACCOUNT
catherine.anastasio@wearcheck.com
T:
F: (904)737-1260



OIL CONDITION

Visc @ 40°C	cSt	█ 29.8	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 17	---	---	---
Sodium	ppm	█ 3	---	---	---
Potassium	ppm	█ 5	---	---	---

Diagnosis

Resample at the next service interval to monitor. All component wear rates are normal. There is no indication of any contamination in the fluid. The condition of the fluid is acceptable for the time in service.



WEAR METALS

Iron	ppm	█ 46	---	---	---
Copper	ppm	█ 24	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 4	---	---	---
Aluminum	ppm	█ 29	---	---	---
Chromium	ppm	█ <1	---	---	---
Molybdenum	ppm	█ <1	---	---	---
Nickel	ppm	█ 1	---	---	---
Titanium	ppm	<1	---	---	---
Silver	ppm	█ 0	---	---	---
Manganese	ppm	█ 5	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	█ 121	---	---	---
Magnesium	ppm	█ 3	---	---	---
Zinc	ppm	█ 26	---	---	---
Phosphorus	ppm	█ 201	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 73	---	---	---

Depot: VOLVO0092
Unique No: 11075665
Signed: Angela Borella
Report Date: 14 Jun 2024




CONSTRUCTION EQUIPMENT




GRAPHS

Ferrous Alloys

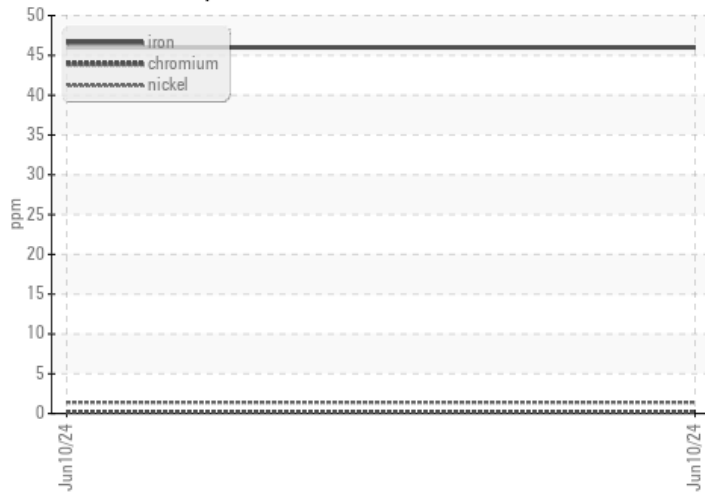

Non-ferrous Metals

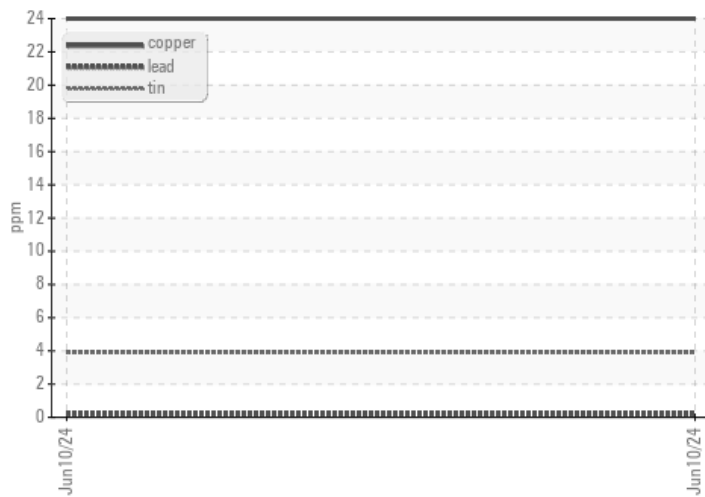

Viscosity @ 40°C

