CONSTRUCTION EQUIPMENT 136502 VOLVO A40G 752154 - TRANSMISSION (AUTO)



Sample No:	VCP442498			
Oil Type:	DEXRON III			
Job No:	136502			

VOLVO

SAMPLE INFORMATION

		N		
Sample Number	-	VCP442498	VCP442492	
Sample Date		07 Jun 2024	03 Apr 2024	
Machine Hours		880	530	
Oil Hours		0	0	
Oil Changed		Changed	Not Changd	
Sample Status		NORMAL	NORMAL	
OIL CON	DITION			
Visc @ 40°C	cSt	28.7	28.9	
	MINATION			
			NEC	
Water	%	NEG	NEG	
Silicon	ppm	13	10	
Sodium	ppm	2	3	
Potassium	ppm	4	4	
VOLVO				
WEAR N	METALS			
Iron	ppm	26	19	
Copper	ppm	29	22	
Lead	ppm	 <1	0	
Tin	ppm	4	3	
Aluminum	ppm	12	8	
Chromium	ppm	 <1	<1	
Molybdenum	ppm	0	0	
Nickel	ppm	3	3	
Titanium	ppm	<1	<1	
Silver	ppm	0	<1	
Manganese	ppm	3	3	
Vanadium	ppm	0	<1	

ADDITIN	VES			
Calcium	ppm	126	79	
Magnesium	ppm	3	<1	
Zinc	ppm	1 9	5	
Phosphorus	ppm	196	201	
Barium	ppm	0	 < 1	
Boron	ppm	83	96	



LATTIMORE MATERIALS/HOLCIM - ROSSER - LAFARGE 14242 S SH-34 SCURRY, TX US 75158 Contact: WALLACE WARREN wallace.warren@lafargeholcim.com T: F:

Diagnosis

Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) DEXRON III. Please confirm. All component wear rates are normal. There is no indication of any contamination in the fluid. The condition of the fluid is acceptable for the time in service.


Depot:LATSCUUnique No:11075668Signed:Wes DavisReport Date:14 Jun 2024Contact/Location: WALLACE WARREN - LATSCU

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

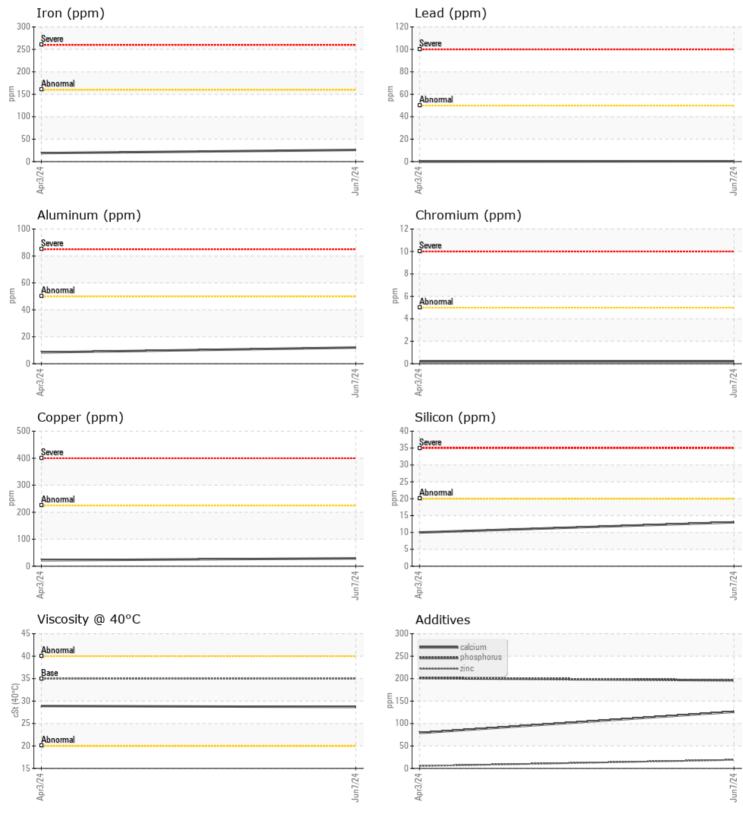

Report Id: LATSCU [WUSCAR] 06208207 (Generated: 06/14/2024 00:36:47) Rev: 1

Contact/Location: WALLACE WARREN - LATSCU