VOLVO


CONSTRUCTION EQUIPMENT X18706 VOLVO A40G 353135 - DROP BOX



Sample No: VCP433027

Oil Type:	VOLVO SUPER GEAR OIL 75W-80-GO102
Job No:	X18706

SAMPLE INFORMATION VCP433027 Sample Number Sample Date 17 Jun 2024 Machine Hours 4110 Oil Hours 0 Oil Changed Changed NORMAL Sample Status **OIL CONDITION** F: Visc @ 40°C cSt 48.3 CONTAMINATION Water % NEG 46 Silicon ppm Sodium 7 ppm Potassium ppm 5 WEAR METALS 393 Iron ppm Copper ppm 15 Lead ppm **||** <1 Tin ppm 0 Aluminum ppm 3 Chromium **4** ppm Molybdenum ppm 14 Nickel 2 ppm Titanium <1 ppm Silver 0 ppm Manganese ppm 6 Vanadium ppm 0 01 **ADDITIVES**





APAC BENTON

393 OREILLY RD BENTON, MS US 39039 Contact: WILL RATLIFF will.ratliffjr@apac.com T: (601)397-3696 F:

Diagnosis

Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

 Depot:
 APABEN

 Unique No:
 11100803

 Signed:
 Wes Davis

 Report Date:
 28 Jun 2024


 Contact/Location:
 WILL RATLIFF - APABEN

CONSTRUCTION EQUIPMENT



GRAPHS

VOLVO

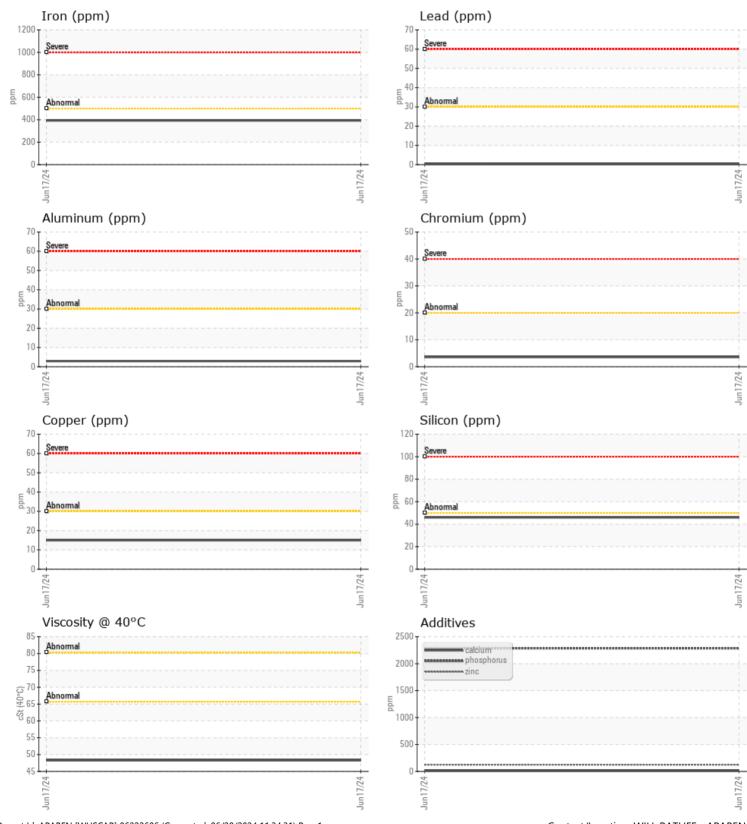

Report Id: APABEN [WUSCAR] 06222606 (Generated: 06/28/2024 11:34:31) Rev: 1

Contact/Location: WILL RATLIFF - APABEN