



CONSTRUCTION EQUIPMENT

VOLVO A25G 752542 - BRAKE COOLING SYSTEM



Sample No: VCP0008738

Oil Type: {unknown}

Job No:



SAMPLE INFORMATION

Sample Number	VCP0008738	---	---	---
Sample Date	21 Jun 2024	---	---	---
Machine Hours	631	---	---	---
Oil Hours	631	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	NORMAL	---	---	---

ALTA EQUIPMENT COMPANY
 8750 PHILIPS HWY
 JACKSONVILLE, FL
 US 32256
 Contact: TECHNICIAN ACCOUNT
 catherine.anastasio@wearcheck.com
 T:
 F: (904)737-1260



OIL CONDITION

Visc @ 40°C	cSt	█ 43.5	---	---	---
-------------	-----	--------	-----	-----	-----



CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 13	---	---	---
Sodium	ppm	█ 3	---	---	---
Potassium	ppm	█ 4	---	---	---



WEAR METALS

Iron	ppm	█ 11	---	---	---
Copper	ppm	█ 169	---	---	---
Lead	ppm	█ <1	---	---	---
Tin	ppm	█ 0	---	---	---
Aluminum	ppm	█ <1	---	---	---
Chromium	ppm	█ 0	---	---	---
Molybdenum	ppm	<1	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	0	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	1	---	---	---
Vanadium	ppm	0	---	---	---



ADDITIVES

Calcium	ppm	3681	---	---	---
Magnesium	ppm	10	---	---	---
Zinc	ppm	1466	---	---	---
Phosphorus	ppm	1264	---	---	---
Barium	ppm	1	---	---	---
Boron	ppm	109	---	---	---

Diagnosis

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample. All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

Depot: VOLVO0092
Unique No: 11111446
Signed: Don Baldrige
Report Date: 07 Jul 2024




CONSTRUCTION EQUIPMENT




GRAPHS

Ferrous Alloys

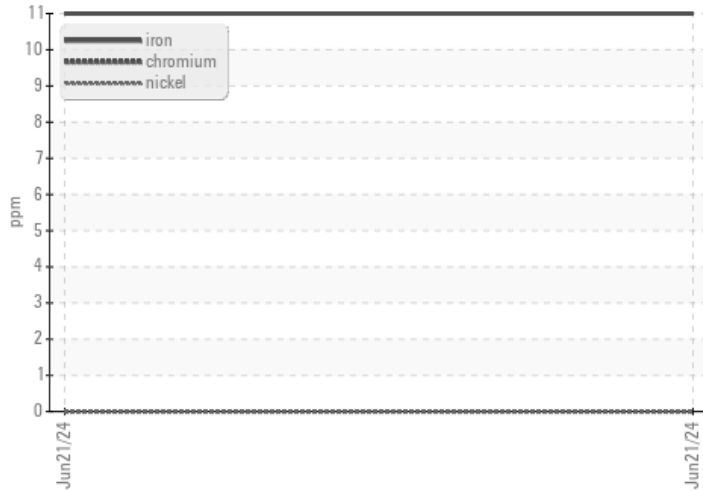

Non-ferrous Metals

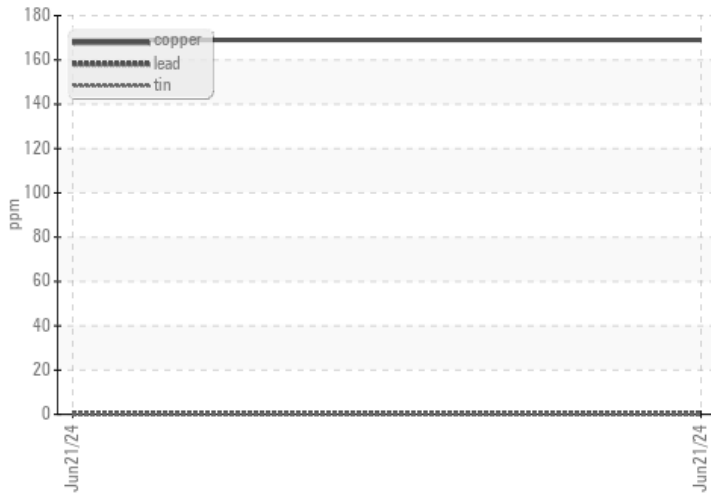

Viscosity @ 40°C

