



CONSTRUCTION EQUIPMENT

VOLVO L150H 6989 - COOLANT



Sample No: VCP452641
Oil Type: HYBRID (HOAT) COOLANT
Job No:



SAMPLE INFORMATION

Sample Number	VCP452641	VCP436466	VCP432776	VCP407072
Sample Date	07 Jul 2024	09 May 2024	22 Feb 2024	15 Dec 2023
Machine Hours	7460	7072	6479	5961
Sample Status	NORMAL	NORMAL	SEVERE	NORMAL

CITY CARTING

221 OLD GATE LN
MILFORD, CT
US 06460
Contact: TAVINS BANKS
tavins@citycart.net
T: (203)223-3885
F:



COOLANT CONDITION

pH	Scale 0-14	7.05	7.11	7.25	7.19
Reserve Alkalinity	Scale 0-20	---	---	---	---
Nitrites	ppm	NT	NT	NT	NT
Percentage Glycol	%	46.9	47.0	46.8	46.5
Freezing Point	°C	-26	-28	-26	-26

Diagnosis

The fluid is suitable for further service. There is no indication of any contamination in the coolant. The carboxylate level of this fluid is acceptable. The glycol level is acceptable. The pH level of this fluid is within the acceptable limits.



CONTAMINATION

Coolant Appearance	normal	normal	▲ oil	normal
Coolant Color	Yllow	Yllow	Red	Yllow

Depot: CITMILCON
Unique No: 11124151
Signed: Jonathan Hester
Report Date: 17 Jul 2024




CONSTRUCTION EQUIPMENT




GRAPHS


Iron/Tin/Silver

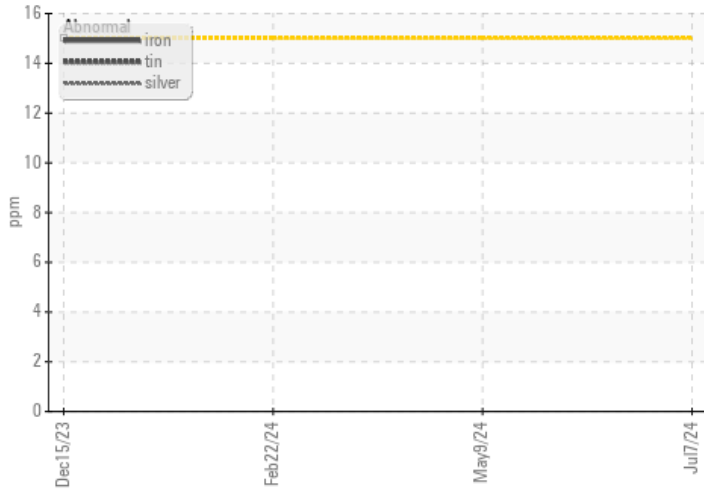


Reserve Alkalinity

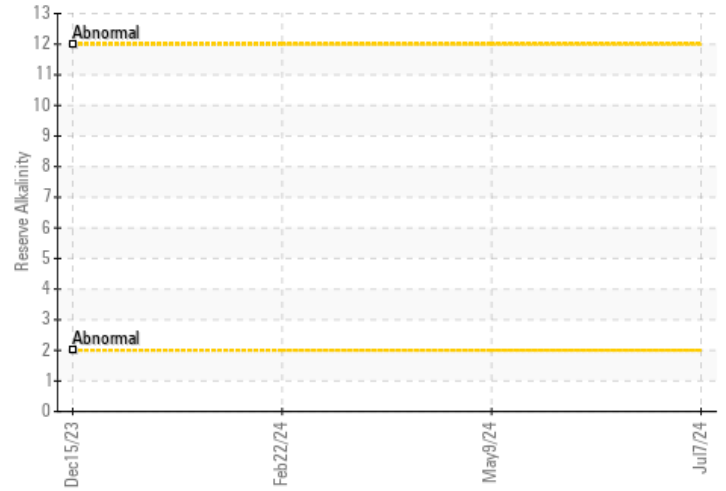


Copper/Aluminum/Lead

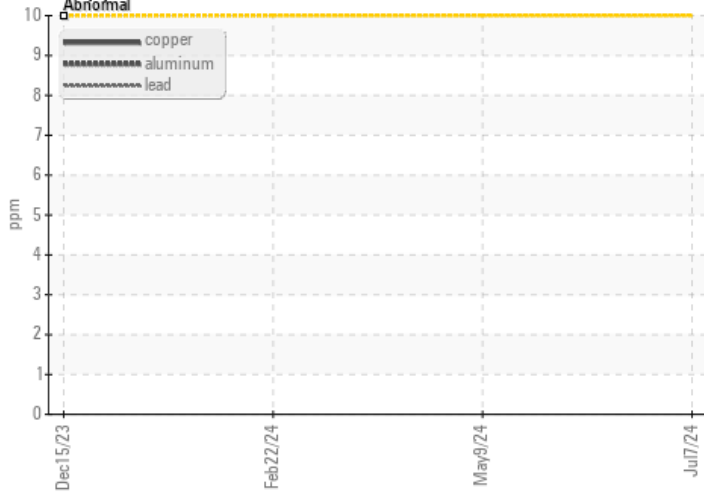

Freeze Point

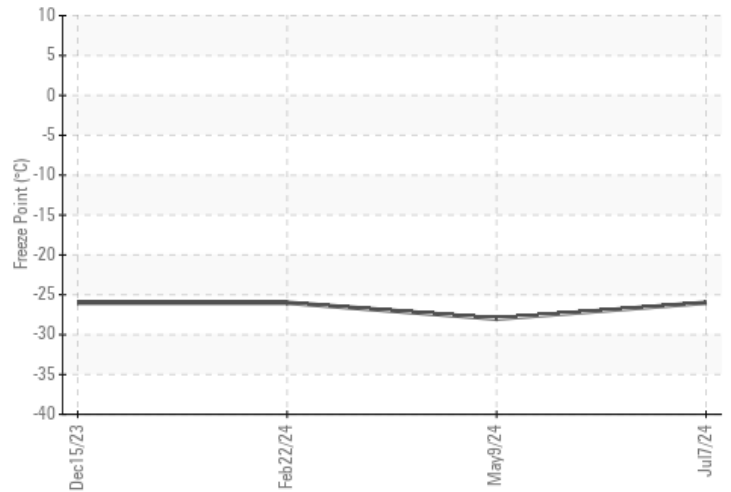

pH

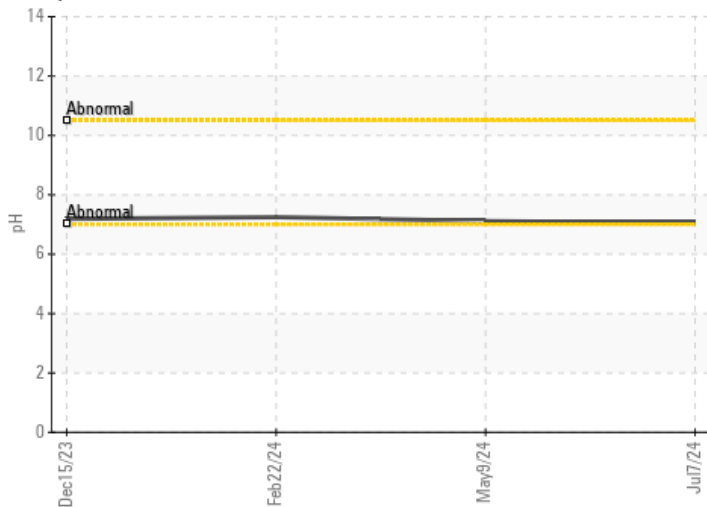

Nitrites

