



# CONSTRUCTION EQUIPMENT

## VOLVO A40G 343662 (S/N 342662) - FRONT AXLE



**Sample No:** VCP0008187  
**Oil Type:** GEAR OIL SAE 75W90  
**Job No:**



**ALTA EQUIPMENT COMPANY**  
 8750 PHILIPS HWY  
 JACKSONVILLE, FL  
 US 32256  
 Contact: SHAWN NORTHCRAFT  
 shawn.northcraft@altg.com  
 T: (904)737-6000  
 F: (904)737-1260



### SAMPLE INFORMATION

Sample Number	VCP0008187	---	---	---
Sample Date	16 Jul 2024	---	---	---
Machine Hours	6726	---	---	---
Oil Hours	6726	---	---	---
Oil Changed	N/A	---	---	---
Sample Status	NORMAL	---	---	---



### OIL CONDITION

Visc @ 40°C	cSt	█ 99.0	---	---	---
-------------	-----	--------	-----	-----	-----



### CONTAMINATION

Water	%	NEG	---	---	---
Silicon	ppm	█ 3	---	---	---
Sodium	ppm	█ 0	---	---	---
Potassium	ppm	█ <1	---	---	---



### WEAR METALS

Iron	ppm	█ 66	---	---	---
Copper	ppm	█ 1	---	---	---
Lead	ppm	█ 0	---	---	---
Tin	ppm	█ 0	---	---	---
Aluminum	ppm	█ 1	---	---	---
Chromium	ppm	█ <1	---	---	---
Molybdenum	ppm	█ 3	---	---	---
Nickel	ppm	█ 0	---	---	---
Titanium	ppm	<1	---	---	---
Silver	ppm	0	---	---	---
Manganese	ppm	█ <1	---	---	---
Vanadium	ppm	0	---	---	---



### ADDITIVES

Calcium	ppm	█ 34	---	---	---
Magnesium	ppm	█ 17	---	---	---
Zinc	ppm	█ 30	---	---	---
Phosphorus	ppm	510	---	---	---
Barium	ppm	█ 0	---	---	---
Boron	ppm	█ 48	---	---	---

### Diagnosis


Resample at the next service interval to monitor. The fluid was not specified, however, a fluid match indicates that this fluid is (GENERIC) GEAR OIL SAE 75W90. Please confirm.  
 All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

**Depot:** VOLVO0092  
**Unique No:** 11129594  
**Signed:** Wes Davis  
**Report Date:** 19 Jul 2024




## GRAPHS

### Ferrous Alloys

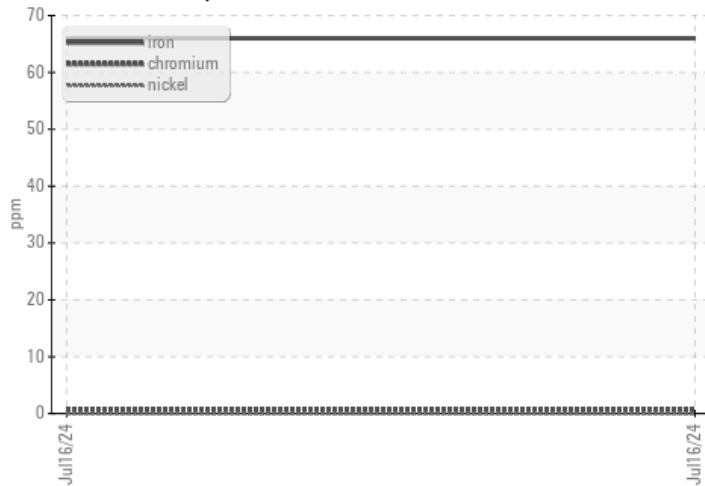

### Non-ferrous Metals

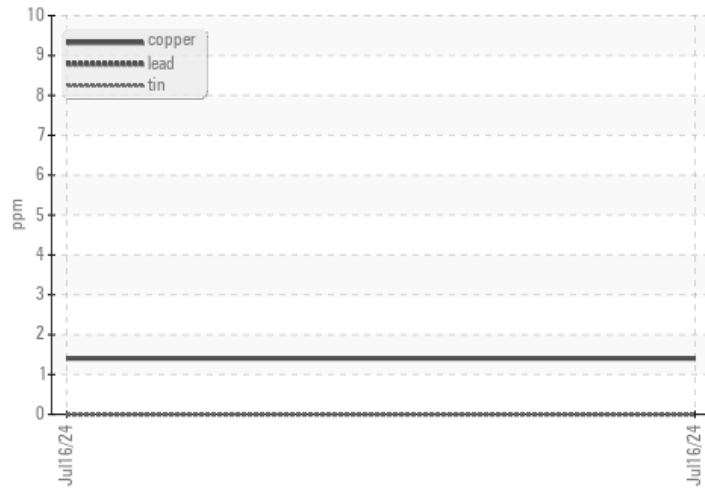

### Viscosity @ 40°C

