OIL ANALYSIS REPORT

LE PRIX 3135 20026852 - INBOARD - PORT GEARBOX

Sample No: VPA044196

Oil Type: SHELL ROTELLA T 30

SAMPLE INFORMATION VPA044196 Sample Number The Talaria Company Sample Date 14 Dec 2022 202 Banks St., One Little Harbor Landing Machine Hours 207 OXFORD, MD 25 **Oil Hours** US 21654 Oil Changed Changed Contact: TRACY PELLERIN NORMAL Sample Status tpellerin@hinckleyyachts.com T: (410)770-4899 **OIL CONDITION** F: x: Visc @ 40°C cSt 95.5 Diagnosis CONTAMINATION Resample at the next service interval % Water NEG to monitor.All component wear rates Silicon ppm 4 are normal. There is no indication of Sodium 3 ppm any contamination in the oil. The Potassium ppm 1 condition of the oil is acceptable for the time in service. WEAR METALS PO 14 28 Iron ppm Copper 32 ppm Lead 43 ppm 2 Tin ppm **||** <1 Aluminum ppm Chromium □ <1 ppm Molybdenum 98 ppm **||** <1 Nickel ppm Titanium 0 ppm Silver <1 ppm **|** <1 Manganese ppm Vanadium 0 ppm **ADDITIVES** Calcium 2462 ppm Magnesium ppm 90 Zinc ppm 1044 Phosphorus ppm 953 Barium 0 🔲 ppm Boron ppm 12



 Depot:
 VP592286

 Unique No:
 10294561

 Signed:
 Don Baldridge


 Report Date:
 17 Jan 2023

Contact/Location: TRACY PELLERIN - VP592286

OIL ANALYSIS REPORT



GRAPHS

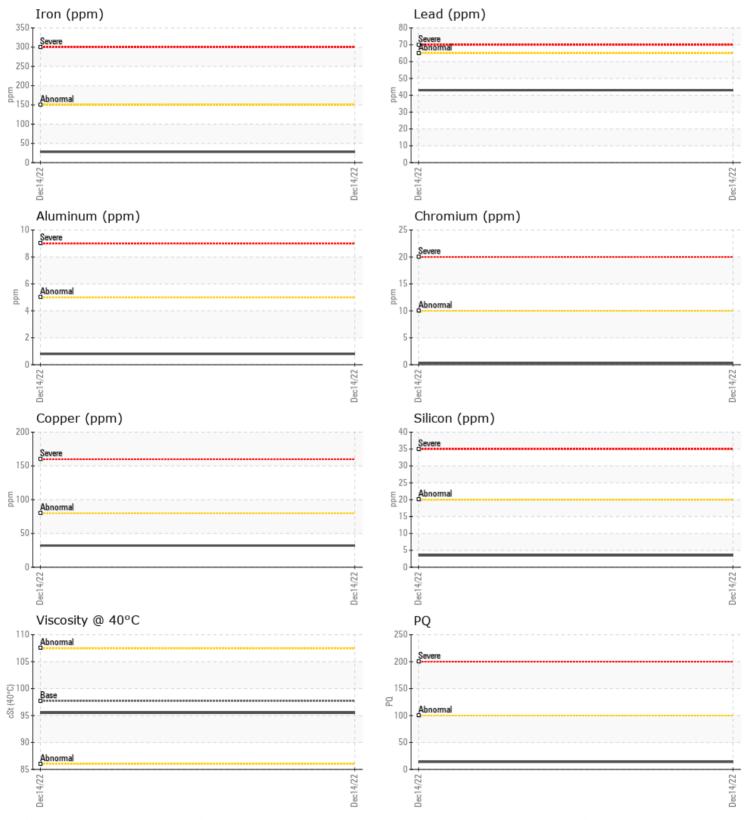

Report Id: VP592286 [WUSCAR] 05739962 (Generated: 06/12/2024 10:56:57) Rev: 1

Contact/Location: TRACY PELLERIN - VP592286