OIL ANALYSIS REPORT

DEWITT VOLVO PENTA 3940022993 - PORT IPS

Sample No:VPA042932Oil Type:NOT GIVEN

SAMPLE INFORM				
Sample Number		VPA042932	 	
Sample Date		12 Jul 2023	 	
Machine Hours		0	 	
Oil Hours		0	 	
Oil Changed		N/A	 	
Sample Status		NORMAL	 	
OIL CONDITION				
Visc @ 40°C	cSt	103	 	
CONTAMINATION				
Silicon	ppm	17	 	
Sodium	ppm	12	 	
Potassium	ppm	2	 	
WEAR METALS				
		= 25		
PQ		25	 	
Iron	ppm	■111 ■10	 	
Copper	ppm	∎19	 	
Lead	ppm	<1	 	
Tin	ppm	<1	 	
Aluminum	ppm	3	 	
Chromium	ppm	1	 	
Molybdenum	ppm	<1	 	
Nickel	ppm	2	 	
Titanium	ppm	0	 	
Silver	ppm	0	 	
Manganese	ppm	9	 	
Vanadium	ppm	0	 	
ADDITIVES				
Calcium	ppm	21	 	
Magnesium	ppm	92	 	
Zinc	ppm	50	 	
Phosphorus	ppm	1445	 	
Barium	ppm	0	 	
Boron	ppm	209	 	
20.011	PPIII			

VOLVO PENTA

MAKO MARINE

117 HUDSON AVE FREEPORT, NY US 11520 Contact: PAUL FLOOD makomarine@optonline.net T: (516)378-7331 F: x:

Diagnosis

No corrective action is recommended at this time. Resample at the next service interval to monitor.All component wear rates are normal. There is no indication of any contamination in the oil. The condition of the oil is acceptable for the time in service.

 Depot:
 VP1134331

 Unique No:
 10560284

 Signed:
 Doug Bogart


 Report Date:
 17 Jul 2023

Contact/Location: PAUL FLOOD - VP1134331

OIL ANALYSIS REPORT





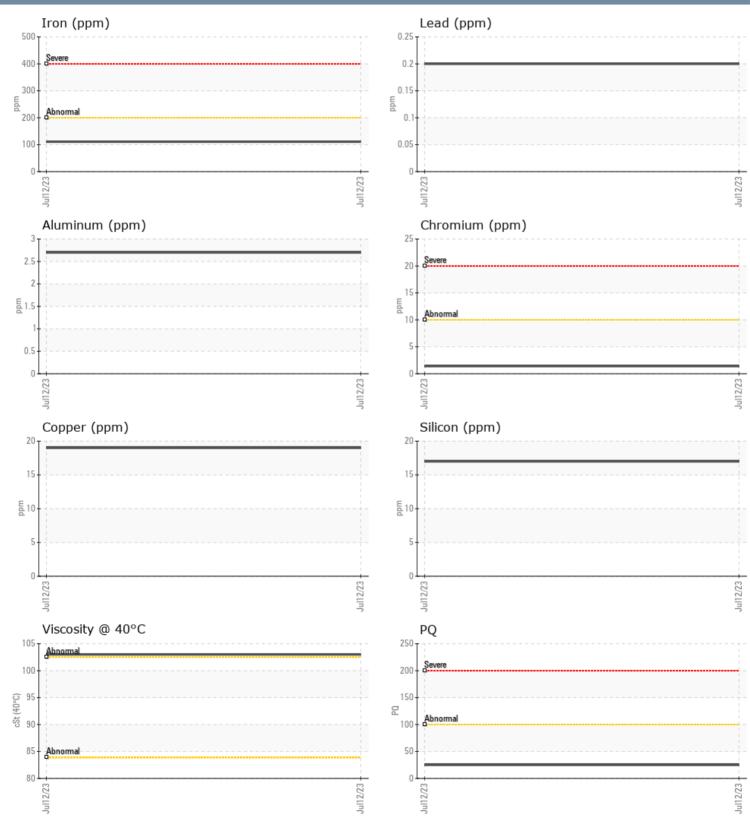

Report Id: VP1134331 [WUSCAR] 05898928 (Generated: 07/17/2023 11:25:19) Rev: 1

Contact/Location: PAUL FLOOD - VP1134331