




# OIL ANALYSIS REPORT

Sample Rating Trend

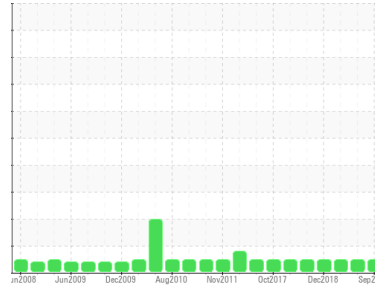

**NORMAL**



Area  
**[178362]**  
 Machine Id  
**HCT-G-LGBR**

Component  
**Bearing**  
 Fluid  
**ESSO TERESSO ISO 68 (95 GAL)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0327952</b>	WC0299313	WC0299359
Sample Date	Client Info		<b>01 Sep 2020</b>	09 Dec 2019	22 Aug 2019
Machine Age	days	Client Info	<b>0</b>	0	0
Oil Age	days	Client Info	<b>0</b>	0	0
Oil Changed	Client Info		<b>N/A</b>	N/A	N/A
Sample Status			<b>NORMAL</b>	NORMAL	NORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Water	WC Method	>2	<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >63	<b>&lt;1</b>	<1	0
Chromium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1
Titanium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	0
Aluminum	ppm	ASTM D5185(m) >2	<b>&lt;1</b>	<1	<1
Lead	ppm	ASTM D5185(m) >161	<b>7</b>	<1	2
Copper	ppm	ASTM D5185(m) >13	<b>1</b>	<1	<1
Tin	ppm	ASTM D5185(m) >27	<b>&lt;1</b>	<1	<1
Antimony	ppm	ASTM D5185(m)	<b>0</b>	<1	<1
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 4.5	<b>&lt;1</b>	<1	0
Barium	ppm	ASTM D5185(m) 0.4	<b>0</b>	<1	<1
Molybdenum	ppm	ASTM D5185(m) 0	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m) 0	<b>0</b>	<1	0
Calcium	ppm	ASTM D5185(m) 0	<b>&lt;1</b>	<1	<1
Phosphorus	ppm	ASTM D5185(m) 0.7	<b>3</b>	2	3
Zinc	ppm	ASTM D5185(m) 0	<b>4</b>	3	3
Sulfur	ppm	ASTM D5185(m) 1315	<b>1831</b>	1905	1901
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1

## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >12	<b>4</b>	4	3
Sodium	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	0
Potassium	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	<1	<1


## FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	<b>1465</b>	4455	6282
Particles >6µm	ASTM D7647	>2500	<b>225</b>	522	1083
Particles >14µm	ASTM D7647	>160	<b>18</b>	21	82
Particles >21µm	ASTM D7647	>40	<b>6</b>	9	31
Particles >38µm	ASTM D7647	>10	<b>0</b>	0	1
Particles >71µm	ASTM D7647	>3	<b>0</b>	0	0
Oil Cleanliness	ISO 4406 (c)	>20/18/14	<b>18/15/11</b>	19/16/12	20/17/14




# OIL ANALYSIS REPORT


Particle Trend

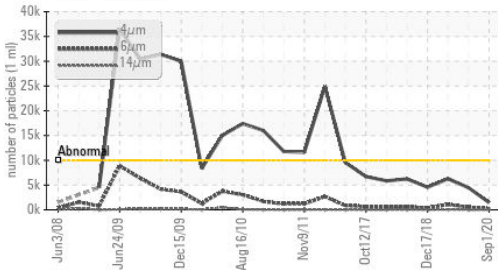


Acid Number

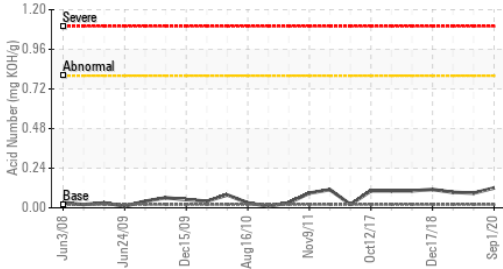

Viscosity @ 40°C

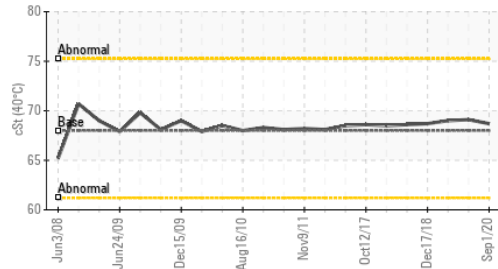

Particle Trend

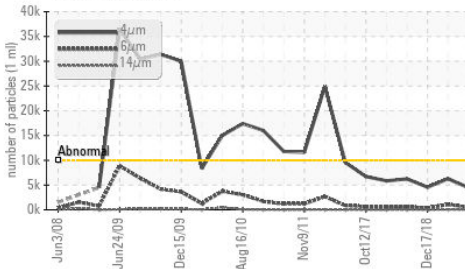


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	<b>0.12</b>	0.089	0.094


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>2	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	68	<b>68.7</b>	69.1	69.0

SAMPLE IMAGES

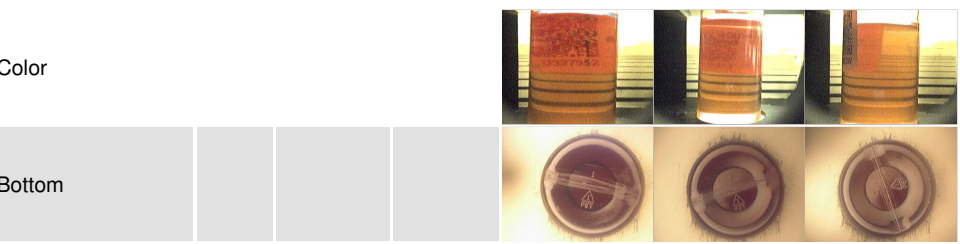

GRAPHS

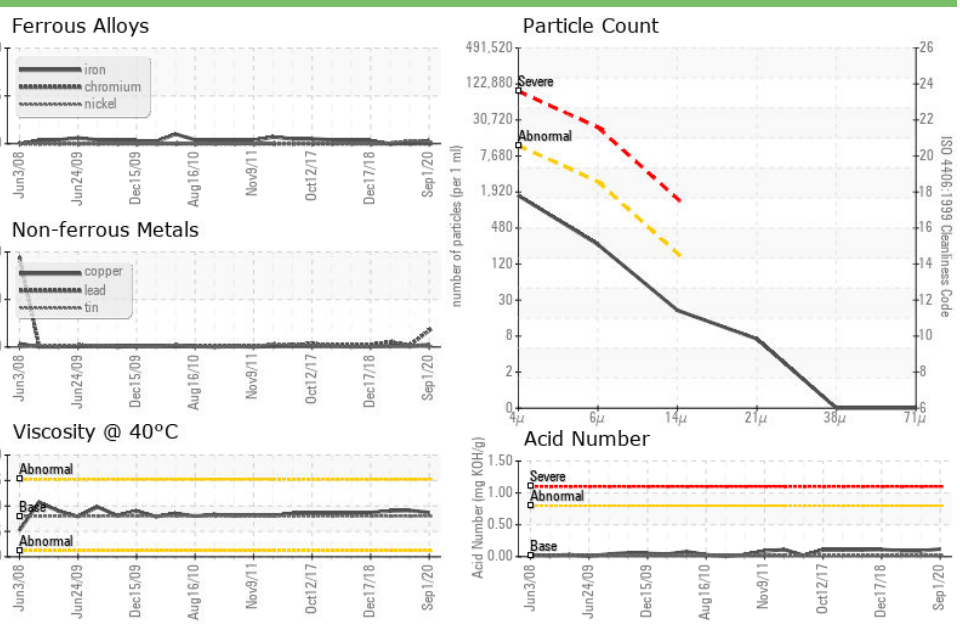

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0327952  
**Lab Number** : 02381791  
**Unique Number** : 5121245  
**Test Package** : IND 2 ( Additional Tests: TAN Man )

**NEWFOUNDLAND POWER INC.**  
 50 DUFFY PLACE, PO BOX 8910  
 ST. JOHNS, NL  
 CA A1B 3P6  
 Contact: Paul Martin  
 pmartin@newfoundlandpower.com  
 T:  
 F: (709)737-2926

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.