




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

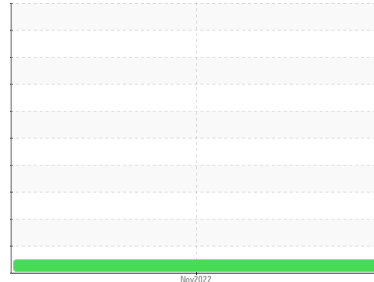

Machine Id
BOEING C-GLRN
 Component
B Hydraulic System
 Fluid
SKYDROL LD-4 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.
 NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The water content is negligible. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION

| | method | limit/base | current | history1 | history2 |
|---------------|-------------|-------------|--------------------|----------|----------|
| Sample Number | Client Info | | WC0626129 | --- | --- |
| Sample Date | Client Info | | 14 Nov 2022 | --- | --- |
| Machine Age | hrs | Client Info | 0 | --- | --- |
| Oil Age | hrs | Client Info | 0 | --- | --- |
| Oil Changed | Client Info | | N/A | --- | --- |
| Sample Status | | | NORMAL | --- | --- |

WEAR METALS

| | method | limit/base | current | history1 | history2 |
|-----------|--------|-------------------|--------------|----------|----------|
| Iron | ppm | ASTM D5185(m) >20 | 3 | --- | --- |
| Chromium | ppm | ASTM D5185(m) >20 | <1 | --- | --- |
| Nickel | ppm | ASTM D5185(m) >20 | <1 | --- | --- |
| Titanium | ppm | ASTM D5185(m) | 0 | --- | --- |
| Silver | ppm | ASTM D5185(m) | 0 | --- | --- |
| Aluminum | ppm | ASTM D5185(m) >20 | <1 | --- | --- |
| Lead | ppm | ASTM D5185(m) >20 | 0 | --- | --- |
| Copper | ppm | ASTM D5185(m) >20 | 5 | --- | --- |
| Tin | ppm | ASTM D5185(m) >20 | <1 | --- | --- |
| Antimony | ppm | ASTM D5185(m) | <1 | --- | --- |
| Vanadium | ppm | ASTM D5185(m) | 0 | --- | --- |
| Beryllium | ppm | ASTM D5185(m) | 0 | --- | --- |
| Cadmium | ppm | ASTM D5185(m) | 17 | --- | --- |

ADDITIVES

| | method | limit/base | current | history1 | history2 |
|------------|--------|---------------------|--------------|----------|----------|
| Boron | ppm | ASTM D5185(m) 0 | 2 | --- | --- |
| Barium | ppm | ASTM D5185(m) 0 | 0 | --- | --- |
| Molybdenum | ppm | ASTM D5185(m) 0 | 0 | --- | --- |
| Manganese | ppm | ASTM D5185(m) | 0 | --- | --- |
| Magnesium | ppm | ASTM D5185(m) 0 | <1 | --- | --- |
| Calcium | ppm | ASTM D5185(m) 0 | 8 | --- | --- |
| Phosphorus | ppm | ASTM D5185(m) 20000 | 27459 | --- | --- |
| Zinc | ppm | ASTM D5185(m) 0 | 3 | --- | --- |
| Sulfur | ppm | ASTM D5185(m) 1900 | 1542 | --- | --- |
| Lithium | ppm | ASTM D5185(m) | <1 | --- | --- |

CONTAMINANTS






| | method | limit/base | current | history1 | history2 |
|-----------|--------|-------------------|---------------|----------|----------|
| Silicon | ppm | ASTM D5185(m) >15 | 5 | --- | --- |
| Sodium | ppm | ASTM D5185(m) | 4 | --- | --- |
| Potassium | ppm | ASTM D5185(m) >20 | 22 | --- | --- |
| Water | % | ASTM D6304* >0.6 | 0.191 | --- | --- |
| ppm Water | ppm | ASTM D6304* >6000 | 1915.0 | --- | --- |

FLUID CLEANLINESS

| | method | limit/base | current | history1 | history2 |
|-----------------|--------------|------------|-----------------|----------|----------|
| Particles >4µm | ASTM D7647 | >5000 | 430 | --- | --- |
| Particles >6µm | ASTM D7647 | >1300 | 92 | --- | --- |
| Particles >14µm | ASTM D7647 | >160 | 11 | --- | --- |
| Particles >21µm | ASTM D7647 | >40 | 4 | --- | --- |
| Particles >38µm | ASTM D7647 | >10 | 1 | --- | --- |
| Particles >71µm | ASTM D7647 | >3 | 0 | --- | --- |
| Oil Cleanliness | ISO 4406 (c) | >19/17/14 | 16/14/11 | --- | --- |



OIL ANALYSIS REPORT

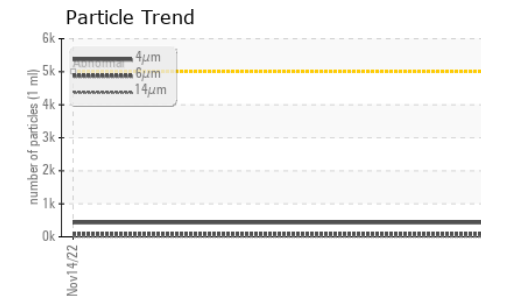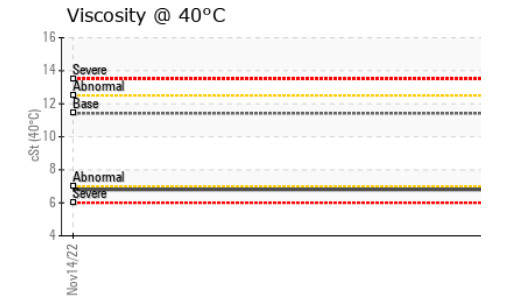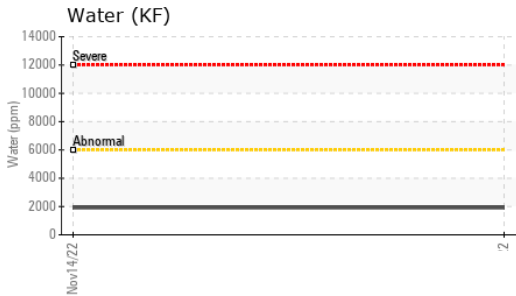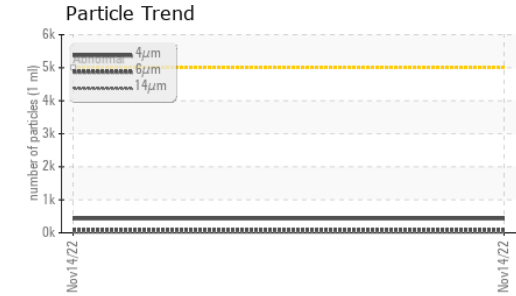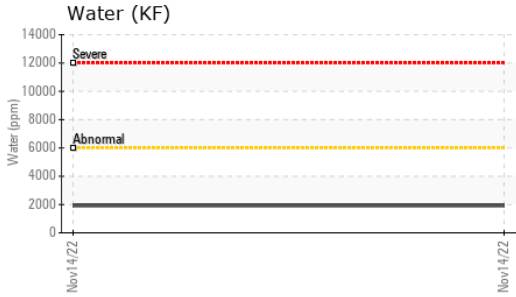

| FLUID DEGRADATION | | method | limit/base | current | history1 | history2 |
|-------------------|----------|------------|------------|-------------|----------|----------|
| Acid Number (AN) | mg KOH/g | ASTM D974* | 0.10 | 0.51 | --- | --- |






| VISUAL | | method | limit/base | current | history1 | history2 |
|------------------|--------|---------|------------|--------------|----------|----------|
| White Metal | scalar | Visual* | NONE | NONE | --- | --- |
| Yellow Metal | scalar | Visual* | NONE | NONE | --- | --- |
| Precipitate | scalar | Visual* | NONE | NONE | --- | --- |
| Silt | scalar | Visual* | NONE | NONE | --- | --- |
| Debris | scalar | Visual* | NONE | NONE | --- | --- |
| Sand/Dirt | scalar | Visual* | NONE | NONE | --- | --- |
| Appearance | scalar | Visual* | NORML | NORML | --- | --- |
| Odor | scalar | Visual* | NORML | NORML | --- | --- |
| Emulsified Water | scalar | Visual* | >0.6 | NEG | --- | --- |
| Free Water | scalar | Visual* | | NEG | --- | --- |

| FLUID PROPERTIES | | method | limit/base | current | history1 | history2 |
|------------------|-----|---------------|------------|------------|----------|----------|
| Visc @ 40°C | cSt | ASTM D7279(m) | 11.42 | 6.8 | --- | --- |

SAMPLE IMAGES

| method | limit/base | current | history1 | history2 |
|--------|------------|---------|----------|----------|
| Color | | | no image | no image |
| Bottom | | | no image | no image |

GRAPHS

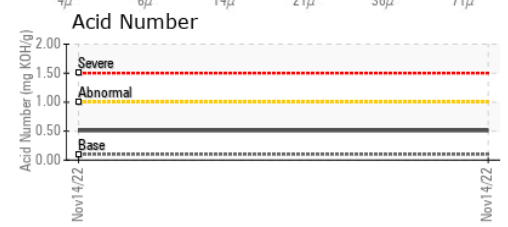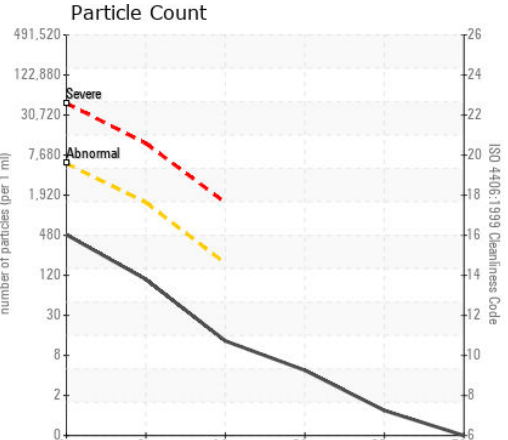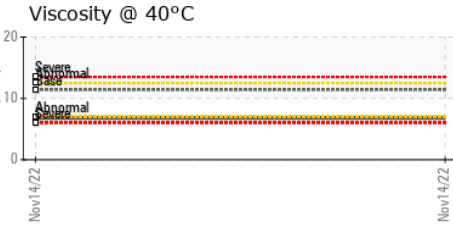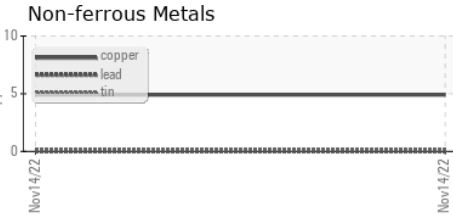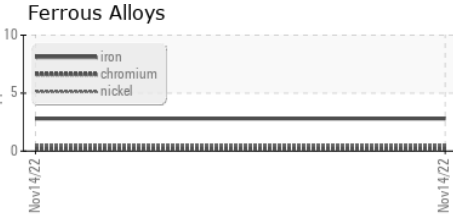

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0626129 **Received** : 15 Nov 2022
Lab Number : **02522801** **Diagnosed** : 17 Nov 2022
Unique Number : 5487782 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: KF, TAN Man)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

KF Aero
 9500 Airport Road
 Mount Hope, ON
 CA L0R 1W0
 Contact: Helen Krzywicki
 h.krzywicki@kfaero.ca
 T: (905)679-3313
 F: (905)679-4921