


OIL ANALYSIS REPORT

Sample Rating Trend



NORMAL

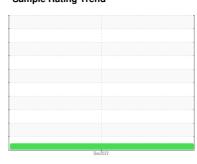

Machine Id **0001821**

Component

Rear Left Final Drive

DOOSAN 80W90 (--- GAL)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Dec2022		
SAMPLE INFOR	MATION	method	limit/base	current	history 1	history 2
Sample Number		Client Info		WC0713501		
Sample Date		Client Info		21 Dec 2022		
Machine Age	hrs	Client Info		135		
Oil Age	hrs	Client Info		135		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
Iron	ppm	ASTM D5185(m)	>500	43		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)		0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)	>50	<1		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185(m)		1		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		2		
Magnesium	ppm	ASTM D5185(m)		<1		
Calcium	ppm	ASTM D5185(m)		<1		
Phosphorus	ppm	ASTM D5185(m)		272		
Zinc	ppm	ASTM D5185(m)		6		
Sulfur	ppm	ASTM D5185(m)		13207		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANT		method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185(m)	>75	<1		
Sodium	ppm	ASTM D5185(m)	710	3		
Potassium	ppm	ASTM D5185(m)	>20	<1		
VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*	, U.L	NEG		
	Joanai	7 IOGGI				



OIL ANALYSIS REPORT

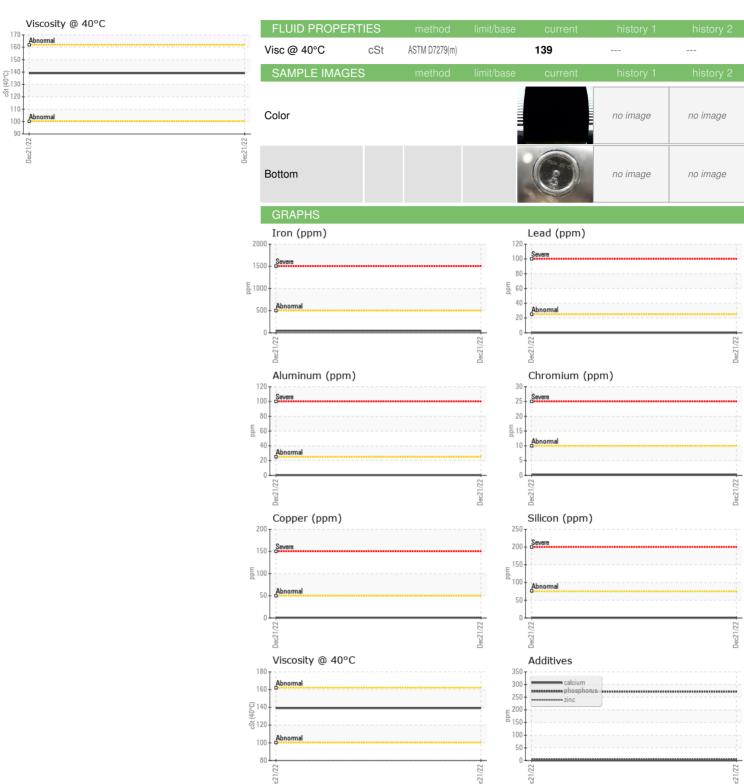



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9

: WC0713501 : 02530898 : 5511897

Received Diagnosed

: 29 Dec 2022 Diagnostician : Wes Davis

: 29 Dec 2022

Test Package : MOB 1 To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

C.G. EQUIPMENT

7367 Wellington Rd. 30, Unit A Guelph, ON

CA NOM 2TO

Contact: CG Equipment CG Guelph cory@cgequipment.com

> T: (519)826-0550 F: (519)837-2055