




OIL ANALYSIS REPORT

Sample Rating Trend

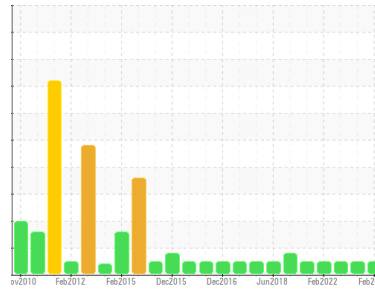

NORMAL



Area
T5 Bottle Line/T5 Labeller #1
 Machine Id
Labeler 1 Main Drive Gearbox
 Component
Gearbox
 Fluid
PETRO CANADA ENDURATEX EP 220 (--- GAL)

DIAGNOSIS

Recommendation

This is a baseline read-out on the submitted sample. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

Wear

All component wear rates are normal.

Contamination

Insufficient sample was received to conduct all the routine laboratory tests.

Fluid Condition

{not applicable}

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	PP	PP	PP
Sample Date	Client Info	03 Feb 2023	01 Aug 2022	29 Apr 2022
Machine Age	hrs	Client Info	0	0
Oil Age	hrs	Client Info	0	0
Oil Changed	Client Info	N/A	N/A	N/A
Sample Status		NORMAL	NORMAL	NORMAL

WEAR METALS

method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m) >200	<1	3	2
Chromium	ppm	ASTM D5185(m) >15	<1	<1	1
Nickel	ppm	ASTM D5185(m) >15	0	0	0
Titanium	ppm	ASTM D5185(m)	0	0	0
Silver	ppm	ASTM D5185(m)	0	0	0
Aluminum	ppm	ASTM D5185(m) >25	0	<1	<1
Lead	ppm	ASTM D5185(m) >100	0	<1	0
Copper	ppm	ASTM D5185(m) >200	1	1	1
Tin	ppm	ASTM D5185(m) >25	0	0	<1
Antimony	ppm	ASTM D5185(m) >5	<1	<1	0
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES

method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m) 60	1	2	2
Barium	ppm	ASTM D5185(m) 0	0	0	0
Molybdenum	ppm	ASTM D5185(m) 0	<1	<1	<1
Manganese	ppm	ASTM D5185(m) 0	0	0	0
Magnesium	ppm	ASTM D5185(m) 0	<1	<1	0
Calcium	ppm	ASTM D5185(m) 0	0	2	2
Phosphorus	ppm	ASTM D5185(m) 270	626	623	714
Zinc	ppm	ASTM D5185(m) 0	4	5	4
Sulfur	ppm	ASTM D5185(m) 11200	429	451	599
Lithium	ppm	ASTM D5185(m)	2	2	2

CONTAMINANTS

method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m) >50	10	9	9
Sodium	ppm	ASTM D5185(m)	0	<1	<1
Potassium	ppm	ASTM D5185(m) >20	<1	<1	0




VISUAL

method	limit/base	current	history1	history2		
White Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	LIGHT	LIGHT
Sand/Dirt	scalar	Visual*	NONE	NONE	LIGHT	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML	NORML

OIL ANALYSIS REPORT

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

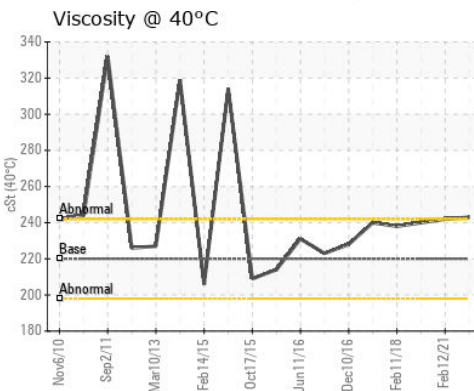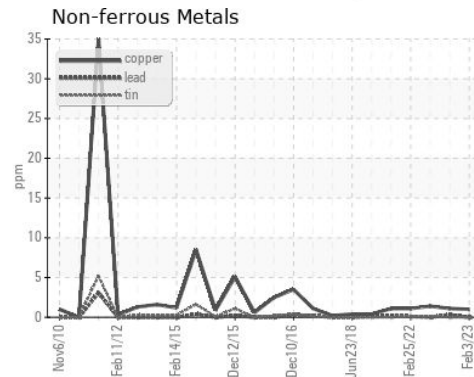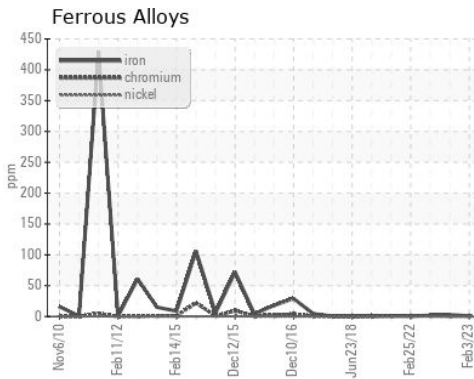

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : PP **Received** : 16 Feb 2023
Lab Number : 02540150 **Diagnosed** : 17 Feb 2023
Unique Number : 5529150 **Diagnostician** : Kevin Marson
Test Package : TEST (Additional Tests: ICP)

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

MOLSON TORONTO
 1 CARLINGVIEW DRIVE
 TORONTO, ON
 CA M9W 5E5
 Contact: Brian Goddard
 brian.goddard@molsoncoors.com

T:
F: