



OIL ANALYSIS REPORT

Sample Rating Trend

ISO



Area
BRANDT TRACTOR [02545910]
 Machine Id
JOHN DEERE 210P 1N000029 (S/N 1FF210PALF000029)
 Component
Hydraulic System
 Fluid
PANOLIN HLP SYNTH 46 (240 LTR)



DIAGNOSIS

Recommendation

Nous recommandons le remplacement des filtres de ce composant. Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

Wear

Les taux d'usure de tous les composants sont normaux.

Contamination

Il y a une légère quantité de limon (particules de 4 à 14 microns) dans l'huile. Il y a une faible concentration (<5.0%) d'huile minérale présente dans le fluide. La teneur en eau est négligeable.

Fluid Condition

Le AN est acceptable pour ce fluide. L'état de l'huile permet d'en prolonger l'utilisation.

SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	WC	---	---
Sample Date	Client Info	14 Mar 2023	---	---
Machine Age	hrs Client Info	2	---	---
Oil Age	hrs Client Info	0	---	---
Oil Changed	Client Info	N/A	---	---
Sample Status		ATTENTION	---	---

WEAR METALS

method	limit/base	current	history1	history2
Iron ppm ASTM D5185(m)	>32	<1	---	---
Chromium ppm ASTM D5185(m)	>9	0	---	---
Nickel ppm ASTM D5185(m)	>5	0	---	---
Titanium ppm ASTM D5185(m)		0	---	---
Silver ppm ASTM D5185(m)		0	---	---
Aluminum ppm ASTM D5185(m)	>9	0	---	---
Lead ppm ASTM D5185(m)	>28	0	---	---
Copper ppm ASTM D5185(m)	>50	<1	---	---
Tin ppm ASTM D5185(m)	>5	0	---	---
Antimony ppm ASTM D5185(m)		<1	---	---
Vanadium ppm ASTM D5185(m)		0	---	---
Beryllium ppm ASTM D5185(m)		0	---	---
Cadmium ppm ASTM D5185(m)		0	---	---

ADDITIVES






method	limit/base	current	history1	history2
Boron ppm ASTM D5185(m)	0	<1	---	---
Barium ppm ASTM D5185(m)	0	0	---	---
Molybdenum ppm ASTM D5185(m)	0	0	---	---
Manganese ppm ASTM D5185(m)	0	0	---	---
Magnesium ppm ASTM D5185(m)	0	0	---	---
Calcium ppm ASTM D5185(m)	0	0	---	---
Phosphorus ppm ASTM D5185(m)	1700	1667	---	---
Zinc ppm ASTM D5185(m)	0	1	---	---
Sulfur ppm ASTM D5185(m)	1350	1341	---	---
Lithium ppm ASTM D5185(m)		<1	---	---

CONTAMINANTS

method	limit/base	current	history1	history2
Silicon ppm ASTM D5185(m)	>11	1	---	---
Sodium ppm ASTM D5185(m)	>21	<1	---	---
Potassium ppm ASTM D5185(m)	>20	0	---	---
Water % ASTM D6304*	>0.05	0.020	---	---
ppm Water ppm ASTM D6304*	>500	205.3	---	---

INFRA-RED

method	limit/base	current	history1	history2
Soot % ASTM D7844*		0	---	---
Nitration Abs/cm ASTM D7624*		3.9	---	---
Sulfation Abs/.1mm ASTM D7415*		163.3	---	---
Mineral Oil Content % ASTM D7418*	<5.0%	<5.0	---	---

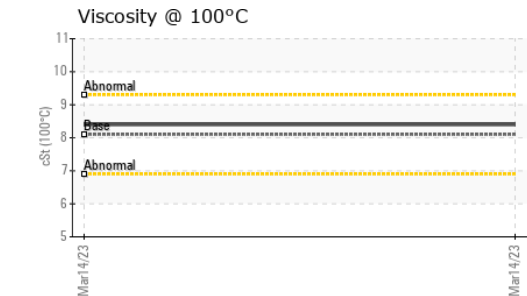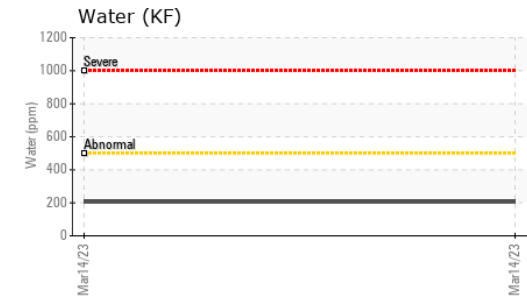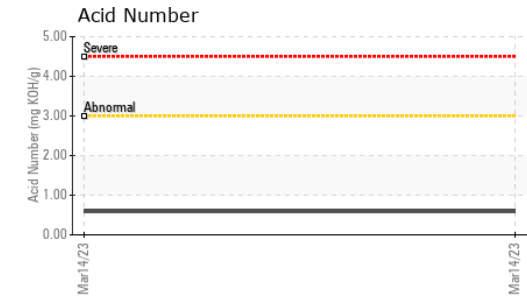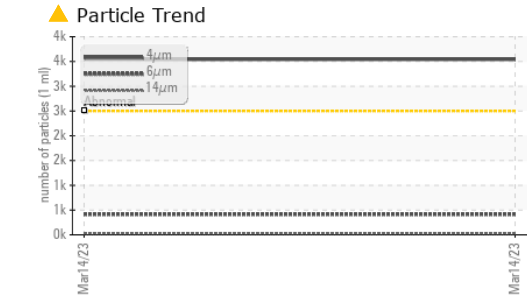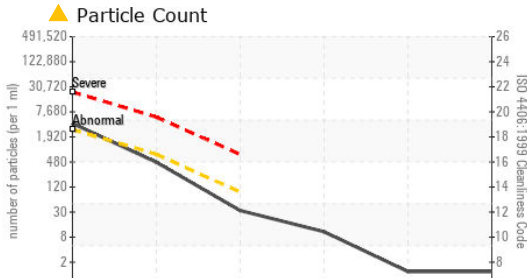

FLUID CLEANLINESS	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>2500	▲ 3543	---	---
Particles >6µm	ASTM D7647	>640	415	---	---
Particles >14µm	ASTM D7647	>80	29	---	---
Particles >21µm	ASTM D7647	>20	9	---	---
Particles >38µm	ASTM D7647	>4	1	---	---
Particles >71µm	ASTM D7647	>3	1	---	---
Oil Cleanliness	ISO 4406 (c)	>18/16/13	▲ 19/16/12	---	---

FLUID DEGRADATION	method	limit/base	current	history1	history2
Oxidation	Abs./1mm	ASTM D7414*	146.1	---	---
Acid Number (AN)	mg KOH/g	ASTM D974*	0.59	---	---

VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	---	---
Precipitate	scalar	Visual*	NONE	---	---
Silt	scalar	Visual*	NONE	---	---
Debris	scalar	Visual*	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	---	---
Appearance	scalar	Visual*	NORML	---	---
Odor	scalar	Visual*	NORML	---	---
Emulsified Water	scalar	Visual*	>0.05	---	---
Free Water	scalar	Visual*	NEG	---	---

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	47.0	---	---
Visc @ 100°C	cSt	ASTM D7279(m)	8.1	---	---
Viscosity Index (VI)	Scale	ASTM D2270*	146	---	---

SAMPLE IMAGES	method	limit/base	current	history1	history2	
Color					no image	no image
Bottom					no image	no image



Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC
Lab Number : 02545911
Unique Number : 5550921
Test Package : MOB 2 (Additional Tests: TAN Man)
Received : 16 Mar 2023
Diagnosed : 21 Mar 2023
Diagnostician : Bill Quesnel

Envirolin Canada
 520 rue Adanac
 Quebec, QC
 CA G1C 7B7
 Contact: Patrick Levesque
 patrick.levesque@envirolin.com
 T: (418)623-1216
 F: (418)660-8889

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.



MINERAL OIL CONTENT REPORT

PASS




Area
BRANDT TRACTOR [02545910]
 Machine Id
JOHN DEERE 210P 1N000029 (S/N 1FF210PALF000029)
 Component
Hydraulic System
 Fluid
PANOLIN HLP SYNTH 46 (240 LTR)


SPECTRAL ANALYSIS

		method	limit/base	current	history1	history2
Zinc	ppm	ASTM D5185(m)	0	1	---	---
Mineral Oil Content	%	ASTM D7418*	<5.0%	<5.0	---	---


FT-IR - Esters I

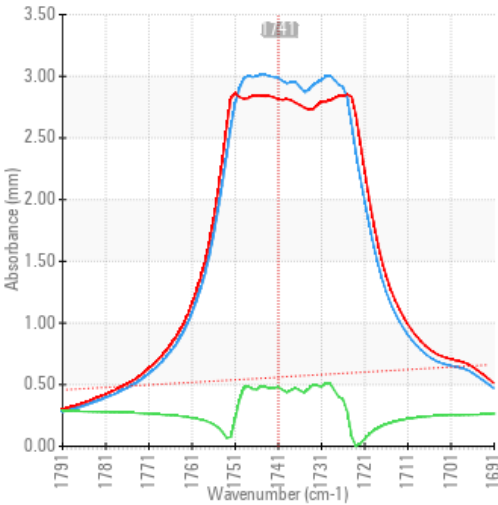

FT-IR - Esters II

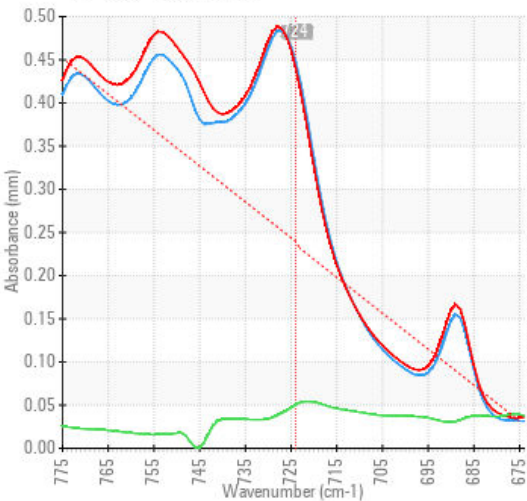

FT-IR Spectrum (Absorbance)

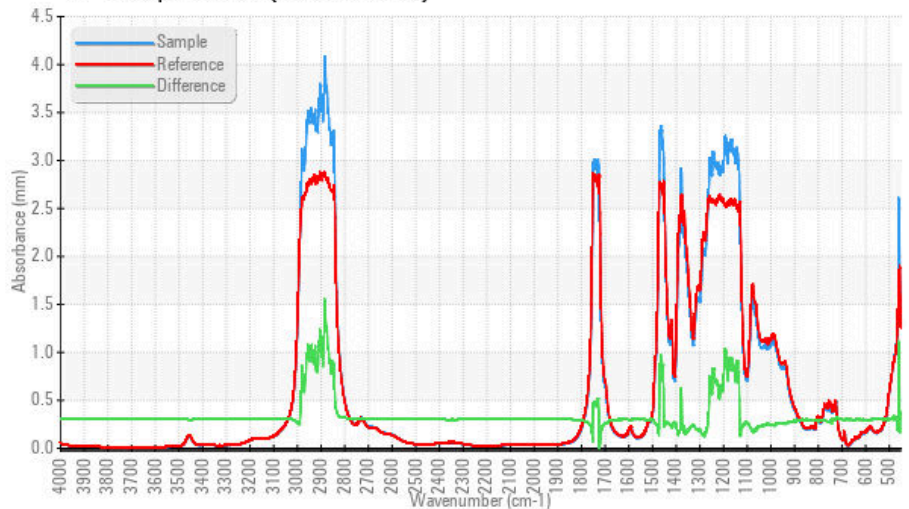

ISO 17025:2017
 Accredited
 Laboratory

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC
Lab Number : 02545911
Unique Number : 5550921
Test Package : MOB 2 (Additional Tests: TAN Man)

Received : 16 Mar 2023
Diagnosed : 21 Mar 2023
Diagnostician : Bill Quesnel

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Envirolin Canada

520 rue Adanac
 Quebec, QC
 CA G1C 7B7
 Contact: Patrick Levesque
 patrick.levesque@envirolin.com
 T: (418)623-1216
 F: (418)660-8889

This page left intentionally blank