


OIL ANALYSIS REPORT



NORMAL

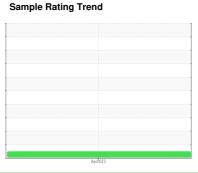

DHKCEWARTK5001421

Component

Front Right Gear Case

DOOSAN 80W90 (--- GAL)

Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the


Fluid Condition

Viscosity of sample indicates oil is within SAE 80 range, advise investigate. The condition of the oil is acceptable for the time in service.

				Apr2023		
SAMPLE INFORI	MATION	method	limit/base	current	history 1	history 2
Sample Number		Client Info		WC0811290		
Sample Date		Client Info		17 Apr 2023		
Machine Age	hrs	Client Info		416		
Oil Age	hrs	Client Info		416		
Oil Changed	1113	Client Info		Changed		
Sample Status		Oliciit iiilo		NORMAL		
WEAR METALS		method	limit/base			
				current	history 1	history 2
Iron	ppm	ASTM D5185(m)	>200	16		
Chromium	ppm	ASTM D5185(m)		<1		
Nickel	ppm	ASTM D5185(m)	>5	0		
Titanium	ppm	ASTM D5185(m)		<1		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>5	<1		
Lead	ppm	ASTM D5185(m)	>5	<1		
Copper	ppm	ASTM D5185(m)	>15	20		
Tin	ppm	ASTM D5185(m)	>5	0		
Antimony	ppm	ASTM D5185(m)	>5	<1		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185(m)		99		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		2		
Magnesium	ppm	ASTM D5185(m)		9		
Calcium	ppm	ASTM D5185(m)		3676		
Phosphorus	ppm	ASTM D5185(m)		1268		
Zinc	ppm	ASTM D5185(m)		1436		
Sulfur	ppm	ASTM D5185(m)		3334		
Lithium	ppm	ASTM D5185(m)		<1		
			live it //e e e e		la i a ta m . d	history O
CONTAMINANTS		method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185(m)	>15	7		
Sodium	ppm	ASTM D5185(m)		14		
Potassium	ppm	ASTM D5185(m)	>20	<1		
VISUAL		method	limit/base	current	history 1	history 2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
3:44:12) Rov: 1			Co		Maureen McDo	nald - CGEGLIE



OIL ANALYSIS REPORT

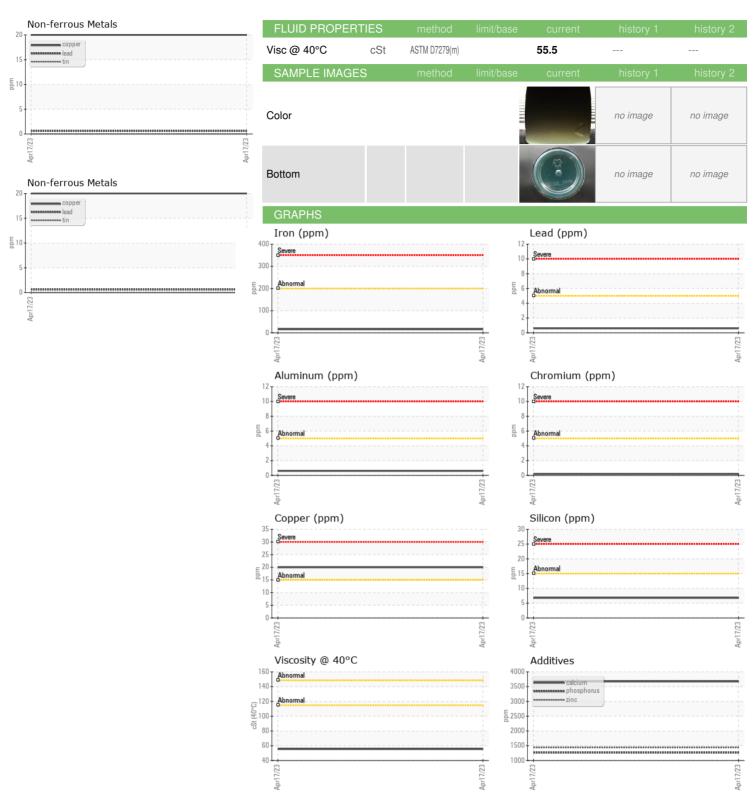



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WC0811290 : 02553696

: 5566711 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 26 Apr 2023 Diagnosed : 26 Apr 2023 Diagnostician : Kevin Marson

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

C.G. EQUIPMENT

7367 Wellington Rd. 30, Unit A Guelph, ON CA NOM 2TO

Contact: Maureen McDonald mmcdonald@cgequipment.com

T:

F: (519)837-2055