



# OIL ANALYSIS REPORT

Sample Rating Trend



ISO



Machine Id

## NO UNIT WC0793820

Component

### Hydraulic System

Fluid

{not provided} (--- LTR)

#### DIAGNOSIS

##### Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. We advise that you perform a filter service, and use off-line filtration to improve the cleanliness of the system fluid. We recommend an early resample to monitor this condition. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

##### Wear

All component wear rates are normal.

##### Contamination

There is a moderate amount of particulates (2 to 100 microns in size) present in the oil.

##### Fluid Condition

The AN level is acceptable for this fluid. The oil is still serviceable provided that the contaminant(s) can be reduced to acceptable levels.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0793820	---	---
Sample Date	Client Info			26 May 2023	---	---
Machine Age	mths	Client Info		0	---	---
Oil Age	mths	Client Info		0	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				ABNORMAL	---	---

CONTAMINATION		method	limit/base	current	history1	history2
Water	WC Method		>0.1	NEG	---	---

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	4	---	---
Chromium	ppm	ASTM D5185(m)	>10	0	---	---
Nickel	ppm	ASTM D5185(m)	>10	0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		0	---	---
Aluminum	ppm	ASTM D5185(m)	>10	0	---	---
Lead	ppm	ASTM D5185(m)	>10	0	---	---
Copper	ppm	ASTM D5185(m)	>75	1	---	---
Tin	ppm	ASTM D5185(m)	>10	<1	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---





ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	---	---
Barium	ppm	ASTM D5185(m)		0	---	---
Molybdenum	ppm	ASTM D5185(m)		0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)		0	---	---
Calcium	ppm	ASTM D5185(m)		0	---	---
Phosphorus	ppm	ASTM D5185(m)		<1	---	---
Zinc	ppm	ASTM D5185(m)		11	---	---
Sulfur	ppm	ASTM D5185(m)		104	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>20	5	---	---
Sodium	ppm	ASTM D5185(m)		0	---	---
Potassium	ppm	ASTM D5185(m)	>20	0	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>5000	● 8803	---	---	
Particles >6µm	ASTM D7647	>1300	▲ 2887	---	---	
Particles >14µm	ASTM D7647	>160	▲ 333	---	---	
Particles >21µm	ASTM D7647	>40	▲ 105	---	---	
Particles >38µm	ASTM D7647	>10	7	---	---	
Particles >71µm	ASTM D7647	>3	0	---	---	
Oil Cleanliness	ISO 4406 (c)	>19/17/14	▲ 20/19/16	---	---	



# OIL ANALYSIS REPORT

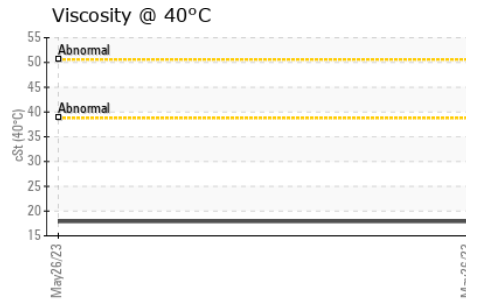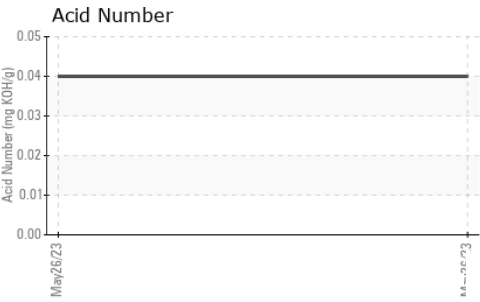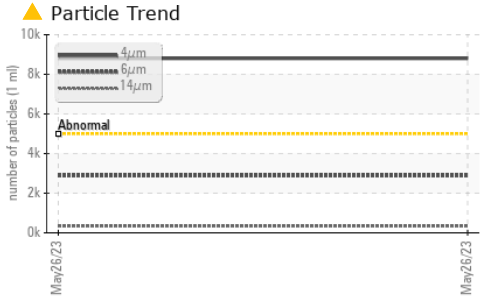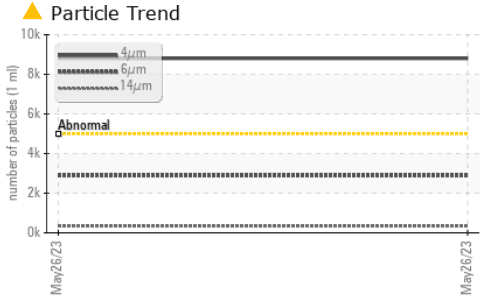

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*		<b>0.04</b>	---	---





VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	---	---
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	---	---
Silt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Debris	scalar	Visual*	NONE	<b>NONE</b>	---	---
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	---	---
Appearance	scalar	Visual*	NORML	<b>NORML</b>	---	---
Odor	scalar	Visual*	NORML	<b>NORML</b>	---	---
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	---	---
Free Water	scalar	Visual*		<b>NEG</b>	---	---

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)		<b>17.9</b>	---	---

### SAMPLE IMAGES

method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image

### GRAPHS

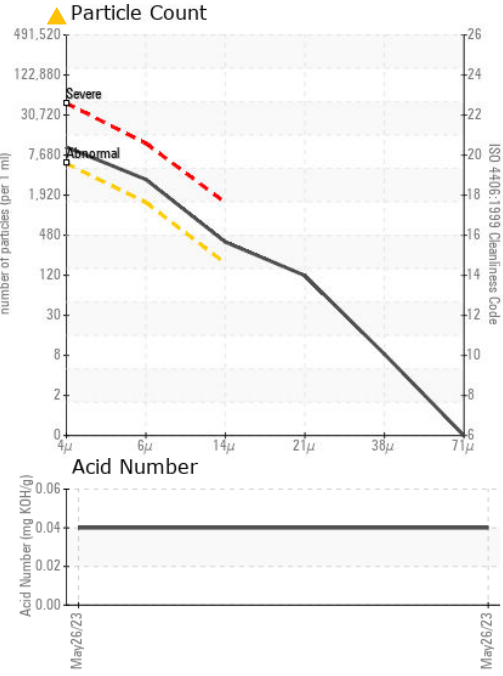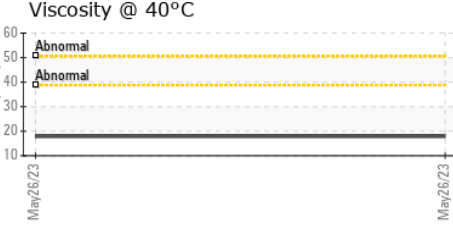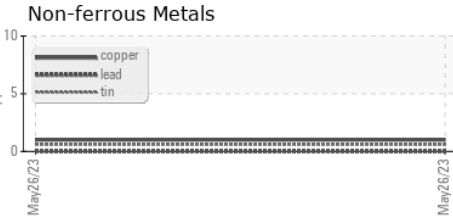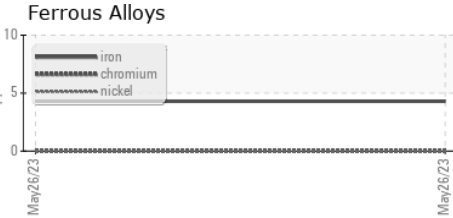

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0793820      **Received** : 31 May 2023  
**Lab Number** : **02560828**      **Tested** : 01 Jun 2023  
**Unique Number** : 5589869      **Diagnosed** : 01 Jun 2023 - Bill Quesnel  
**Test Package** : IND 2

**Constant Environmental Supply**  
 555 Main Street East; Unit 14  
 Milton, ON  
 CA L9T 3J2  
 Contact: Karl Wiebe  
 karl.wiebe@htpg.ca  
 T: (905)878-4912  
 F: (905)878-2812

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.