


# **OIL ANALYSIS REPORT**

# ASPIRE BRANTFORD [4501199253]

FRICK C7 (S/N F0142VFMCTHAA03)

Component
7 Screw Compressor

**CIMCO TYPE A (90 GAL)** 

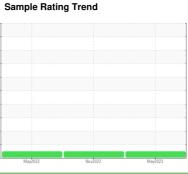



## Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The water content is negligible. The system and fluid cleanliness is acceptable.


## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		Ma	y2022	Nov2022 May20	23	
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0817812	WC0759236	WC0693998
Sample Date		Client Info		31 May 2023	30 Nov 2022	06 May 2022
Machine Age	hrs	Client Info		101046	97072	95574
Oil Age	hrs	Client Info		0	0	0
Oil Changed		Client Info		Not Changd	Not Changd	Not Changd
Sample Status				NORMAL	NORMAL	NORMAL
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>60	1	1	1
Chromium	ppm	ASTM D5185(m)	>4	0	0	0
Nickel	ppm	ASTM D5185(m)		0	<1	<1
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		0	0	0
Aluminum	ppm	ASTM D5185(m)	>5	0	0	0
Lead	ppm	ASTM D5185(m)	>10	0	0	0
Copper	ppm	ASTM D5185(m)	>30	0	0	<1
Tin	ppm	ASTM D5185(m)	>15	0	0	0
Antimony	ppm	ASTM D5185(m)		<1	0	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1	<1	<1
Barium	ppm	ASTM D5185(m)		0	0	0
Molybdenum	ppm	ASTM D5185(m)		0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)		<1	0	0
Calcium	ppm	ASTM D5185(m)		0	0	<1
Phosphorus	ppm	ASTM D5185(m)		<1	<1	1
Zinc	ppm	ASTM D5185(m)		<1	<1	<1
Sulfur	ppm	ASTM D5185(m)		71	73	67
Lithium	ppm	ASTM D5185(m)		<1	<1	<1
CONTAMINANTS	;	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	<1	0	0
Sodium	ppm	ASTM D5185(m)		0	<1	0
Potassium	ppm	ASTM D5185(m)	>20	<1	0	0
Water	%	ASTM D6304*	>0.1	0.00	0.001	0.001
ppm Water	ppm	ASTM D6304*	>1000	0.00	10.0	2.0
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*		0		
Nitration	Abs/cm	ASTM D7624*		1.7		
		10T11D=11E				
Sulfation	Abs/.1mm	ASTM D7415*		11.3		



## OIL ANALYSIS REPORT

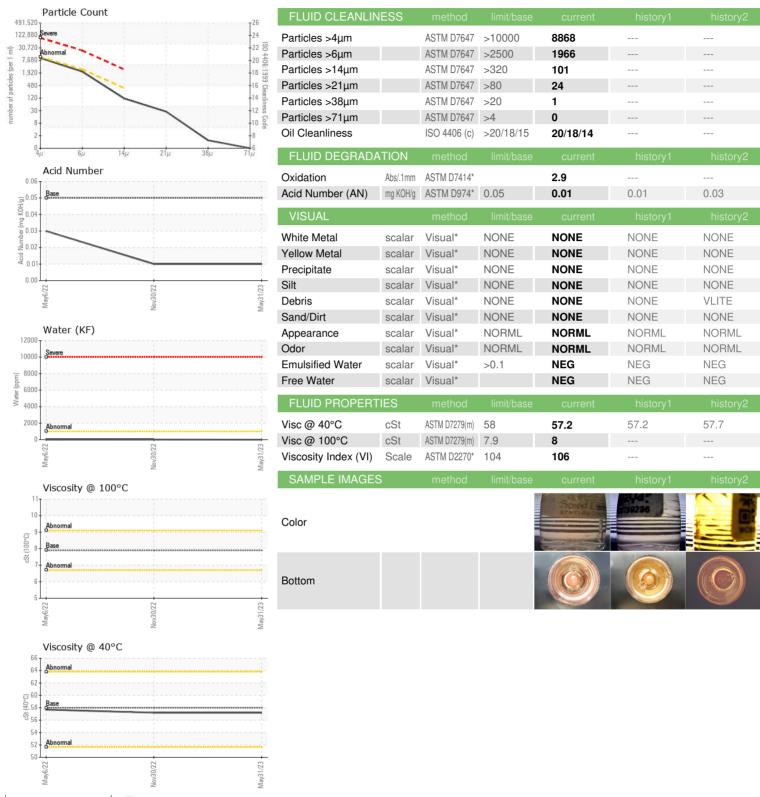



CALA ISO 17025:2017 Accredited

Laboratory

Laboratory Sample No. Lab Number **Unique Number** 

: WC0817812 : 02564716 : 5593757

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received Diagnosed

: 16 Jun 2023 : 19 Jun 2023 Diagnostician : Bill Quesnel

**CIMCO Refrigeration** 1551 Corporate Drive Burlington, ON CA L7L 6M3

Test Package : IND 2 (Additional Tests: FT-IR, ICP-NewOil, KF, KV100, TAN Man, VI) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Contact: DAVID PARISE DPARISE@ToROMONT.COM

Contact/Location: DAVID PARISE - CIMTOR

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: (416)465-7581 F: (416)465-8815