

# **OIL ANALYSIS REPORT**

Sample Rating Trend

**NORMAL** 



# R-2 AGITATOR

Component

Gearbox

MOBIL SHC 630 (--- GAL)

#### Recommendation

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

#### Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the

## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

	Jun2023					
SAMPLE INFORM	MATION	method	limit/base	current	history 1	history 2
Sample Number		Client Info		WC0820471		
Sample Date		Client Info		06 Jun 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history 1	history 2
PQ		ASTM D8184*		0		
Iron	ppm	ASTM D5185(m)	>200	6		
Chromium	ppm	ASTM D5185(m)	>15	0		
Nickel	ppm	ASTM D5185(m)	>15	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		0		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
Lead	ppm	ASTM D5185(m)	>100	0		
Copper	ppm	ASTM D5185(m)	>200	0		
Tin	ppm	ASTM D5185(m)	>25	0		
Antimony	ppm	ASTM D5185(m)	>5	<1		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history 1	history 2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		8		
Phosphorus	ppm	ASTM D5185(m)		501		
Zinc	ppm	ASTM D5185(m)		6		
Sulfur	ppm	ASTM D5185(m)		96		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	3	method	limit/base	current	history 1	history 2
Silicon	ppm	ASTM D5185(m)	>50	25		
Sodium	ppm	ASTM D5185(m)		0		
Potassium	ppm	ASTM D5185(m)	>20	<1		
FLUID DEGRADA	NOITA	method	limit/base	current	history 1	history 2


0.55

Acid Number (AN)

mg KOH/g ASTM D974\*



## **OIL ANALYSIS REPORT**

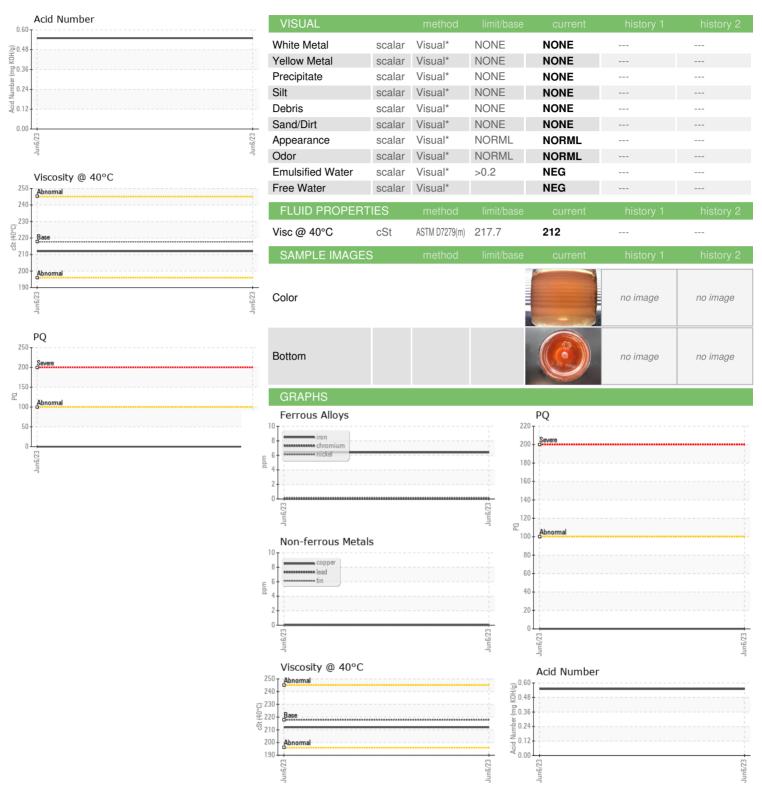



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number** 

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Hexion Canada Inc. - EDMONTON PLANT : WC0820471

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Received : 02565162 Diagnosed : 5594203

: 19 Jun 2023 : 19 Jun 2023 Diagnostician

: Kevin Marson

Test Package : IND 2 (Additional Tests: TAN Man)

Edmonton, AB **CA T5V 1E1** Contact: Scott Mckenzie scott.mckenzie@henxion.com

12621 - 156th Street NW

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: (780)447-8469 F: (780)447-7268