



# OIL ANALYSIS REPORT

Sample Rating Trend



ISO



Machine Id  
**T154-7702-230718-6**

Component  
**Hydraulic System**

Fluid  
**VALVOLINE I205 TRACTION OIL (50 GAL)**

## DIAGNOSIS

### ▲ Recommendation

This is a baseline read-out on the submitted sample.

### Wear

{not applicable}

### ▲ Contamination

{not applicable}

### Fluid Condition

{not applicable}

## SAMPLE INFORMATION

method	limit/base	current	history1	history2
Sample Number	Client Info	<b>WC0772835</b>	---	---
Sample Date	Client Info	<b>08 Aug 2023</b>	---	---
Machine Age	hrs	Client Info	<b>0</b>	---
Oil Age	hrs	Client Info	<b>0</b>	---
Oil Changed	Client Info	<b>N/A</b>	---	---
Sample Status		<b>ABNORMAL</b>	---	---



## FLUID CLEANLINESS

method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647 >1300	<b>▲ 2516</b>	---	---
Particles >6µm	ASTM D7647 >320	<b>151</b>	---	---
Particles >14µm	ASTM D7647 >80	<b>12</b>	---	---
Particles >21µm	ASTM D7647 >20	<b>3</b>	---	---
Particles >38µm	ASTM D7647 >4	<b>0</b>	---	---
Particles >71µm	ASTM D7647 >3	<b>0</b>	---	---
Oil Cleanliness	ISO 4406 (c) >17/15/13	<b>▲ 19/14/11</b>	---	---

## VISUAL



method	limit/base	current	history1	history2
White Metal	scalar	Visual* NONE	<b>NONE</b>	---
Yellow Metal	scalar	Visual* NONE	<b>NONE</b>	---
Precipitate	scalar	Visual* NONE	<b>NONE</b>	---
Silt	scalar	Visual* NONE	<b>NONE</b>	---
Debris	scalar	Visual* NONE	<b>NONE</b>	---
Sand/Dirt	scalar	Visual* NONE	<b>NONE</b>	---
Appearance	scalar	Visual* NORML	<b>NORML</b>	---
Odor	scalar	Visual* NORML	<b>NORML</b>	---

## SAMPLE IMAGES




method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image



# OIL ANALYSIS REPORT

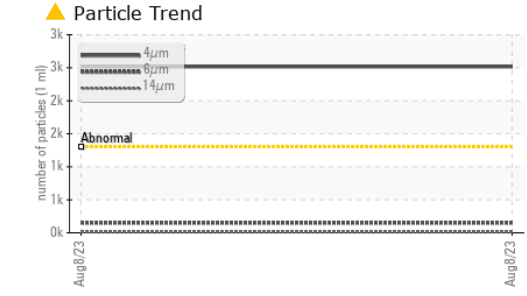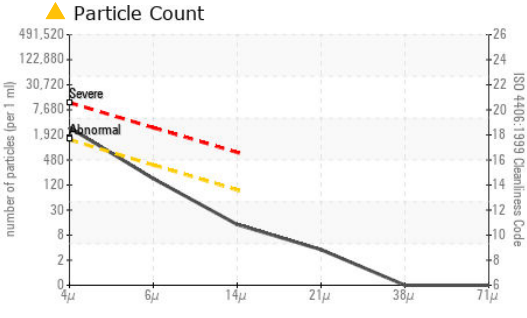

## GRAPHS

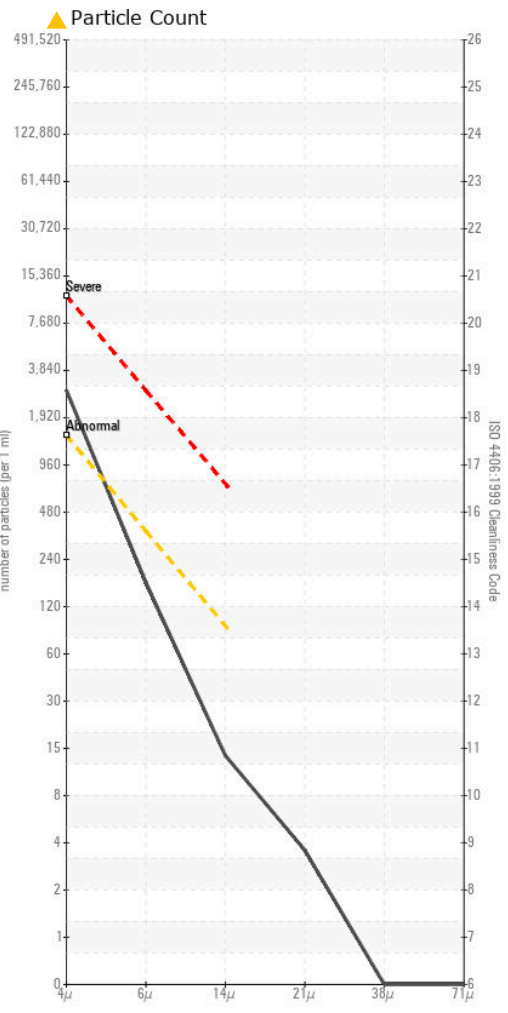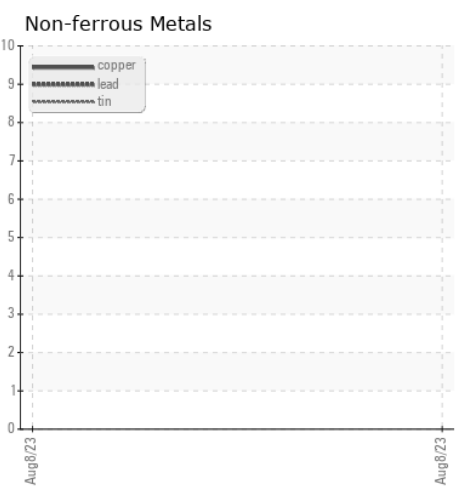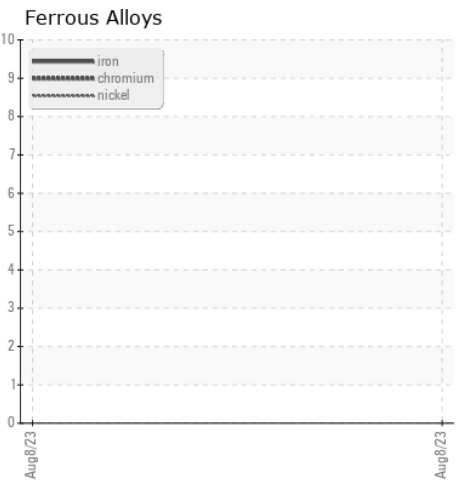

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0772835 **Received** : 09 Aug 2023  
**Lab Number** : 02574992 **Diagnosed** : 10 Aug 2023  
**Unique Number** : 5620043 **Diagnostician** : Kevin Marson  
**Test Package** : TEST ( Additional Tests: PrtCount )

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**CVT Corp.**  
 2101 Nobel, Suite N  
 Sainte-Julie, QC  
 CA J3E 1Z8  
 Contact: JR Desmeules  
 jrdesmeules@cvtcorp.com  
 T: (819)383-1347  
 F: (450)922-0335