


OIL ANALYSIS REPORT

KOHLER T0244

Component

Diesel Engine

DIESEL ENGINE OIL SAE 15W40 (--- LTR)

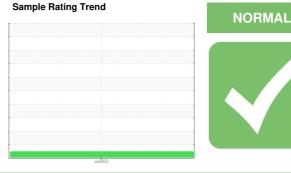

Recommendation

Resample at the next service interval to monitor.

Metal levels are typical for a new component breaking in.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Jul2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0764053		
Sample Date		Client Info		04 Jul 2023		
Machine Age	hrs	Client Info		145		
Oil Age	hrs	Client Info		21		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	2		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>4	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	0		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>40	0		
Copper	ppm	ASTM D5185(m)	>330	<1		
Tin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	250	3		
Barium	ppm	ASTM D5185(m)	10	0		
Molybdenum	ppm	ASTM D5185(m)	100	<1		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)	450	14		
Calcium	ppm	ASTM D5185(m)	3000	2228		
Phosphorus	ppm	ASTM D5185(m)	1150	917		
Zinc	ppm	ASTM D5185(m)	1350	978		
Sulfur	ppm	ASTM D5185(m)	4250	3442		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	5		
Sodium	ppm	ASTM D5185(m)	>158	2		
Potassium	ppm	ASTM D5185(m)	>20	1		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0		
Nitration	Abs/cm	ASTM D7624*	>20	5.0		
Sulfation	Abs/.1mm	ASTM D7415*	>30	15.3		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	7.7		



OIL ANALYSIS REPORT

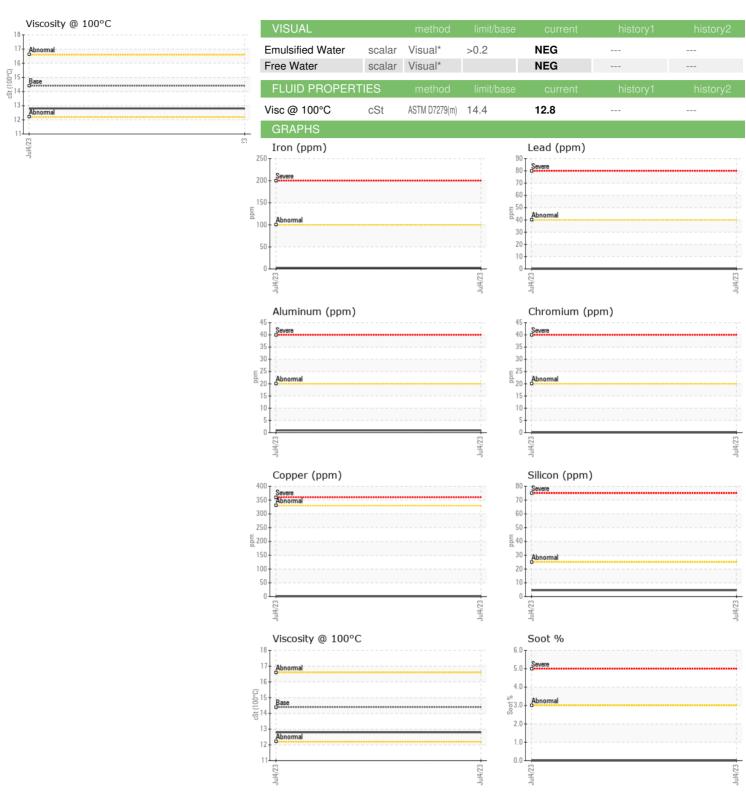



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : WC0764053

: 02575092 : 5620143

Received : 10 Aug 2023 Diagnosed

: 10 Aug 2023 Diagnostician : Wes Davis

Test Package : MOB 1 To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

GENCARE SERVICES LTD.

360 SOVEREIGN ROAD LONDON, ON **CA N6M 1A8**

Contact: Teresa Matthews tmatthews@gencare.com

T: (519)659-7118 F: (519)451-1707