


OIL ANALYSIS REPORT

VOLVO VNR 4626

Component **Diesel Engine**

PETRO CANADA DURON SHP 10W30 (--- 0

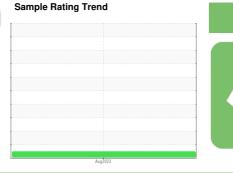



Recommendation

Resample at the next service interval to monitor.

All component wear rates are normal.

Contamination

Elevated aluminum (Al) and/or lead (Pb) and potassium (K) levels in your metals analysis are likely a result of solder flux release into the lubricant and is common on new equipment/components. There is no indication of any contamination in the


Fluid Condition

The condition of the oil is acceptable for the time in service.

AL)				Aug2023		
•	MATION				111	1:
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0831144		
Sample Date		Client Info		11 Aug 2023		
Machine Age	kms	Client Info		286895		
Oil Age	kms	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Fuel		WC Method	>6.0	<1.0		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	60		
Chromium	ppm	ASTM D5185(m)	>20	1		
Nickel	ppm	ASTM D5185(m)	>2	2		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>2	<1		
Aluminum	ppm	ASTM D5185(m)	>25	6		
Lead	ppm	ASTM D5185(m)	>40	3		
Copper	ppm	ASTM D5185(m)	>330	20		
Tin	ppm	ASTM D5185(m)	>15	2		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	2	3		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)	50	62		
Manganese	ppm	ASTM D5185(m)		2		
Magnesium	ppm	ASTM D5185(m)	950	951		
Calcium	ppm	ASTM D5185(m)	1050	1233		
Phosphorus	ppm	ASTM D5185(m)	995	962		
Zinc	ppm	ASTM D5185(m)	1180	1196		
Sulfur	ppm	ASTM D5185(m)	2600	2091		
Lithium	ppm	ASTM D5185(m)	2000	<1		
CONTAMINANTS	6	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	8		
Sodium	ppm	ASTM D5185(m)		4		
Potassium	ppm	ASTM D5185(m)	>20	11		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0.9		
Nitration	Abs/cm	ASTM D7624*	>20	12.2		
Sulfation	Abs/.1mm	ASTM D7415*	>30	26.5		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	22.3		



OIL ANALYSIS REPORT

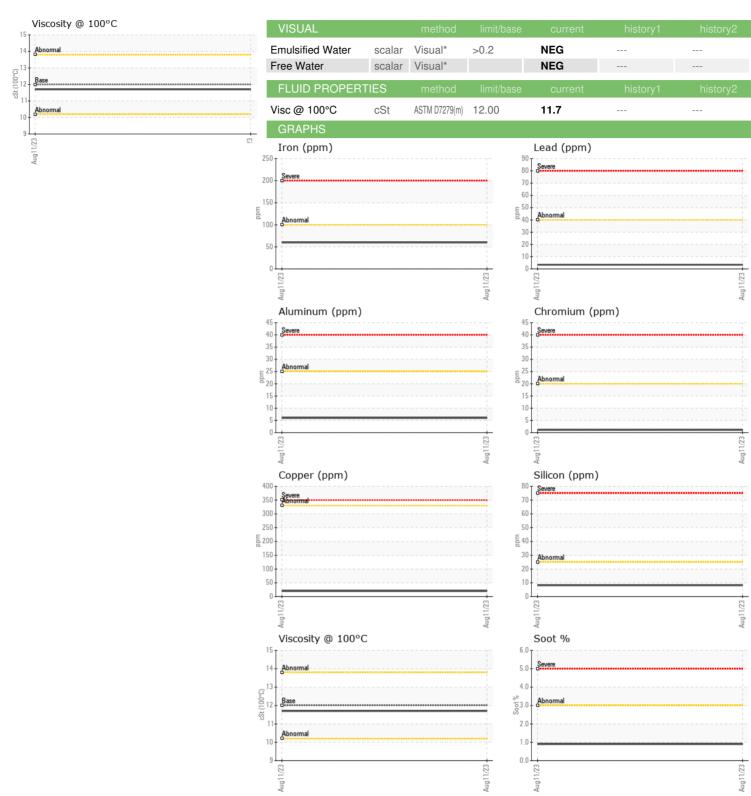



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

Test Package : MOB 1

: WC0831144 : 02575649

Received : 5620700

Diagnosed Diagnostician

: 14 Aug 2023 : 14 Aug 2023 : Wes Davis

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 PERFORMANCE EQUIPMENT - VISION TRUCK 415 EVANS AVENUE ETOBICOKE, ON CA M8W 0B3

Contact: Service etobservice@visiontruckgroup.com

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T:

F: