




# OIL ANALYSIS REPORT



Machine Id  
**LIDM01BE (S/N GZJ-00169)**  
 Component  
**Biogas Engine**  
 Fluid  
**CHEVRON HDAX 6500 LFG GAS ENGINE OIL (540 LTR)**

Sample Rating Trend

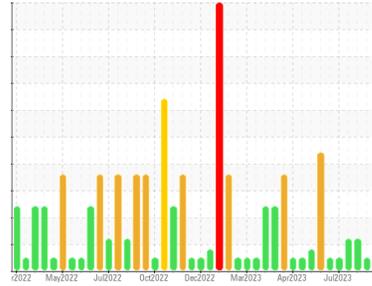

**NORMAL**



## DIAGNOSIS

### Recommendation

Échantillonner de nouveau l'équipement au prochain intervalle de vidange afin d'en surveiller la condition.

### Wear

Les taux d'usure de tous les composants sont normaux.

### Contamination

Il n'y a aucun indice de contamination dans l'huile.

### Fluid Condition

Le résultat pour le BN indique que la réserve d'alcalinité est acceptable pour l'huile. Le AN est acceptable pour ce fluide. L'état de l'huile permet d'en prolonger l'utilisation.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0817871</b>	WC0817901	WC0817941
Sample Date	Client Info		<b>28 Aug 2023</b>	21 Aug 2023	15 Aug 2023
Machine Age	hrs	Client Info	<b>921</b>	754	611
Oil Age	hrs	Client Info	<b>313</b>	141	611
Oil Changed	Client Info		<b>Not Chngd</b>	Not Chngd	Changed
Sample Status			<b>NORMAL</b>	NORMAL	ABNORMAL

## CONTAMINATION

	method	limit/base	current	history1	history2
Fuel	WC Method	>4.0	<b>&lt;1.0</b>	<1.0	<1.0
Glycol	WC Method		<b>NEG</b>	NEG	NEG

## WEAR METALS

	method	limit/base	current	history1	history2	
Iron	ppm	ASTM D5185(m)	>15	<b>2</b>	1	7
Chromium	ppm	ASTM D5185(m)	>4	<b>0</b>	0	<1
Nickel	ppm	ASTM D5185(m)	>2	<b>&lt;1</b>	0	<1
Titanium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	>5	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m)	>6	<b>2</b>	1	2
Lead	ppm	ASTM D5185(m)	>9	<b>&lt;1</b>	0	1
Copper	ppm	ASTM D5185(m)	>6	<b>2</b>	1	9
Tin	ppm	ASTM D5185(m)	>4	<b>1</b>	<1	4
Antimony	ppm	ASTM D5185(m)		<b>2</b>	1	4
Vanadium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)		<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)		<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2	
Boron	ppm	ASTM D5185(m)		<b>6</b>	7	6
Barium	ppm	ASTM D5185(m)		<b>0</b>	0	<1
Molybdenum	ppm	ASTM D5185(m)		<b>4</b>	4	4
Manganese	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1
Magnesium	ppm	ASTM D5185(m)		<b>16</b>	16	16
Calcium	ppm	ASTM D5185(m)		<b>1752</b>	1681	1730
Phosphorus	ppm	ASTM D5185(m)		<b>261</b>	253	258
Zinc	ppm	ASTM D5185(m)		<b>287</b>	282	296
Sulfur	ppm	ASTM D5185(m)		<b>2406</b>	1788	2684
Lithium	ppm	ASTM D5185(m)		<b>&lt;1</b>	<1	<1

## CONTAMINANTS




	method	limit/base	current	history1	history2	
Silicon	ppm	ASTM D5185(m)	>181	<b>83</b>	43	133
Sodium	ppm	ASTM D5185(m)		<b>1</b>	<1	9
Potassium	ppm	ASTM D5185(m)	>20	<b>1</b>	1	3

## INFRA-RED

	method	limit/base	current	history1	history2	
Soot %	%	ASTM D7844*		<b>0</b>	0	0
Nitration	Abs/cm	ASTM D7624*	>20	<b>4.7</b>	4.8	5.0
Sulfation	Abs/1mm	ASTM D7415*	>30	<b>20.2</b>	18.3	22.3



# OIL ANALYSIS REPORT






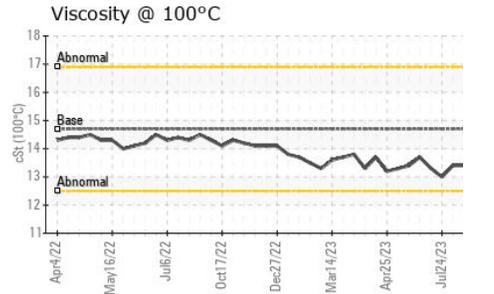
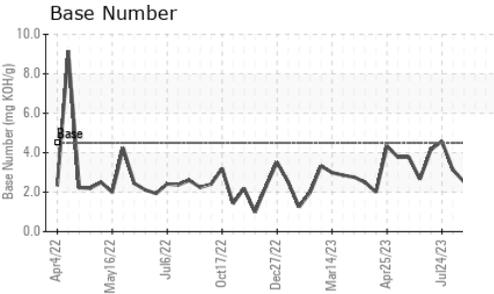
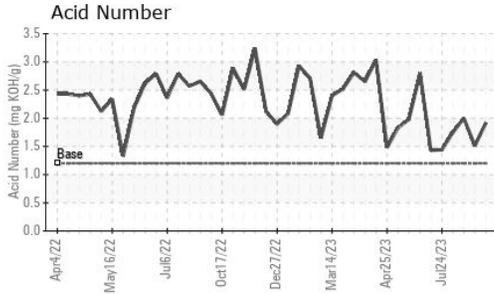


FLUID DEGRADATION	method	limit/base	current	history1	history2	
Oxidation	Abs./1mm	ASTM D7414*	>25	<b>8.9</b>	7.9	10.6
Acid Number (AN)	mg KOH/g	ASTM D974*	1.2	<b>1.92</b>	1.51	2.00
Base Number (BN)	mg KOH/g	ASTM D2896*	4.5	<b>3.01</b>	3.94	2.53
i-pH	Scale 0-14	ASTM D7946*	<4.5	<b>4.72</b>	5.58	▲ 4.28

VISUAL	method	limit/base	current	history1	history2	
Emulsified Water	scalar	Visual*	>0.1	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 100°C	cSt	ASTM D7279(m)	14.7	<b>13.3</b>	13.3	13.4

## GRAPHS

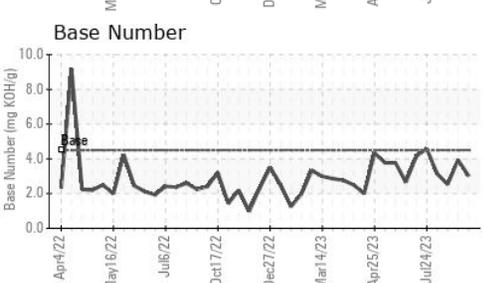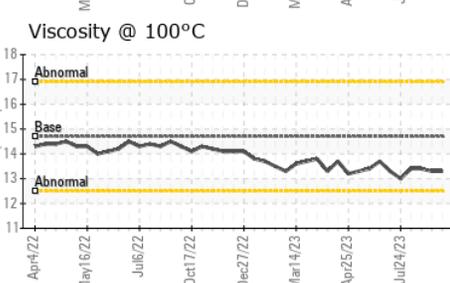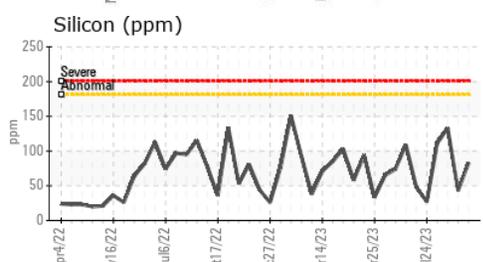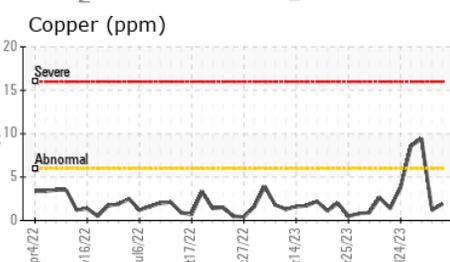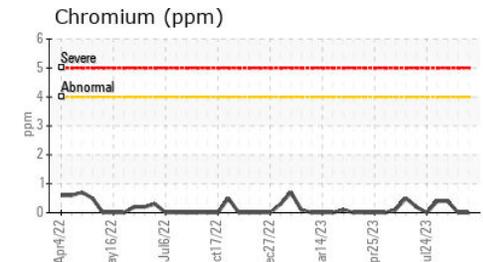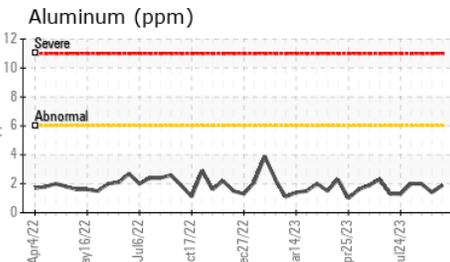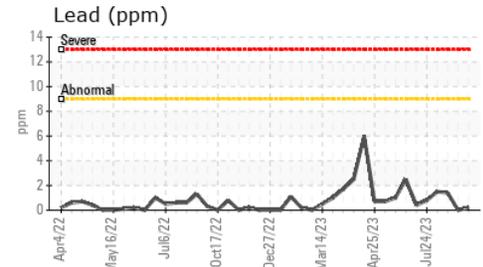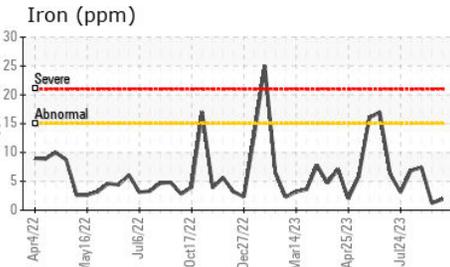

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0817871 **Received** : 29 Aug 2023  
**Lab Number** : **02579075** **Diagnosed** : 30 Aug 2023  
**Unique Number** : 5632135 **Diagnostician** : Kevin Marson  
**Test Package** : MOB 2 ( Additional Tests: i-pH, TAN Auto, TAN Man )

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.

**EDL NA Recips-Lydia**  
 6985 CHEMIN DES SOURCES  
 LACHUTE, QC  
 CA J8H 2C5  
 Contact: Eloi Legault  
 eloi.legault@energydi.com  
 T: (450)526-4001  
 F: