

OIL ANALYSIS REPORT

(C-GYFB) [C-GYFB] PIPER PA-28 R 200 RL-18456-51A

Component **Piston Aircraft Engine**

NOT GIVEN (8 LTR)

Recommendation

Resample at the next service interval to monitor. Please specify the brand, type, and viscosity of the oil on your next sample.

Wear


All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

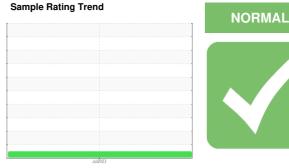





SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0834778		
Sample Date		Client Info		07 Jul 2023		
TSN	hrs	Client Info		2370		
TSO	hrs	Client Info		2370		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATION	۷	method	limit/base	current	history1	history2
Fuel		WC Method	>4.0	<1.0		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>90	7		
Chromium	ppm	ASTM D5185(m)	>20	<1		
Nickel	ppm	ASTM D5185(m)	>15	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>5	0		
Aluminum	ppm	ASTM D5185(m)	>25	3		
Lead	ppm	ASTM D5185(m)	>20000	1766		
Copper	ppm	ASTM D5185(m)	>25	1		
Tin	ppm	ASTM D5185(m)	>30	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		2		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		4		
Calcium	ppm	ASTM D5185(m)		20		
Phosphorus	ppm	ASTM D5185(m)		27		
Zinc	ppm	ASTM D5185(m)		5		
Sulfur	ppm	ASTM D5185(m)		1151		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	5		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	<1		



OIL ANALYSIS REPORT

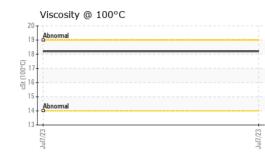

VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	MODER		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.1	NEG		
Free Water	scalar	Visual*		NEG		
FLUID PROPER	TIES	method	limit/base	ourropt	biotoryd	history ()
	IIES	methoa	iinii/base	current	history1	history2
Visc @ 100°C	cSt	ASTM D7279(m)		18.2		
GRAPHS						

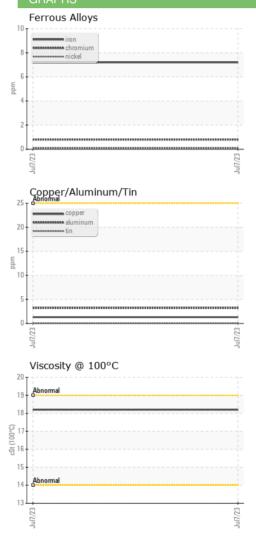



: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Laboratory CALA Sample No. : WC0834778 Lab Number : 02579336 ISO 17025:2017 Accredited Laboratory Unique Number : 5632396

Diagnostician : Kevin Marson Test Package : AVI 1 (Additional Tests: Bottom) To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

Received

Diagnosed

: 30 Aug 2023

: 30 Aug 2023

AIR PARTNERS INC. 2833 - 16TH AVENUE,, HANGAR 9 MARKHAM, ON CA L3R 0P8 Contact: Joanne joanne.airpartners@gmail.com Т: F: (905)513-8986