


# **OIL ANALYSIS REPORT**



**NORMAL** 

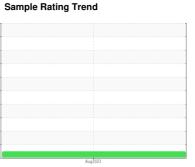

# **EPIROC ST18 SCP202**

Component

**Front Differential** 

PENNZOIL SYNTHETIC SAE 75W140 GL-5

Recommendation Confirm the source of the lubricant being utilized for top-up/fill. Resample at the next service interval to

# monitor.

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the oil.

### **Fluid Condition**

Additive levels indicate the addition of a different brand, or type of oil. The condition of the oil is acceptable for the time in service.

( GAL)						
		,		Aug2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0848089		
Sample Date		Client Info		31 Aug 2023		
Machine Age	hrs	Client Info		1760		
Oil Age	hrs	Client Info		400		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>500	120		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
Lead	ppm	ASTM D5185(m)	>25	0		
Copper	ppm	ASTM D5185(m)	>100	3		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		106		
Barium	ppm	ASTM D5185(m)		0		
Molybdenum	ppm	ASTM D5185(m)		<1		
Manganese	ppm	ASTM D5185(m)		1		
Magnesium	ppm	ASTM D5185(m)		1		
Calcium	ppm	ASTM D5185(m)		5		
Phosphorus	ppm	ASTM D5185(m)		918		
Zinc	ppm	ASTM D5185(m)		7		
Sulfur	ppm	ASTM D5185(m)		18339		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	nnm	ASTM D5185(m)	>75	5		
Sodium	ppm	ASTM D5185(m)	>10	1		
Potassium	ppm	ASTM D5185(m)	>20	<1		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	VLITE		
Debris	scalar	Visual*	NONE	VLITE		
Sand/Dirt						
Juliu/ Dirt	scalar	Visual*	NONE	NONE		
Annearance	scalar	Visual*	NONE	NONE		
Appearance Odor	scalar scalar scalar	Visual* Visual* Visual*	NONE NORML	NONE NORML NORML		

scalar Visual\*

scalar Visual\*

>.2

**Emulsified Water** 


Free Water

NEG

NEG



## **OIL ANALYSIS REPORT**

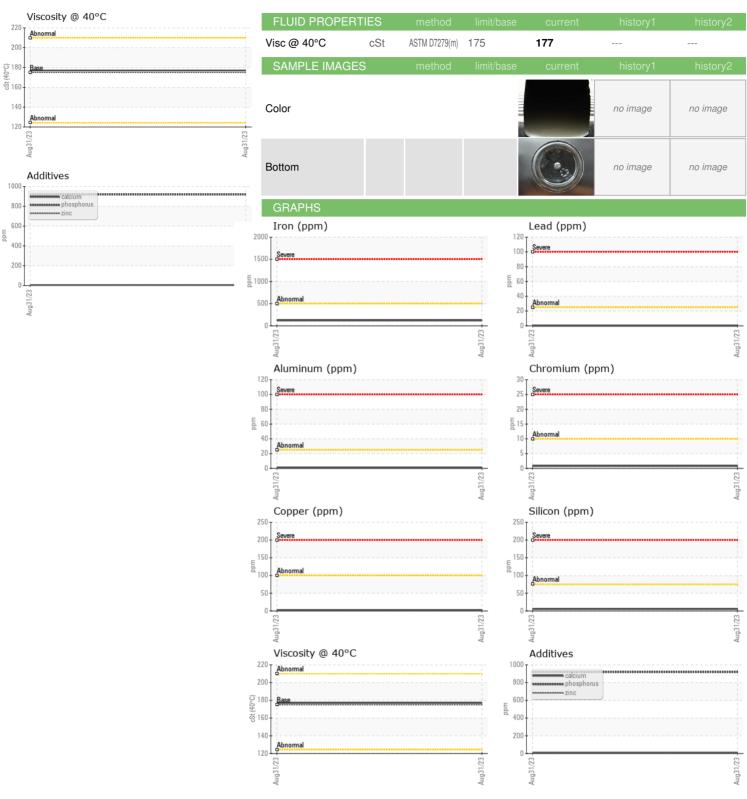



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number** Test Package : MOB 1

: WC0848089 : 02580458 : 5633518

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received Diagnosed

: 05 Sep 2023 : 05 Sep 2023 Diagnostician : Kevin Marson

Agnico Eagle Canada 1350 Government Rd. W, MACASSA COMPLEX Kirkland Lake, ON

CA P2N 3J1

Contact: Mitch Lamontagne AEM\_KL\_macassaoilsampleresults@agnicoeagle.com

> T: (705)567-5208 F: (705)567-5221

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.