


OIL ANALYSIS REPORT



NORMAL

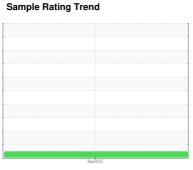

Machine Id **1570B** Component

2 Propel Gearbox

PARGON 320 (20 GAL)

Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample.

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.


Fluid Condition

The condition of the oil is acceptable for the time in service.

				Sep2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		BR0000790		
Sample Number		Client Info		20 Sep 2023		
Machine Age	hrs	Client Info		0 Sep 2023		
Oil Age	hrs	Client Info		0		
Oil Changed	1113	Client Info		N/A		
Sample Status		Oliciti IIIIo		NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>200	66		
Chromium	ppm	ASTM D5185(m)	>10	<1		
Nickel	ppm	ASTM D5185(m)	>10	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)		548		
Lead	ppm	ASTM D5185(m)		<1		
Copper	ppm	ASTM D5185(m)		2		
Tin	ppm	ASTM D5185(m)		0		
Antimony	ppm	ASTM D5185(m)	>5	6		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		<1		
Barium	ppm	ASTM D5185(m)		1		
Molybdenum	ppm	ASTM D5185(m)		560		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		2		
Calcium	ppm	ASTM D5185(m)		117		
Phosphorus	ppm	ASTM D5185(m)		805		
Zinc	ppm	ASTM D5185(m)		14		
Sulfur	ppm	ASTM D5185(m)		14450		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
						,=
Silicon	ppm	ASTM D5185(m)		78		
Sodium	ppm	ASTM D5185(m)	00	22		
Potassium	ppm	ASTM D5185(m)	>20	1		
VISUAL	l-:	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*	Contac	NEG		 CANESTSK



OIL ANALYSIS REPORT

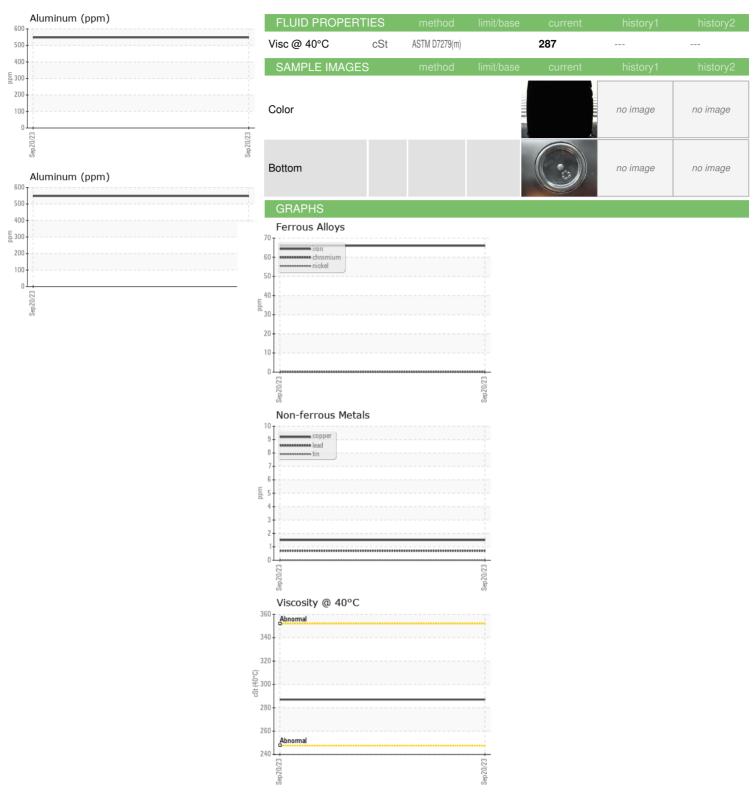



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5655024

Test Package : IND 1

: BR0000790 : 02585958

Received Diagnosed

: 28 Sep 2023 : 29 Sep 2023

Diagnostician : Kevin Marson

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 CAN JER INDUSTRIAL LUBRICANT LTD 419 MISSISSIPPIAN DRIVE

ESTEVAN, SK CA S4A 2A4

Contact: LANDON LILLEJORD

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.

Validity of results and interpretation are based on the sample and information as supplied.

llillrjord@canjer.com T:

F: