

OIL ANALYSIS REPORT

т

NORMAL




CATERPILLAR Génératrice tribord (S/N C6T00277)

Component

Diesel Engine

CHEVRON DELO 400 XLE 15W40 (18)

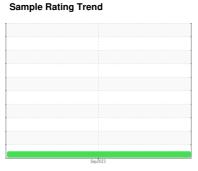



DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil


Fluid Condition

The condition of the oil is acceptable for the time in service.

(LE 15W40 (18)				Sep2023		
SAMPLE INFOR	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0854770		
Sample Date		Client Info		23 Sep 2023		
Machine Age	hrs	Client Info		24577		
Oil Age	hrs	Client Info		635		
Oil Changed		Client Info		Changed		
Sample Status				NORMAL		
CONTAMINATIO	N	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	8		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>2	<1		
Titanium	ppm	ASTM D5185(m)	>2	11		
Silver	ppm	ASTM D5185(m)	>2	<1		
Aluminum	ppm	ASTM D5185(m)	>25	2		
Lead	ppm	ASTM D5185(m)	>40	2		
Copper	ppm	ASTM D5185(m)	>330	8		
Tin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		120		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		48		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		608		
Calcium	ppm	ASTM D5185(m)		1547		
Phosphorus	ppm	ASTM D5185(m)		773		
Zinc	ppm	ASTM D5185(m)		921		
Sulfur	ppm	ASTM D5185(m)		2519		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS	3	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	4		
Sodium	ppm	ASTM D5185(m)		4		
Potassium	ppm	ASTM D5185(m)	>20	<1		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0.2		
Nitration	Abs/cm	ASTM D7624*	>20	8.6		
Sulfation	Abs/.1mm	ASTM D7415*	>30	19.5		
FLUID DEGRADA	ATION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	14.3		




OIL ANALYSIS REPORT

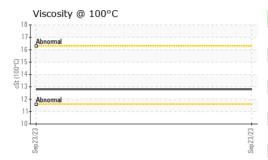


VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		

FLUID PROPER	THES	method		flistory i	History2
Visc @ 100°C	cSt	ASTM D7279(m)	12.8		

GRAPHS

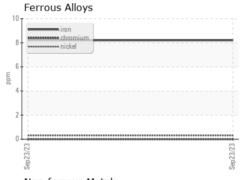

10 T	Non-ferrous Metals	
8-	copper	
E 6-		
udd 4-		
2 -		
0	C7	
	Sep23/23	Sep 23/23
	Viscosity @ 100°C	

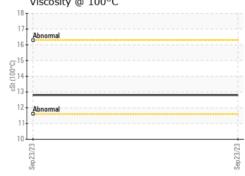



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5655136 Test Package : MAR 1

: WC0854770 : 02586070

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Canadian Coast Guard - CCGS Leim Received Diagnosed

: 02 Oct 2023 Diagnostician : Wes Davis

: 02 Oct 2023 850 route de la mer, Mont-Joli, QC CA G5H 3Z4

Contact: Philippe Clermont Leimce@ccgs-ngcc.gc.ca T: (418)732-2978

To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.