




# OIL ANALYSIS REPORT

Sample Rating Trend

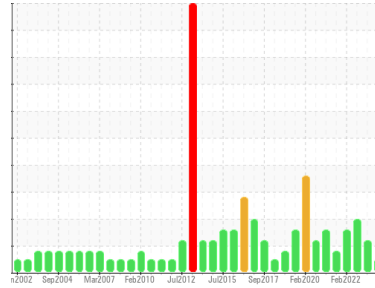

**NORMAL**



Area  
**COR**  
 Machine Id  
**LONGGEN2BRGDS**  
 Component  
**Bearing**  
 Fluid  
**SHELL TURBO T ISO 68 (25 LTR)**

## DIAGNOSIS

### Recommendation

Resample at the next service interval to monitor.

### Wear

All component wear rates are normal.

### Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The water content is negligible. The system and fluid cleanliness is acceptable.

### Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

## SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		<b>WC0790728</b>	WC0681470	WC0681487
Sample Date	Client Info		<b>14 Sep 2023</b>	22 Feb 2023	12 Sep 2022
Machine Age	mths	Client Info	<b>312</b>	305	300
Oil Age	mths	Client Info	<b>12</b>	5	12
Oil Changed	Client Info		<b>Changed</b>	Not Changd	Changed
Sample Status			<b>NORMAL</b>	ABNORMAL	ATTENTION

## WEAR METALS

	method	limit/base	current	history1	history2
PQ	ASTM D8184*		<b>0</b>	0	0
Iron	ppm	ASTM D5185(m) >20	<b>0</b>	<1	0
Chromium	ppm	ASTM D5185(m) >20	<b>0</b>	0	0
Nickel	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	0	0
Titanium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Silver	ppm	ASTM D5185(m)	<b>0</b>	0	0
Aluminum	ppm	ASTM D5185(m) >20	<b>0</b>	<1	0
Lead	ppm	ASTM D5185(m) >20	<b>0</b>	0	0
Copper	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	<1	0
Tin	ppm	ASTM D5185(m) >20	<b>&lt;1</b>	<1	<1
Antimony	ppm	ASTM D5185(m)	<b>0</b>	0	0
Vanadium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Beryllium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Cadmium	ppm	ASTM D5185(m)	<b>0</b>	0	0

## ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1
Barium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Molybdenum	ppm	ASTM D5185(m)	<b>0</b>	0	0
Manganese	ppm	ASTM D5185(m)	<b>0</b>	0	0
Magnesium	ppm	ASTM D5185(m)	<b>0</b>	0	0
Calcium	ppm	ASTM D5185(m)	<b>&lt;1</b>	0	0
Phosphorus	ppm	ASTM D5185(m)	<b>2</b>	2	<1
Zinc	ppm	ASTM D5185(m)	<b>1</b>	2	<1
Sulfur	ppm	ASTM D5185(m)	<b>59</b>	20	15
Lithium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	<1






## CONTAMINANTS

	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	<b>0</b>	0	0
Sodium	ppm	ASTM D5185(m)	<b>&lt;1</b>	<1	0
Potassium	ppm	ASTM D5185(m) >20	<b>0</b>	<1	0
Water	%	ASTM D6304* >2	<b>0.002</b>	0.001	0.001
ppm Water	ppm	ASTM D6304*	<b>21.3</b>	9.3	9.6

## FLUID CLEANLINESS

	method	limit/base	current	history1	history2
Particles >4µm	ASTM D7647	>10000	<b>7647</b>	9876	▲ 18623
Particles >6µm	ASTM D7647	>2500	<b>1719</b>	1934	▲ 3968
Particles >14µm	ASTM D7647	>160	<b>99</b>	▲ 244	▲ 231
Particles >21µm	ASTM D7647	>40	<b>22</b>	▲ 83	▲ 62
Particles >38µm	ASTM D7647	>10	<b>2</b>	4	2
Particles >71µm	ASTM D7647	>3	<b>0</b>	1	1
Oil Cleanliness	ISO 4406 (c)	>20/18/14	<b>20/18/14</b>	▲ 20/18/15	▲ 21/19/15

# OIL ANALYSIS REPORT

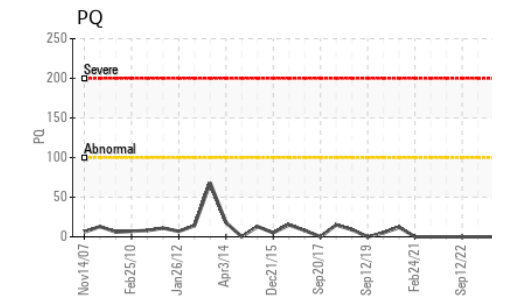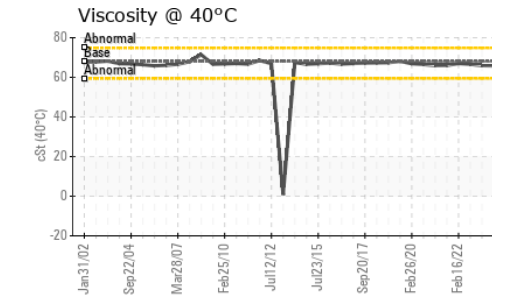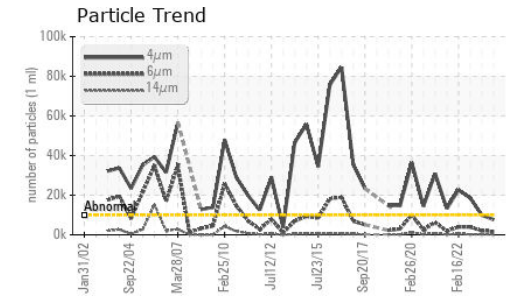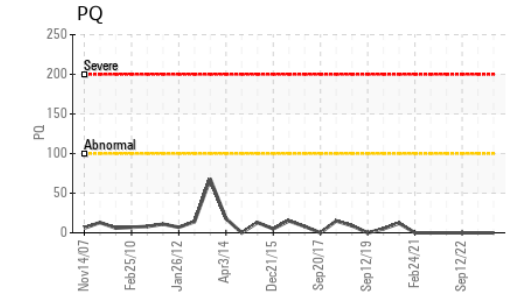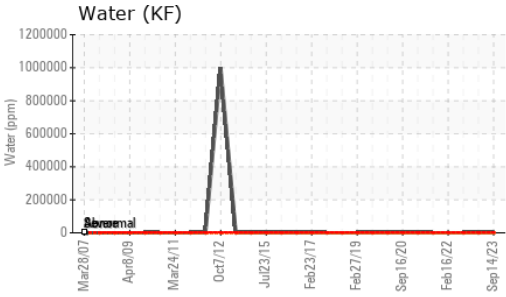


FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	.05	<b>0.09</b>	0.09	0.07






VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Precipitate	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Silt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Debris	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	<b>NONE</b>	NONE	NONE
Appearance	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Odor	scalar	Visual*	NORML	<b>NORML</b>	NORML	NORML
Emulsified Water	scalar	Visual*	>2	<b>NEG</b>	NEG	NEG
Free Water	scalar	Visual*		<b>NEG</b>	NEG	NEG

FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	68	<b>65.8</b>	65.9	66.6

### SAMPLE IMAGES

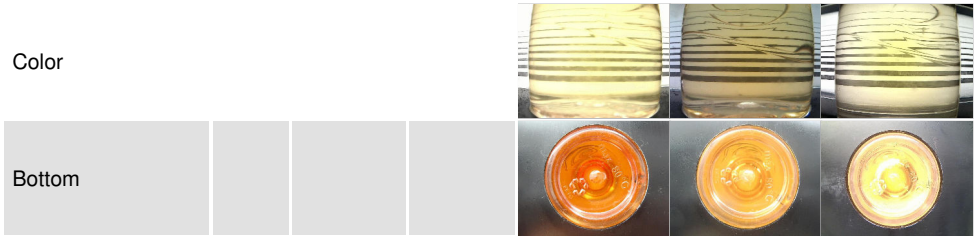

### GRAPHS

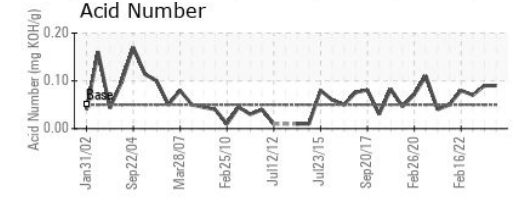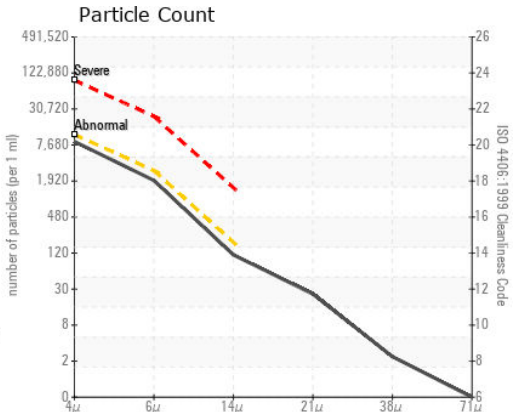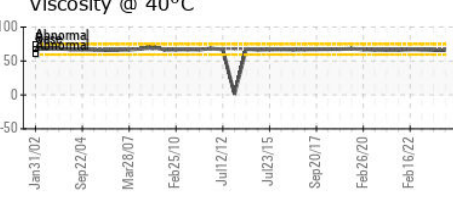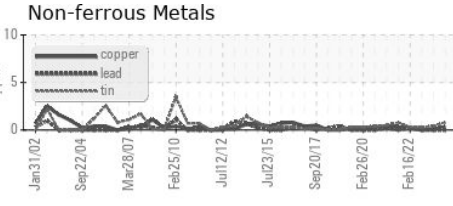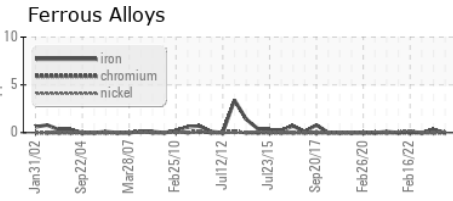

**Laboratory** : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9  
**Sample No.** : WC0790728  
**Lab Number** : 02586443  
**Unique Number** : 5655509  
**Test Package** : IND 2 ( Additional Tests: KF, Prcnt, TAN Man )  
**Received** : 03 Oct 2023  
**Tested** : 04 Oct 2023  
**Diagnosed** : 04 Oct 2023 - Kevin Marson

**ALGONQUIN POWER SYSTEMS INC.**  
 354 DAVIS ROAD  
 OAKVILLE, ON  
 CA L6J 2X1  
 Contact: Antonino Champ Fernando  
 antoninoChamp.fernando@algonquinpower.com  
 T: (905)465-7065  
 F: x:

To discuss this sample report, contact Customer Service at 1-800-268-2131.  
 Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab.  
 Validity of results and interpretation are based on the sample and information as supplied.