

## **OIL ANALYSIS REPORT**

# CON AGITATOR #1

Component Gearbox

NOT GIVEN (--- GAL)

# Sample Rating Trend



### Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the


### **Fluid Condition**

The condition of the oil is acceptable for the time in service.

				Sep2023		
SAMPLE INFORM	IATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0671181		
Sample Date		Client Info		25 Sep 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		Not Changd		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>200	36		
Chromium	ppm	ASTM D5185(m)	>10	0		
Nickel	ppm	ASTM D5185(m)	>10	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>25	<1		
Lead	ppm	ASTM D5185(m)	>50	2		
Copper	ppm	ASTM D5185(m)	>200	2		
Tin	ppm	ASTM D5185(m)	>10	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		10		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		0		
Calcium	ppm	ASTM D5185(m)		16		
Phosphorus	ppm	ASTM D5185(m)		256		
Zinc	ppm	ASTM D5185(m)		21		
Sulfur	ppm	ASTM D5185(m)		2310		
Lithium		ASTM D5185(m)		7		
	ppm	. ,				
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	22		
Sodium	ppm	ASTM D5185(m)		1		
Potassium	ppm	ASTM D5185(m)	>20	0		
VISUAL		method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE		
Yellow Metal	scalar	Visual*	NONE	NONE		
Precipitate	scalar	Visual*	NONE	NONE		
Silt	scalar	Visual*	NONE	NONE		
Debris	scalar	Visual*	NONE	NONE		
Sand/Dirt	scalar	Visual*	NONE	NONE		
Appearance	scalar	Visual*	NORML	NORML		
Odor	scalar	Visual*	NORML	NORML		
Emulsified Water	scalar	Visual*	>0.2	NEG		
Free Water	scalar	Visual*		NEG		
5:34:31) Rev: 1			Con	tact/Location: .I	acynthe Gelinas	- INCOCCSME



### **OIL ANALYSIS REPORT**

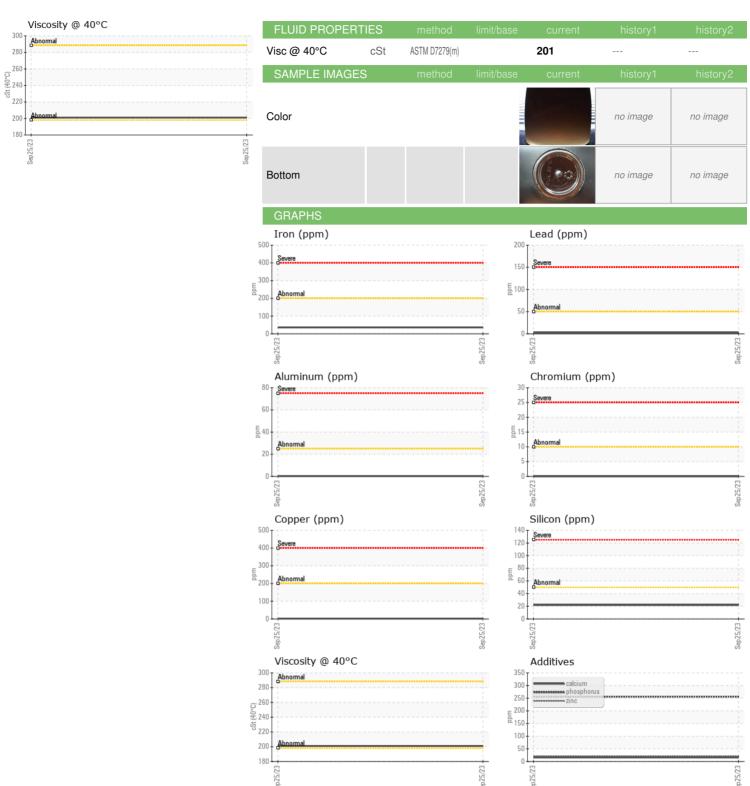



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number **Unique Number** 

: WC0671181 : 02586856

: 5655922 Test Package : MOB 1

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 04 Oct 2023 : 04 Oct 2023 Diagnosed

: Wes Davis Diagnostician

Vale - Copper Cliff Smelter COPPER CLIFF SMELTER WAREHOUSE, 155 BALSAM ST. COPPER CLIFF, ON

CA P0M 1N0 Contact: Jacynthe Gelinas jacynthe.gelinas@vale.com

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

T: (705)682-5980 F: (705)682-6535