




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

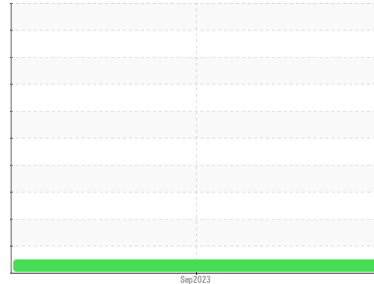

Machine Id
#2 BLAC (S/N 10585803)

Component
Unknown Component

Fluid
SHELL TURBO T ISO 46 (--- GAL)

DIAGNOSIS

Recommendation

Little or no information is provided as to the component and lubricant being tested. Recommendations are therefore generic in nature and may not apply to the current application. Please forward information as to equipment type, reservoir capacity, lubricant type and any pertinent information to allow for a more accurate assessment. Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample. Please provide more complete information on your next sample.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the sample is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0716525	---	---
Sample Date	Client Info			29 Sep 2023	---	---
Machine Age	hrs	Client Info		5353	---	---
Oil Age	hrs	Client Info		0	---	---
Oil Changed	Client Info			N/A	---	---
Sample Status				NORMAL	---	---

WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0	---	---
Iron	ppm	ASTM D5185(m)		0	---	---
Chromium	ppm	ASTM D5185(m)		0	---	---
Nickel	ppm	ASTM D5185(m)		0	---	---
Titanium	ppm	ASTM D5185(m)		0	---	---
Silver	ppm	ASTM D5185(m)		<1	---	---
Aluminum	ppm	ASTM D5185(m)		0	---	---
Lead	ppm	ASTM D5185(m)		0	---	---
Copper	ppm	ASTM D5185(m)		<1	---	---
Tin	ppm	ASTM D5185(m)		0	---	---
Antimony	ppm	ASTM D5185(m)		0	---	---
Vanadium	ppm	ASTM D5185(m)		0	---	---
Beryllium	ppm	ASTM D5185(m)		0	---	---
Cadmium	ppm	ASTM D5185(m)		0	---	---






ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	4.0	<1	---	---
Barium	ppm	ASTM D5185(m)	0	<1	---	---
Molybdenum	ppm	ASTM D5185(m)	0	0	---	---
Manganese	ppm	ASTM D5185(m)		0	---	---
Magnesium	ppm	ASTM D5185(m)	0	0	---	---
Calcium	ppm	ASTM D5185(m)	0	1	---	---
Phosphorus	ppm	ASTM D5185(m)	2.1	3	---	---
Zinc	ppm	ASTM D5185(m)	2.0	<1	---	---
Sulfur	ppm	ASTM D5185(m)	1300	180	---	---
Lithium	ppm	ASTM D5185(m)		<1	---	---

CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)		0	---	---
Sodium	ppm	ASTM D5185(m)		<1	---	---
Potassium	ppm	ASTM D5185(m)	>20	0	---	---

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	4199	---	---
Particles >6µm		ASTM D7647	>1300	875	---	---
Particles >14µm		ASTM D7647	>160	44	---	---
Particles >21µm		ASTM D7647	>40	10	---	---
Particles >38µm		ASTM D7647	>10	1	---	---
Particles >71µm		ASTM D7647	>3	0	---	---
Oil Cleanliness		ISO 4406 (c)	>19/17/14	19/17/13	---	---



OIL ANALYSIS REPORT

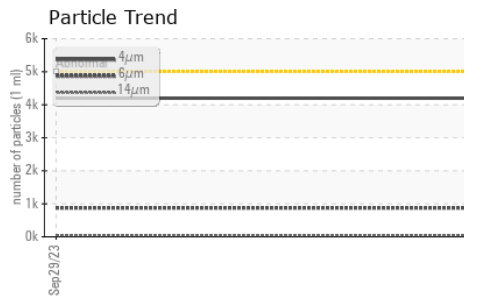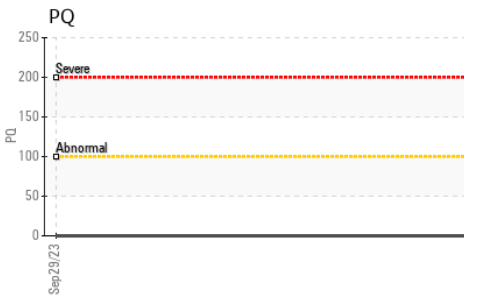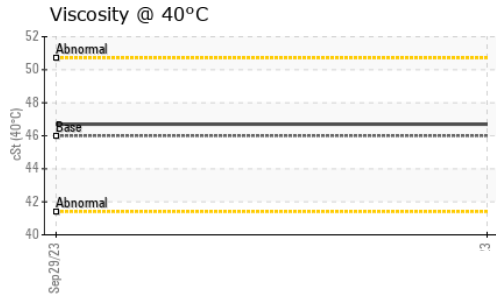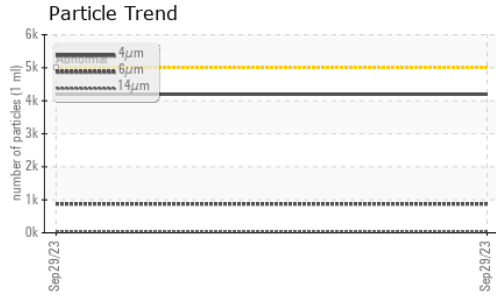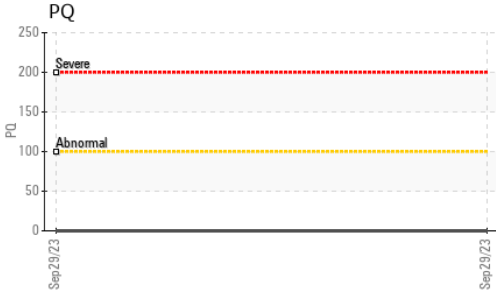

FLUID DEGRADATION	method	limit/base	current	history1	history2	
Acid Number (AN)	mg KOH/g	ASTM D974*	.05	0.10	---	---






VISUAL	method	limit/base	current	history1	history2	
White Metal	scalar	Visual*	NONE	NONE	---	---
Yellow Metal	scalar	Visual*	NONE	NONE	---	---
Precipitate	scalar	Visual*	NONE	NONE	---	---
Silt	scalar	Visual*	NONE	NONE	---	---
Debris	scalar	Visual*	NONE	NONE	---	---
Sand/Dirt	scalar	Visual*	NONE	NONE	---	---
Appearance	scalar	Visual*	NORML	NORML	---	---
Odor	scalar	Visual*	NORML	NORML	---	---
Emulsified Water	scalar	Visual*	NEG	---	---	
Free Water	scalar	Visual*	NEG	---	---	

FLUID PROPERTIES	method	limit/base	current	history1	history2	
Visc @ 40°C	cSt	ASTM D7279(m)	46	46.7	---	---

SAMPLE IMAGES

method	limit/base	current	history1	history2
Color			no image	no image
Bottom			no image	no image

GRAPHS

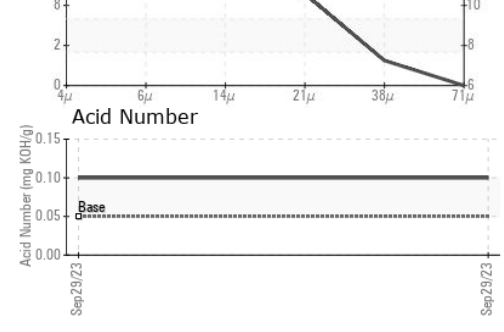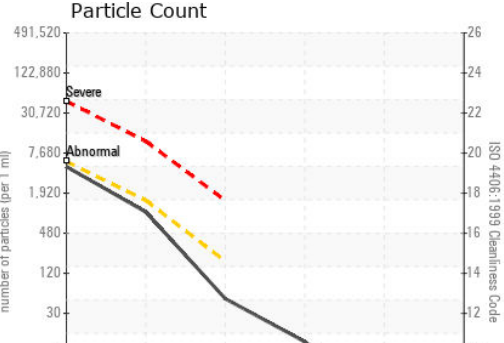

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9
Sample No. : WC0716525 **Received** : 05 Oct 2023
Lab Number : **02587147** **Diagnosed** : 10 Oct 2023
Unique Number : 5656213 **Diagnostician** : Kevin Marson
Test Package : IND 2 (Additional Tests: PQ, PrtCount, TAN Man)

Vale - Copper Cliff Smelter
 COPPER CLIFF SMELTER WAREHOUSE, 155 BALSAM ST.
 COPPER CLIFF, ON
 CA P0M 1N0
 Contact: Jacynthe Gelinas
 jacynthe.gelinas@vale.com
 T: (705)682-5980
 F: (705)682-6535

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.