




OIL ANALYSIS REPORT

Sample Rating Trend

NORMAL

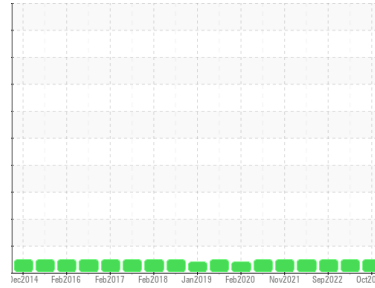

Area
MTR [73955]
 Machine Id
TINHGOV4

Component
Hydraulic System
 Fluid
ESSO TERESSO ISO 46 (160 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

The system cleanliness is acceptable for your target ISO 4406 cleanliness code. The system and fluid cleanliness is acceptable.

Fluid Condition

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

SAMPLE INFORMATION		method	limit/base	current	history1	history2
Sample Number	Client Info			WC0862791	WC0678271	WC0511685
Sample Date	Client Info			03 Oct 2023	28 Feb 2023	12 Sep 2022
Machine Age	yrs	Client Info		0	0	0
Oil Age	yrs	Client Info		5	5	5
Oil Changed	Client Info			Changed	Not Changd	N/A
Sample Status				NORMAL	NORMAL	NORMAL

WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>20	<1	<1	<1
Chromium	ppm	ASTM D5185(m)	>20	0	0	0
Nickel	ppm	ASTM D5185(m)	>20	<1	0	0
Titanium	ppm	ASTM D5185(m)		0	0	0
Silver	ppm	ASTM D5185(m)		<1	0	0
Aluminum	ppm	ASTM D5185(m)	>20	<1	<1	<1
Lead	ppm	ASTM D5185(m)	>20	1	1	1
Copper	ppm	ASTM D5185(m)	>20	<1	<1	<1
Tin	ppm	ASTM D5185(m)	>20	0	0	0
Antimony	ppm	ASTM D5185(m)		0	0	<1
Vanadium	ppm	ASTM D5185(m)		0	0	0
Beryllium	ppm	ASTM D5185(m)		0	0	0
Cadmium	ppm	ASTM D5185(m)		0	0	0

ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)	0	<1	<1	<1
Barium	ppm	ASTM D5185(m)		<1	0	0
Molybdenum	ppm	ASTM D5185(m)	0	0	0	0
Manganese	ppm	ASTM D5185(m)		0	0	0
Magnesium	ppm	ASTM D5185(m)	0	0	0	0
Calcium	ppm	ASTM D5185(m)	0	<1	0	<1
Phosphorus	ppm	ASTM D5185(m)	2.4	2	<1	<1
Zinc	ppm	ASTM D5185(m)	0	3	2	3
Sulfur	ppm	ASTM D5185(m)		991	1021	1239
Lithium	ppm	ASTM D5185(m)		<1	<1	<1





CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>15	0	0	0
Sodium	ppm	ASTM D5185(m)		<1	0	0
Potassium	ppm	ASTM D5185(m)	>20	0	0	0

FLUID CLEANLINESS		method	limit/base	current	history1	history2
Particles >4µm		ASTM D7647	>5000	812	1230	1680
Particles >6µm		ASTM D7647	>1300	118	132	210
Particles >14µm		ASTM D7647	>160	5	3	11
Particles >21µm		ASTM D7647	>40	2	1	3
Particles >38µm		ASTM D7647	>10	0	0	0
Particles >71µm		ASTM D7647	>3	0	0	0
Oil Cleanliness		ISO 4406 (c)	>19/17/14	17/14/10	17/14/9	18/15/11

FLUID DEGRADATION		method	limit/base	current	history1	history2
Acid Number (AN)	mg KOH/g	ASTM D974*	0.02	0.11	0.11	0.15



OIL ANALYSIS REPORT



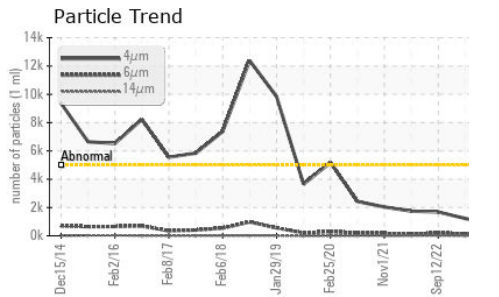
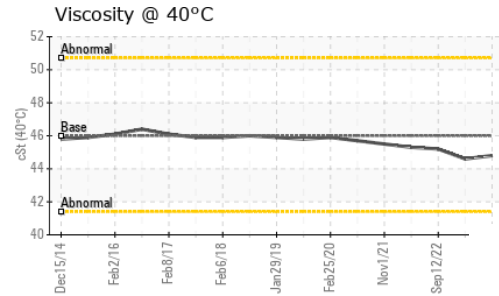
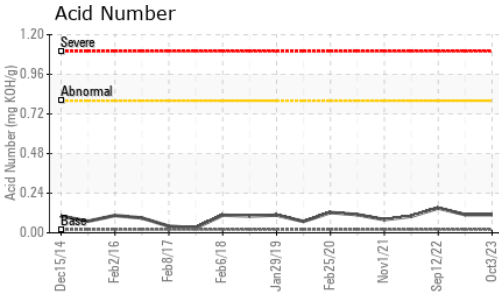
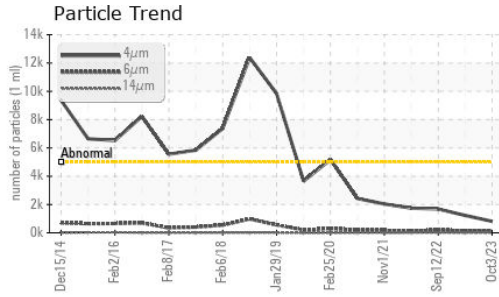


VISUAL	method	limit/base	current	history1	history2
White Metal	scalar	Visual*	NONE	NONE	NONE
Yellow Metal	scalar	Visual*	NONE	NONE	NONE
Precipitate	scalar	Visual*	NONE	NONE	NONE
Silt	scalar	Visual*	NONE	NONE	NONE
Debris	scalar	Visual*	NONE	NONE	NONE
Sand/Dirt	scalar	Visual*	NONE	NONE	NONE
Appearance	scalar	Visual*	NORML	NORML	NORML
Odor	scalar	Visual*	NORML	NORML	NORML
Emulsified Water	scalar	Visual*	>0.05	NEG	NEG
Free Water	scalar	Visual*		NEG	NEG

FLUID PROPERTIES	method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	46	44.8	44.6

SAMPLE IMAGES	method	limit/base	current	history1	history2
Color					
Bottom					

GRAPHS

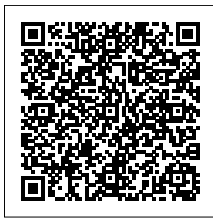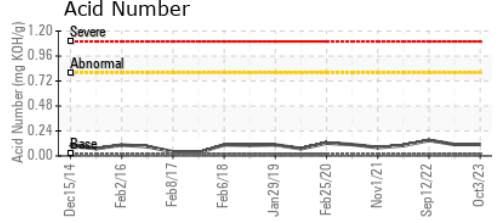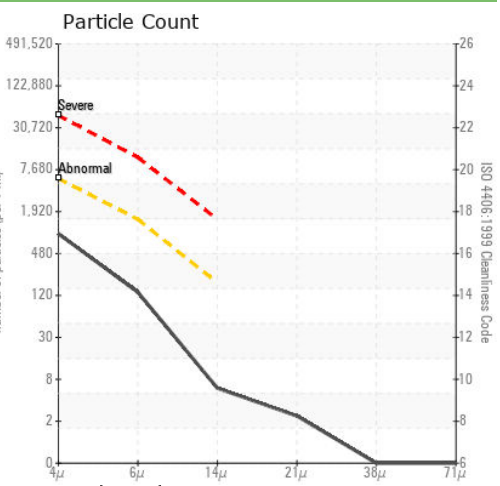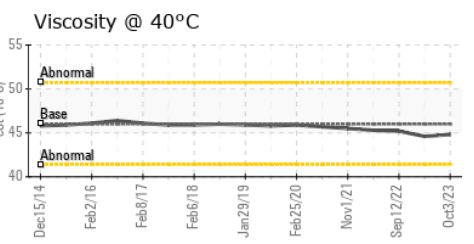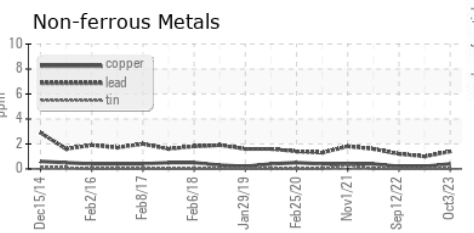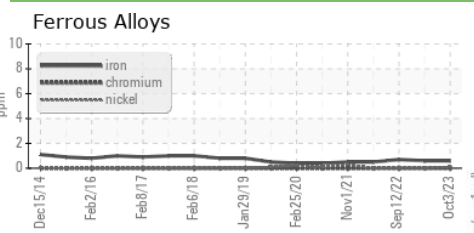

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 **ALGONQUIN POWER SYSTEMS INC.**
Sample No. : WC0862791 **Received** : 06 Oct 2023 **354 DAVIS ROAD**
Lab Number : 02587611 **Diagnosed** : 10 Oct 2023 **OAKVILLE, ON**
Unique Number : 5656677 **Diagnostician** : Wes Davis **CA L6J 2X1**
Test Package : IND 2 (Additional Tests: TAN Man)
 Contact: Antonino Champ Fernando
 antoninoChamp.fernando@algonquinpower.com
 T: (905)465-7065
 F: x:

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.