




OIL ANALYSIS REPORT

Sample Rating Trend

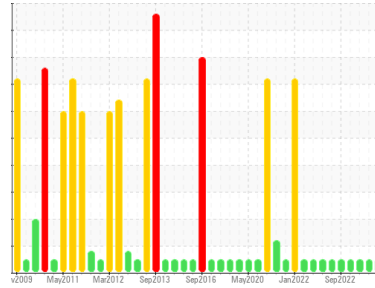

NORMAL



Area
STRATH
 Machine Id
BABBIT BRG PEDESTAL B BALL MILL DRIVE END
 Component
Drive End Bearing
 Fluid
PETRO CANADA TURBOFLO 68 (30 LTR)

DIAGNOSIS

Recommendation

Resample at the next service interval to monitor.

Wear

All component wear rates are normal.

Contamination

There is no indication of any contamination in the oil.

Fluid Condition

The condition of the oil is acceptable for the time in service.

SAMPLE INFORMATION

	method	limit/base	current	history1	history2
Sample Number	Client Info		WC0866183	WC0828553	WC0786837
Sample Date	Client Info		04 Oct 2023	17 Jul 2023	28 Mar 2023
Machine Age	mths	Client Info	6	0	2
Oil Age	mths	Client Info	6	6	2
Oil Changed	Client Info		Not Changed	Not Changed	Changed
Sample Status			NORMAL	NORMAL	NORMAL

WEAR METALS

	method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m) >20	<1	<1	1
Chromium	ppm	ASTM D5185(m) >20	0	0	0
Nickel	ppm	ASTM D5185(m) >20	0	<1	0
Titanium	ppm	ASTM D5185(m)	0	0	0
Silver	ppm	ASTM D5185(m)	<1	<1	0
Aluminum	ppm	ASTM D5185(m) >20	0	0	<1
Lead	ppm	ASTM D5185(m) >20	1	<1	<1
Copper	ppm	ASTM D5185(m) >20	<1	<1	<1
Tin	ppm	ASTM D5185(m) >20	<1	<1	2
Antimony	ppm	ASTM D5185(m)	0	<1	0
Vanadium	ppm	ASTM D5185(m)	0	0	0
Beryllium	ppm	ASTM D5185(m)	0	0	0
Cadmium	ppm	ASTM D5185(m)	0	0	0

ADDITIVES

	method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m) 0	<1	0	0
Barium	ppm	ASTM D5185(m) 0	<1	0	0
Molybdenum	ppm	ASTM D5185(m) 0	0	0	0
Manganese	ppm	ASTM D5185(m) 0	0	0	0
Magnesium	ppm	ASTM D5185(m) 0	0	0	0
Calcium	ppm	ASTM D5185(m) 0	<1	<1	0
Phosphorus	ppm	ASTM D5185(m) 120	5	6	8
Zinc	ppm	ASTM D5185(m) 0.0	2	3	2
Sulfur	ppm	ASTM D5185(m) 50	149	151	171
Lithium	ppm	ASTM D5185(m)	<1	<1	<1

CONTAMINANTS


	method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m) >15	0	0	0
Sodium	ppm	ASTM D5185(m)	<1	0	<1
Potassium	ppm	ASTM D5185(m) >20	0	0	<1

VISUAL

	method	limit/base	current	history1	history2
White Metal	scalar	Visual* NONE	NONE	NONE	NONE
Yellow Metal	scalar	Visual* NONE	NONE	NONE	NONE
Precipitate	scalar	Visual* NONE	NONE	NONE	NONE
Silt	scalar	Visual* NONE	NONE	NONE	NONE
Debris	scalar	Visual* NONE	NONE	VLITE	NONE
Sand/Dirt	scalar	Visual* NONE	VLITE	NONE	NONE
Appearance	scalar	Visual* NORML	NORML	NORML	NORML
Odor	scalar	Visual* NORML	NORML	NORML	NORML
Emulsified Water	scalar	Visual* >2	NEG	NEG	NEG
Free Water	scalar	Visual*	NEG	NEG	NEG




OIL ANALYSIS REPORT



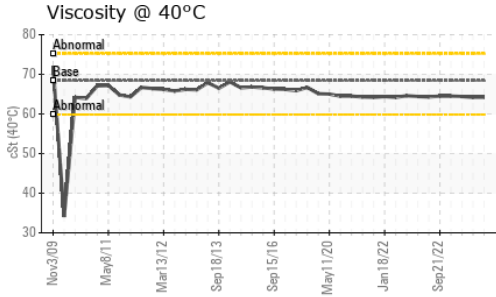


FLUID PROPERTIES		method	limit/base	current	history1	history2
Visc @ 40°C	cSt	ASTM D7279(m)	68.4	64.2	64.2	64.4

SAMPLE IMAGES		method	limit/base	current	history1	history2
---------------	--	--------	------------	---------	----------	----------

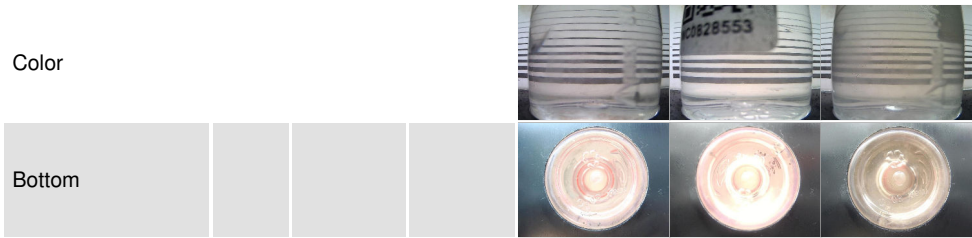

GRAPHS

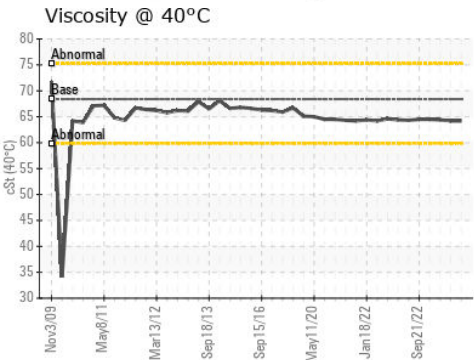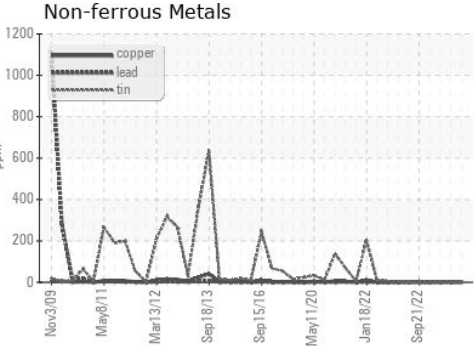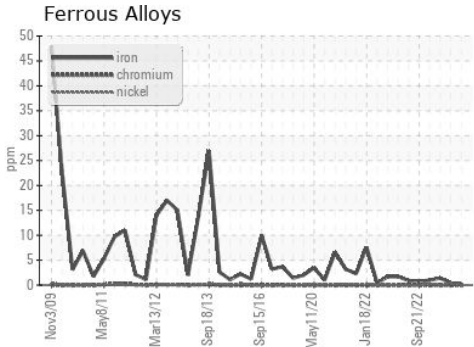

Laboratory : WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Wajax - Northpoint Technical Services
Sample No. : WC0866183 **Received** : 06 Oct 2023 1108 WebbWood Drive.
Lab Number : 02587631 **Diagnosed** : 10 Oct 2023 Sudbury, ON
Unique Number : 5656697 **Diagnostician** : Kevin Marson CA P3C 3B7
Test Package : IND 1

To discuss this sample report, contact Customer Service at 1-800-268-2131.
 Test denoted (*) outside scope of accreditation, (m) method modified, (e) tested at external lab.
 Validity of results and interpretation are based on the sample and information as supplied.

Contact: Nick Walker
 nwalker@northpoints.com
 T: (705)499-2387
 F: (795)690-9010