


# **OIL ANALYSIS REPORT**

Samp





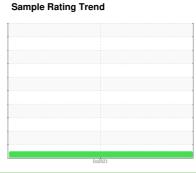

Machine Id T914A Component

Gearbox

SHELL OMALA S2 GX 68 (--- LTR)

#### DIAGNOSIS

#### Recommendation

Resample at the next service interval to monitor. NOTE: Please provide information regarding reservoir capacity, filter type and micron rating with next sample.

#### Wear

All component wear rates are normal.

## Contamination

There is no indication of any contamination in the

## **Fluid Condition**

The AN level is acceptable for this fluid. The condition of the oil is suitable for further service.

		L		Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		WC0864500		
Sample Date		Client Info		05 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
WEAR METALS		method	limit/base	current	history1	history2
PQ		ASTM D8184*		0		
Iron	ppm	ASTM D5185(m)	>200	55		
Chromium	ppm	ASTM D5185(m)	>15	<1		
Nickel	ppm	ASTM D5185(m)	>15	<1		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)		<1		
Aluminum	ppm	ASTM D5185(m)	>25	4		
Lead	ppm	ASTM D5185(m)	>100	<1		
Copper	ppm	ASTM D5185(m)	>200	7		
Tin	ppm	ASTM D5185(m)	>25	0		
Antimony	ppm	ASTM D5185(m)	>5	0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		1		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		0		
Manganese	ppm	ASTM D5185(m)		<1		
Magnesium	ppm	ASTM D5185(m)		<1		
Calcium	ppm	ASTM D5185(m)		10		
Phosphorus	ppm	ASTM D5185(m)		246		
Zinc	ppm	ASTM D5185(m)		5		
Sulfur	ppm	ASTM D5185(m)		7857		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>50	<1		
Sodium	ppm	ASTM D5185(m)		<1		
Potassium	ppm	ASTM D5185(m)	>20	0		


0.59

Acid Number (AN)

mg KOH/g ASTM D974\*



## **OIL ANALYSIS REPORT**

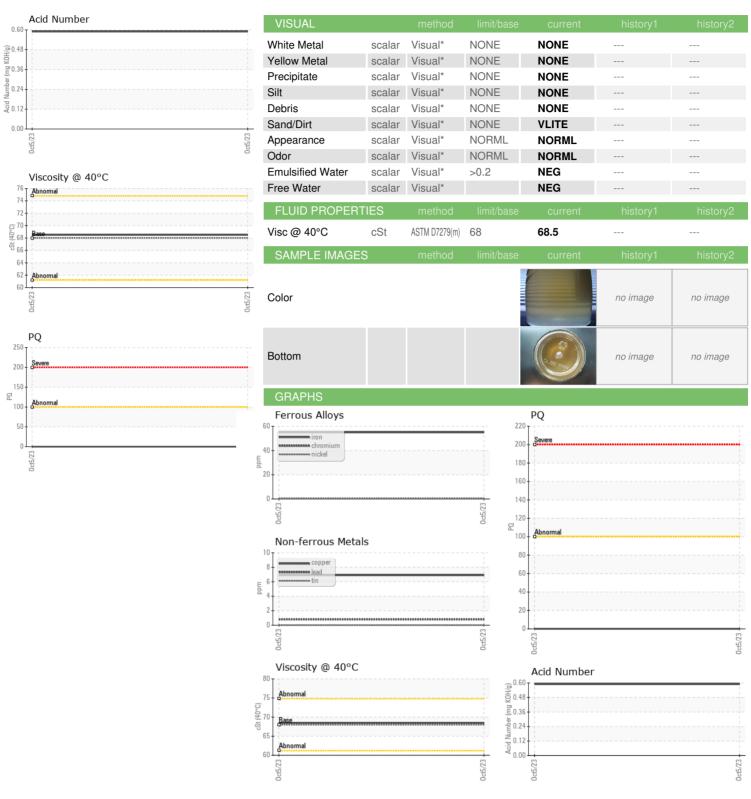



CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 : 02587842

: WC0864500

Received : 5656908

Diagnosed : 10 Oct 2023 : Wes Davis Diagnostician

: 06 Oct 2023

Test Package : IND 2 (Additional Tests: TAN Man) To discuss this sample report, contact Customer Service at 1-800-268-2131.

Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

**HEDDLE SHIPYARDS** 340 LAKESHORE RD ST. CATHARINES, ON

CA L2M 0A2 Contact: Brooke Warren bwarren@heddleshipyards.com T: (905)528-2635

F: