


# **OIL ANALYSIS REPORT**

# Area [132359] WINDSOR HANSPORT WATER

Component **Diesel Engine** 

NOT GIVEN (--- GAL)

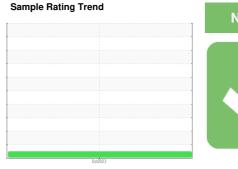



### Recommendation

Resample at the next service interval to monitor. Please specify the component make and model with your next sample. Please specify the brand, type, and viscosity of the oil on your next sample.

### Wear

All component wear rates are normal.

### Contamination

There is no indication of any contamination in the

### **Fluid Condition**

The condition of the oil is acceptable for the time in service.

				Oct2023		
SAMPLE INFORM	MATION	method	limit/base	current	history1	history2
Sample Number		Client Info		CU0021756		
Sample Date		Client Info		04 Oct 2023		
Machine Age	hrs	Client Info		0		
Oil Age	hrs	Client Info		0		
Oil Changed		Client Info		N/A		
Sample Status				NORMAL		
CONTAMINATION	١	method	limit/base	current	history1	history2
Fuel		WC Method	>5	<1.0		
Glycol		WC Method		NEG		
WEAR METALS		method	limit/base	current	history1	history2
Iron	ppm	ASTM D5185(m)	>100	3		
Chromium	ppm	ASTM D5185(m)	>20	0		
Nickel	ppm	ASTM D5185(m)	>4	0		
Titanium	ppm	ASTM D5185(m)		0		
Silver	ppm	ASTM D5185(m)	>3	<1		
Aluminum	ppm	ASTM D5185(m)	>20	<1		
Lead	ppm	ASTM D5185(m)	>40	<1		
Copper	ppm	ASTM D5185(m)	>330	4		
Tin	ppm	ASTM D5185(m)	>15	0		
Antimony	ppm	ASTM D5185(m)		0		
Vanadium	ppm	ASTM D5185(m)		0		
Beryllium	ppm	ASTM D5185(m)		0		
Cadmium	ppm	ASTM D5185(m)		0		
ADDITIVES		method	limit/base	current	history1	history2
Boron	ppm	ASTM D5185(m)		41		
Barium	ppm	ASTM D5185(m)		<1		
Molybdenum	ppm	ASTM D5185(m)		48		
Manganese	ppm	ASTM D5185(m)		0		
Magnesium	ppm	ASTM D5185(m)		803		
Calcium	ppm	ASTM D5185(m)		1200		
Phosphorus	ppm	ASTM D5185(m)		733		
Zinc	ppm	ASTM D5185(m)		839		
Sulfur	ppm	ASTM D5185(m)		2000		
Lithium	ppm	ASTM D5185(m)		<1		
CONTAMINANTS		method	limit/base	current	history1	history2
Silicon	ppm	ASTM D5185(m)	>25	5		
Sodium	ppm	ASTM D5185(m)		3		
Potassium	ppm	ASTM D5185(m)	>20	0		
INFRA-RED		method	limit/base	current	history1	history2
Soot %	%	ASTM D7844*	>3	0		
Nitration	Abs/cm	ASTM D7624*	>20	7.1		
Sulfation	Abs/.1mm	ASTM D7415*	>30	20.4		
FLUID DEGRADA	TION	method	limit/base	current	history1	history2
Oxidation	Abs/.1mm	ASTM D7414*	>25	17.5		



## **OIL ANALYSIS REPORT**





CALA ISO 17025:2017 Accredited Laboratory

Laboratory Sample No. Lab Number Unique Number : 5657252

Test Package : MOB 1

: CU0021756 : 02588186

: WearCheck - C8-1175 Appleby Line, Burlington, ON L7L 5H9 Received : 11 Oct 2023 Diagnosed : 11 Oct 2023

Diagnostician : Wes Davis

To discuss this sample report, contact Customer Service at 1-800-268-2131. Test denoted (\*) outside scope of accreditation, (m) method modified, (e) tested at external lab. Validity of results and interpretation are based on the sample and information as supplied.

**CUMMINS DIESEL** 50 SIMMONDS DRIVE DARTMOUTH, NS CA B3B 1R3

Contact: Maurice Connolly maurice.connolly@cummins.com

T: (902)468-7938 F: (902)468-5177